NOTICE

All drawings located at the end of the document.



Controlled Copy No. 665





ROCKY FLATS

RFP/ER-SAF-94-GMP

ADMIN RECORD

Final Health and Safety Plan Groundwater Monitoring Program



April 1995

DOCUMENT CLASSIFICATION REVIEW WAIVER PER CLASSIFICATION OFFICE

VERSION 0.1

Rocky Flats Environmental Technology Site Golden, Colorado

FINAL GROUNDWATER MONITORING PROGRAM HEALTH AND SAFETY PLAN

RFP/ER-SAF-94-GMP

EG&G ROCKY FLATS PLANT Manual: Revision No.: Page: **Effective Date:** Organization: **Environmental Management** "Health And Safety Plan (HASP), Groundwater Monitoring Program, Rocky Flats Plant," prepared by Golder Associates Inc. This site-specific Health And Safety Plan has been written for the use of EG&G-Rocky Flats, Inc., its employees and subcontractors. Personnel associated with this Project will comply with all aspects of this plan. **REVIEW AND APPROVAL** EG&G Project Manager Health and Safety Liaison Officer Date

Environmental Restoration Health and

Safety Officer

ROCKY FLATS ENVIRONMENTAL

TECHNOLOGY SITE

Manual No.: Section No.

RFP/ER-SAF-94-GMP Table of Contents, R0

Page:

Effective Date:

1 of 1 03/15/95

GROUNDWATER MONITORING PROGRAM HEALTH & SAFETY PLAN

Organization: Environmental Restoration Mgmt

TABLE OF CONTENTS HEALTH AND SAFETY PLAN (HASP) **GROUNDWATER MONITORING PROGRAM**

Section No.	<u>Title</u>	Rev. <u>No.</u>	Effective <u>Date</u>
	Table of Contents	0	03/15/95
1.0	Project Identification	0	03/15/95
2.0	Staff Organization	0	03/15/95
3.0	Site History and Nature of Contamination	0	03/15/95
4.0	Work Activities	0	03/15/95
5.0	Hazard Assessment	0	03/15/95
6.0	General Site-Specific Health and Safety Requirements	0	03/15/95
7.0	Site-Specific Personal Protective Equipment Requirements	0	03/15/95
8.0	Emergency Response Procedures	0	03/15/95
9.0	Logs, Reports, and Recordkeeping	0	03/15/95
10.0	References	0	03/15/95
LT	List of Tables	0	03/15/95
LF .	List of Figures	0	03/15/95
APPA	Appendix A: Responsibilities and Authority of Health and Safety Personnel	0	03/15/95
APPB	Appendix B: Characteristics of Radioisotopes Found at Rocky Flats	0	03/15/95
APPC	Appendix C: List of Chemical Substances Found at Rocky Flats	0	03/15/95
APPD	Appendix D: Example On-the-Job Training	0	03/15/95
APPE	Appendix E: Air Monitoring Survey Results	0	03/15/95
APPF	Appendix F: Special Task Health and Safety Plan	0	03/15/95

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: Page: Effective Date: RFP/ER-SAF-94-GMP

i of viii 3//5/95 Environmental Management

Organization:

TABLE OF CONTENTS

		<u>P</u> :	<u>age</u>
1.0	PRO	JECT IDENTIFICATION	1
2.0	STA	FF ORGANIZATION	2
3.0	SITE	E HISTORY AND NATURE OF CONTAMINATION	3
•	3.1	Rocky Flats	3
		3.1.1 Physical Setting	3
		3.1.2 Site Background	3
		3.1.3 Rocky Flats Operations	4
		3.1.4 Previous Investigations	
		3.1.5 Groundwater Monitoring Program	
	3.2	Creation of the Operable Units and Individual Hazardous Substance Sites	•
		(IHSS's)	7
	3.3	Operable Unit 1 - 881 Hillside	
	3.4	Operable Unit 2 - 903 Pad, Mound, and East Trenches	
	3.5	Operable Unit 3 - Off-Site Releases	
	3.6	Operable Unit 4 - Solar Evaporation Ponds	
	3.7	Operable Unit 5 - Woman Creek Priority Drainage	
	3.8	Operable Unit 6 - Walnut Creek Priority Drainage	
	3.9	Operable Unit 7 - Present Landfill and Inactive Hazardous Waste Storage	
		Area	16
	3.10	Operable Unit 8 - 700 Area	17
	3.11	Operable Unit 9 - Original Process Waste Lines	
	3.12	Operable Unit 10 - Other Outside Closures	19
	3.13	Operable Unit 11 - West Spray Field	21
	3.14	Operable Unit 12 - 400/800 Area	21
	3.15	Operable Unit 13 - 100 Area	
	3.16	Operable Unit 14 - Radioactive Sites	
	3.17	Operable Unit 15 - Inside Building Closures	
	3.18	Operable Unit 16 - Low-Priority Sites	
	3.19	Buffer Zone	
		•	

ROCKY	FLATS	
ENVIRO	NMEN	ΓAL
TECHN(DLOGY	SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

Effective Date:
Organization:

ii of viii

3//5/95

Environmental Management

				Page
4.0	wo	RK .	ACTIVITIES	27
	4.1 4.2		ies	
5.0	HA	ZARD	ASSESSMENT	29
	5.1	Overvi	ew	29
	5.2		Assessment Methodologies and Results	
		5.2.1	Methodology Employed to Assess Encounters with Wildlife, Environmental Extremes, Physical Injuries, and Electrical Shock	
			When Working With Equipment	30
		5.2.2	Methodology Employed to Assess Exposures to Radioisotopes and Nonradioactive Potentially Hazardous Chemicals	30
			5.2.2.1 The Absorption, Injection, and Ingestion Routes of	
			Exposure	31
			5.2.2.2 The Inhalation Route of Exposure	
6.0	GEN	NERAL	SITE-SPECIFIC HEALTH AND SAFETY	
	REG	QUIR	EMENTS	33
	6.1	Medica	al Surveillance	33
	6.2	Safety	Training	33
		6.2.1	40-hour Basic Training	34
		6.2.2	Three-Day On-Site Supervision	
		6.2.3	Radiation Worker Training	
		6.2.4	On-Site Project Manager	
		6.2.5	Site Safety Officer (SSO)	
		6.2.6	Health & Safety Specialist (HSS)	
		6.2.7	Site-Specific Safety Orientation Meeting	
		6.2.8	Periodic Safety Meetings	37

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page: Effective Date: Organization:

iii of viii 3//5/95 Environmental Management

			<u>Page</u>
	6.2.9	Lifting	37
6.3	Visitor	Clearances	38
6.4	Buddy	System	38
6.5	Work	Zones	39
	6.5.1	Exclusion Zone (EZ)	39
	6.5.2	Contamination Reduction Zone (CRZ)	41
		6.5.2.1 RCA Step-off Pad Requirements	41
		6.5.2.2 Non-RCA Step-off Pad Requirements	43
	6.5.3	Support Zone	43
6.6	Field A	Activities	44
	6.6.1	Personnel Requirements/Prohibitions	44
	6.6.2	Contamination/Exposure Prevention	
	6.6.3	On-Site Travel	
	6.6.4	Housekeeping	48
6.7	Person	al Protective Equipment (PPE)	48
	6.7.1	Clothing	49
	6.7.2	Protective-toe Footware, Safety Glasses, and Hard Hats	
	6.7.3	Respirators	50
6.8	Emerg	gency. Equipment	50
6.9	Tempe	rature Stress	51
	6.9.1	Heat Stress	
	6.9.2	Heat Stress Monitoring	
	6.9.3	Cold Stress	
	6.9.4	Cold Stress Monitoring	56

ROCKY	FLATS	
ENVIRO	NMEN?	ΓAL
TECHNO	DLOGY	SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page: Effective Date:

Organization:

iv of viii
3/15/95
Environmental Management

			<u>P</u>	age
•		6.9.5	Training	. 58
	6.10	Work I	During Darkness	. 58
	6.11	Confin	ed Space Work	. 59
	6.12		erstorms and Tornadoes	
	6.13	Hand 7	Tools and Portable Power Tools	60
•		6.13.1	General Requirements	61
		6.13.2	Hand Tool Requirements	61
		6.13.3	Power Tool Requirements	62
	6.14	Electric	cal Safety	64
	6.15	Labora	tory Safety	. 66
			Base Laboratory	
			General Safety	
		6.15.3	Storage and Handling of Chemicals	68
7.0	SITE	E-SPEC	CIFIC PERSONAL PROTECTIVE EQUIPMENT	
			EMENTS	70
	7.1	Introdu	action	70
	7.2	Monito	oring Instruments	71
		7.2.1	Radioactive Substance Monitoring Instruments	71
		7.2.2	Chemical Substance Monitoring Instruments	
	7.3	Monito	oring Strategies	73
		7.3.1	Monitoring for Radioactive Substances	. 73
		7.3.2	Monitoring for Chemical Substances	. 74
			7.3.2.1 Photoionization Detector Monitoring	. 75
			7.3.2.2 Colormetric Detector Tube Monitoring	

ROCKY FLATS	Manual:	RFP/ER-SAF-94-GMP
ENVIRONMENTAL	Revision No.:	0
TECHNOLOGY SITE	Page:	v of viii
	Effective Date:	3/15/95
	Organization:	Environmental Management

Pag	<u>e</u>
7.3.2.3 Combustible Gas Indicator Monitoring	6
al Protective Equipment	7
Clothing	8 9
7.4.2.1 Respiratory Protection Program87.4.2.2 Respirator Decision Logic87.4.2.3 Respirator Action Levels8	1
Personal Protective Equipment Ensembles	3
7.4.3.1 Level D 8 7.4.3.2 Modified Level D 8 7.4.3.3 Level C 8	5
red Levels of Personal Protective Equipment Per Task 8	7
SOP GW.1: Water Level Measurements in Wells and Piezometers 8 SOP GW.2: Well Development	8 9 0 1 12 12 13 14 14 17
	7.3.2.3 Combustible Gas Indicator Monitoring

ROCKY FLATS

Manual:
RFP/ER-SAF-94-GMP
Revision No.:
0
TECHNOLOGY SITE
Page:
Vi of viii
Effective Date:
Organization:
Environmental Management

				<u>Page</u>
		7.5.13	SOP FO.07: Handling of Decontamination Water and Wash Water	98
		7.5.14	SOP FO.11: Field Communications	99
			SOP FO.12: Decontamination Facility Operations	
			SOP FO.13: Containerization, Preserving, Handling	
			and Shipping of Soil and Water Samples	101
		7.5.17		
		7.5.18	SOP FO.15: Photoionization Detectors (PID) and Flame	
			Ionization Detectors (FID)	103
		7.5.19	SOP FO.16: Field Radiological Measurements	103
			SOP FO.18: Environmental Sample Radioactivity Content	
			Screening	104
		7.5.21	SOP FO.19: Base Laboratory Work	
	-	7.5.22	SOP FO.25: Shipment of Radioactive Materials Samples	105
			Special Tasks Conducted by the Groundwater Monitoring Program	
			Subcontractor	106
8.0	EMI	ERGEN	ICY RESPONSE PROCEDURES	107
	8.1	Radio (Communications	107
	8.2		ency Telephone	
	8.3		al Facilities	
	8.4		ency Response Procedures	
		8.4.1	Fire/Explosion	110
		8.4.2	Physical Injury	
		8.4.2	Injury Due to Heat	
		8.4.4	Injury Due to Cold	
		8.4.5	Reporting and Notification	
		8.4.5 8.4.6	Thunderstorms and Tornadoes	
		8.4.7	Other Adverse Weather	
		8.4.8	Electric Shock	
		0.7.0	DICCUIC DICCR	115

	FLATS IMENTAL LOGY SITE	Manual: Revision No.: Page: Effective Date: Organization:	RFP/ER-SAF-94-GMP 0 vii of viii 3//5/95 Environmental Management
	TABLE OF	CONTENTSCon	tinued Page
9.0 LO	GS, REPORTS, AND REC	CORDKEEPING	117
9.1 9.2 9.3 9.4 9.5 9.6	Personnel Records	lth Administration Fo	
	<u>LIS</u>	T OF TABLES	
Table 6-1 Table 6-2 Table 7-1 Table 7-2 Table 7-3 Table 8-1 Table 8-2	Signs and Symptoms of Hear Permissible Heat Exposure L Environmental Management I Action Levels for Nonradioac Task-Specific PPE Requirem Emergency Telephone Numb Emergency Alarms	imits Radiological Guidelinctive Issues nents	nes
	<u>LIS'</u>	T OF FIGURES	
Figure 3-1 Figure 3-2 Figure 8-1	Rocky Flats Site Map Groundwater Monitoring We Medical Facility Map	ell and Piezometer Lo	ocations

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page: Effective Date:

viii of viii 3/15/95

Organization:

Environmental Management

TABLE OF CONTENTS--continued

LIST OF APPENDICES

Appendix A Responsibilities and Authority of Health and Safety Personnel Appendix B Characteristics of Radioisotopes Found at Rocky Flats

Appendix C List of Chemical Substances Found at Rocky Flats

Appendix D Example On-the-Job Training (OJT) Form

Appendix E Air Monitoring Survey Results

Appendix F Special Task Health and Safety Plan

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0 3 of 123

Page:

Effective Date:

3/15/95

Organization:

Environmental Management

3.0 SITE HISTORY AND NATURE OF CONTAMINATION

3.1 Rocky Flats

3.1.1 Physical Setting

The Rocky Flats Environmental Technology Site is located in northern Jefferson County, Colorado, approximately 16 miles northwest of Denver. The cities of Boulder, Broomfield, Westminster, and Arvada are located less than 10 miles to the north, northeast, east, and southeast, respectively. Rocky Flats consists of approximately 6,550 acres of federal land and occupies Sections 1 through 4 and 9 through 15 of Township 2 South, Range 70 West, 6th Principal Meridian. Major plant buildings are located within the Rocky Flats security area of approximately 400 acres. The security area is surrounded by a Buffer Zone of approximately 6,150 acres. Rocky Flats is generally bounded on the north by State Highway 128. To the east is Jefferson County Highway 17, also known as Indiana Street; to the south are agricultural and industrial properties, and State Highway 72; and to the west is State Highway 93. A general map of the site is provided in Figure 3-1.

3.1.2 Site Background

Rocky Flats is a government-owned and contractor-operated facility that is part of the nationwide nuclear weapons production complex. Rocky Flats was operated for the U. S. Atomic Energy Commission (AEC) from Rocky Flat's inception in 1951 until the AEC was dissolved in January 1975. At that time, responsibility for Rocky Flats was assigned to the Energy Research and Development Administration (ERDA), which was succeeded by the Department of Energy (DOE) in 1977. Dow Chemical USA, an operating unit of the Dow Chemical Company, was the



ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

4 of 123 3/15/95

Organization:

Environmental Management

managing and operating contractor of the facility from 1951 until June 30, 1975. Rockwell International succeeded Dow Chemical USA from July 1, 1975 to January 1, 1990, when EG&G-Rocky Flats, Inc. succeeded Rockwell International.

3.1.3 Rocky Flats Plant Operations

Until 1992, Rocky Flat's primary mission was to produce metal components for nuclear weapons. These components were fabricated from plutonium, uranium, and nonradioactive metals, principally beryllium and stainless steel. Parts made at the plant were shipped elsewhere for final assembly. When a nuclear weapon is determined to be obsolete, components of these weapons which had been fabricated at Rocky Flats are returned for special processing which recovers plutonium. Other activities at Rocky Flats include research and development in metallurgy, machining, nondestructive testing, coatings, remote engineering, chemistry, and physics.

3.1.4 Previous Investigations

Various studies have been conducted at Rocky Flats to characterize environmental media and to assess the extent of radiological and chemical contaminant releases to the environment. These have included geological studies, surface water and groundwater studies, and geophysical and radiometric surveys. Several environmental, ecological, and public health studies culminated in the Final Sitewide Environmental Impact Statement (DOE 1980).

In 1986, two major environmental investigations were completed at Rocky Flats. The first was the Comprehensive Environmental Assessment and Response Program (CEARP) Installation Assessment (DOE 1986a), which included analyses and identification of current operational



ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

5 of 123

Effective Date: Organization:

3/15/95 Environmental Management

activities, active and inactive waste sites, current and past waste management practices, and potential environmental pathways through which contaminants could be transported. A number of sites that could potentially have adverse impacts on the environment were identified. These sites were divided into three categories:

- Hazardous waste management units that will continue to operate and need a Resource Conservation and Recovery Act (RCRA) Part A operating permit;
- Hazardous waste management units that will be closed under RCRA interim status;
 and,
- Inactive waste management units that will be investigated and cleaned up under Section 3004 (u) of RCRA or under CERCLA.

The second major environmental investigation completed at Rocky Flats in 1986 involved a hydrogeologic and hydrochemical characterization of the entire Rocky Flats site. Results of these investigations were reported by Rockwell International in 1986. Investigation results indicated four areas to be significant contributors to environmental contamination, with each area containing several sites. Those areas are commonly referred to as the 881 Hillside Area, the 903 Pad Area, the Mound Area, and the East Trenches Area.

3.1.5 Groundwater Monitoring Program

The Groundwater Monitoring Program at Rocky Flats currently includes 510 wells. The actual number of wells monitored varies according to specific program requirements. The program has been designed to protect groundwater, measure the concentrations and rate of transport of hazardous constituents, and to define the extent of any contaminant plumes in the uppermost aquifer within the Rocky Flats boundaries. Three Operable Units (OUs) (the Solar Evaporation

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

6 of 123

Page: Organization:

Effective Date:

/ 15/95 Environmental Managemen

Ponds [OU4], the Present Landfill [OU7], and the West Spray Field [OU11]) at Rocky Flats are subject to Interim Status groundwater monitoring requirements under the Resource Conservation and Recovery Act (RCRA). The remainder of the Rocky Flats OUs are sampled to characterize the groundwater during the Remedial Field Investigation (RFI) activities or do not require a specific groundwater monitoring system, but have been included in the Rocky Flats Groundwater Monitoring Program to supply hydrogeologic and analytical data needed to characterize other areas of Rocky Flats. Groundwater monitoring is currently being accomplished within 12 OUs and the Buffer Zone and at Rocky Flats. The twelve areas are listed below and discussed in subsequent

OU1: 881 Hillside;

subsections of the Section.

- OU2: 903 Pad, Mound, and East Trenches;
- OU3: Off-Site Releases:
- **OU4: Solar Evaporation Ponds**;
- OU5: Woman Creek Priority Drainage;
- OU6: Walnut Creek Priority Drainage;
- OU7: Present Landfill and Inactive Hazardous Waste Storage Areas;
- OU9: Original Process Waste Lines;
- OU11: West Spray Field;
- OU12: 400/800 Area;
- OU13: 100 Area; and,
- OU14: Radioactive Sites.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

7 of 123

Page:

Effective Date: Organization:

Environmental Management

Wells at Rocky Flats are classified into one of six categories, determined by their specific function in the Groundwater Protection and Monitoring Program. The locations of each well and piezometer are shown in Figure 3-2. The six types are defined as follows:

- RCRA Wells Wells that monitor the uppermost aquifer and which are capable of (1) immediately detecting any statistically significant amounts of hazardous waste or hazardous waste constituents that migrate into the uppermost aquifer, and (2) determining the rate and extent of migration of hazardous waste or hazardous waste constituents in the groundwater;
- CERCLA Wells Wells that are used for the characterization of RFI activities as stated in 40 CFR Section 430;
- Boundary Wells The on-site monitoring wells located furthest downgradient of Rocky Flats-affected areas:
- Background Wells Wells that monitor the groundwater in areas upgradient or cogradient of Rocky Flats and that are unaffected by Rocky Flats operations;
- RCRA-Characterization Wells Additional wells in the groundwater monitoring program are used to characterize the groundwater. For example, wells within a RCRA-regulated unit that monitor a hydrostratigraphic unit which is not the uppermost aquifer are characterization wells; and,
- Special Purpose Wells Wells that are sampled at the discretion of EG&G-Geosciences.

3.2 Creation of the Operable Units and Individual Hazardous Substance Sites (IHSS's)

The Draft Installation Assessment under the Comprehensive Environmental Restoration Program (CERP), formerly the Comprehensive Environmental Assessment and Response Program (CEARP) (DOE 1986a), appears to have been the first document to compile a list of potential

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

8 of 123

Effective Date: Organization:

Environmental Management

hazardous waste sites at Rocky Flats. The Assessment also attempted to prioritize the sites on the basis of EPA's Hazard Ranking System (HRS) and DOE's Modified HRS scoring. High priority sites, such as the 881 Hillside, were recommended for further investigation. In response to the recommendation, remedial investigations commenced at the high priority sites. The RCRA Part B Permit Application (DOE 1986b, DOE 1986c) for Rocky Flats was completed in November 1986 for Rocky Flats hazardous waste management units that would continue to operate. Appendix 1 of the permit application (DOE 1987), RCRA 3004 (u) Waste Management Units, defined the inactive waste sites as solid waste management units (SWMUs). A plan for investigating the remaining sites, referred to as the low priority sites, was prepared in 1988. This plan identified 103 low priority SWMUs and recommended appropriate additional investigations. The plan also presented groups of SWMUs based on their geographical locations, similar contaminants, and applicable pathways. The SWMUs were combined into ten Operable Units (OUs) in the Draft Interagency Agreement (IAG) (IAG 1990).

Additional SWMUs were added to the IAG based on the Part B RCRA application and independent reviews of aerial photographs and facility submittals. A total of 178 SWMUs were identified. The ten OUs were reprioritized and divided into sixteen OUs (Operable Units 1 through 16) in the final IAG (1991). The SWMUs were also renamed Individual Hazardous Substances Sites (IHSS's) in the final IAG. The term IHSS is used in the remainder of this Section.

3.3 Operable Unit 1 - 881 Hillside

Information on the nature and extent of contamination is taken from the Final Phase III RFI/RI Work Plan, Rocky Flats Plant, 881 Hillside Area Operable Unit No. 1 (DOE 1990). Section 2.3.1

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page: Effective Date:

9 of 123 3/15/95

Organization:

Environmental Management

of that Work Plan describes how background levels of chemical constituents were calculated. Section 2.3 and the Appendixes of that Work Plan present available analytical data.

Phase I and Phase II soils investigations indicated tetrachloroethane, trichloroethene, and 1,1,1-trichloroethane contamination in some samples at the 881 Hillside. Plutonium and americium were detected above background in soil samples that include the ground surface; however, windblown dust from the 903 Pad (OU2) is the suspected source of these radionuclides. Tetrachloroethane and trichloroethene are the principle volatile organic compounds which have been detected in surface water samples in the area. Numerous metals and other inorganic compounds have occasionally been above background. Gross alpha, gross beta, uranium, and plutonium exceed background in many of the surface water samples.

Groundwater is contaminated in both the eastern and western portion of the 881 Hillside. The most pronounced organic contamination is in the eastern portion of the Hillside area, with tetrachloroethane, trichloroethene, 1,1-dichloroethene, 1,1-dichloroethane, 1,1,1-trichloroethane, 1,1,2-trichloroethane, and carbon tetrachloride reaching several thousand micrograms per liter in many samples. Organic contamination in the western portion of the 881 Hillside area occurs at much lower concentrations. Concentrations of metals and inorganic constituents in the eastern portion of the study area include numerous occurrences of nickel, strontium, selenium, zinc, copper, and uranium above background.

3.4 Operable Unit 2 - 903 Pad, Mound, and East Trenches

Information on the nature and extent of contamination is taken from the Phase II RFI/RI Work Plans for Alluvial and Bedrock, 903 Pad, Mound, and East Trenches Areas (Operable Unit 2)

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

0 10 of 123

Effective Date: Organization:

3/15/95 Environmental Management

(DOE 1991a, DOE 1991b). Section 2.3 of the Work Plan describes how background levels of

available analytical data.

Plutonium and americium occur above background in surface soils. Other radionuclides and trace metals occur at low concentrations and are infrequently above background but may also be soil contaminants. Data suggest plutonium and americium were released to soils in the area via wind dissemination during clean-up efforts at the 903 Drum Storage Site.

chemical constituents were calculated. Section 2.3 and the Appendixes of the Work Plan present

Based on existing results, carbon tetrachloride, tetrachloroethane, and trichloroethene are the primary volatile organic contaminants found in the upper hydrostratigraphic unit groundwater flow system. Trace elements commonly occurring above background in groundwater include strontium, barium, copper, and nickel, and to a lesser extent, chromium, manganese, selenium, lead, zinc, and molybdenum. Also, major cations and anions and total dissolved solids are somewhat elevated above background throughout and downgradient of the OU. Uranium-238 is the predominant radionuclide occurring above background in the upper groundwater, but a few samples indicate plutonium and americium downgradient of the 903 Pad and possibly north of the Mound.

There is considerable interaction between surface water and groundwater. As a result, organic contamination is observed in seeps downgradient of the 903 Pad and in the upper reaches of South Walnut Creek at the Mound Area. Also, somewhat elevated concentrations of total dissolved solids, major ions, strontium, zinc, and uranium are present at many of the surface water stations. Plutonium and americium are also observed in two seeps downgradient of the 903 Pad and in the

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

0 11 of 123

Effective Date: Organization:

3/15/95 Environmental Management

upper reaches of South Walnut Creek. This may be attributed to the water from the seeps coming in contact with surface soils exhibiting elevated concentrations of these radionuclides.

3.5 Operable Unit 3 - Off-Site Releases

Information on the nature and extent of contamination is taken from Final RFI/RI Work Plan for Operable Unit 3, Rocky Flats Plant (DOE 1991c).

IHSS 199, Contamination of the Land's Surface, is comprised of 350 acres of land with concentrations of plutonium greater than 0.9 picocuries per gram. Hot spots may occur outside the designated acreage; however, it is reasonable to assume that areas outside the designated acreage contain lower concentrations of plutonium than the designated areas. Remediation has been implemented on 120 of the 250 acres of contaminated land owned by Jefferson County. Tilling of the 120 acres resulted in soil concentrations below the mandated cleanup level. Revegetation of this land is in progress. Very few data exist for contaminants other than plutonium.

Sampling at Great Western Reservoir (IHSS 200) indicates that layers of sediment containing plutonium above background levels are present in the bottom of the reservoir. Plutonium exists in discrete sediment horizons (at depths of 17 inches and 7.5 inches) corresponding to historical releases from Rocky Flats. The highest concentrations are found in the deepest areas of the reservoir. There is no evidence of plutonium migration through the sediment column. Concentrations of plutonium and other radionuclides in water at the reservoir are below background levels and/or EPA drinking water standards.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

0 12 of 123

Effective Date:

3/15/95

Organization:

Environmental Management

Radioactive materials released from Rocky Flats may have been transported to Standley Lake (IHSS 201) through surface water and/or airborne particulates. Plutonium has been measured in sediment in the lake. The concentrations in the sediment layers exceeded baseline levels beginning in the 1966 layer, peaked in 1969, and declined after 1969. The time period correlates with the known period of windblown plutonium release from the 903 Pad at Rocky Flats. Studies of the sediments concluded that plutonium rapidly and almost irreversibly attaches itself to clay sediments. In 1974, Battelle conducted an investigation of radionuclide concentrations in reservoirs and streams near Rocky Flats. Concentrations of plutonium-239, plutonium-240, and americium-241 in the water at the lake were above the expected atmospheric fallout background, which was not specifically quantified in the study, but were more than four orders of magnitude below EPA National Primary Drinking Water Regulation of 15 pCi/L for total long-lived alpha activity.

Only very limited data have been collected to characterize Mower Reservoir (IHSS 202). Rocky Flats-derived contaminants in the reservoir are believed to have been transported primarily as airborne particulates, and, to a lesser degree, by surface water through the Woman Creek drainage. It can be inferred that contaminant concentrations resulting from releases into Woman Creek would be similar for Mower Reservoir and Standley Lake, while concentrations resulting from airborne releases and from erosion and transport of contaminated soils by surface runoff would be similar for Mower Reservoir and Great West Reservoir. It is expected that Mower Reservoir received similar amounts of plutonium through airborne transport as the nearby land surface.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0 13 of 123

Page: Effective Date: Organization:

3/15/95 Environmental Management

3.6 Operable Unit 4 - Solar Evaporation Ponds

Information on the nature and extent of contamination is taken from the Draft Final Phase I RFI/RI Work Plan (DOE 1991d) and Environmental Assessment, Dewatering and RCRA Partial Closure Action on Solar Evaporation Ponds, Rocky Flats Plant (DOE 1991e). Section 2.5 of the Work Plan describes the calculation of background concentration and summarizes the chemical data for OU4.

Liquids and sludges in the Solar Evaporation Ponds contain detectable levels of the radionuclides plutonium, americium, tritium and uranium. Metals of interest in the liquids and sludges include beryllium, cadmium, chromium and nickel. Nitrates are also a major constituent of the liquids and sludges. Soil samples in the vicinity of the solar ponds contain concentrations of chromium, nickel, nitrate, potassium, sodium, calcium, magnesium, and radionuclides that are likely attributable to the Solar Ponds. Low levels of nitrates and radionuclides have been detected in both alluvial and bedrock groundwater. Surface water in the form of seeps near the solar ponds contains nitrate, metal and radionuclides.

3.7 Operable Unit 5 - Woman Creek Priority Drainage

Information on the nature and extent of contamination is taken from Section 2.0 of the Final Phase I RFI/RI Work Plan, Woman Creek Priority Drainage (Operable Unit No. 5) (DOE 1991f).

The Original Landfill (IHSS 115) received numerous materials during its operation. Chemicals that may have been placed in the Original Landfill include commonly used solvents, such as

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0 14 of 123

Page:

Effective Date: Organization:

Environmental Management

trichloroethylene, carbon tetrachloride, tetrachloroethylene, petroleum distillates, 1,1,1-trichloroethane, dichloromethane, benzene, paint and paint thinners. Metals such as beryllium, uranium, lead, and chromium may also be present. Radiological surveys of the area have indicated the presence of radionuclides, and some soil containing uranium was previously removed from the Original Landfill. Metals and radionuclides have been detected in groundwater near the Original Landfill.

The nature and extent of contamination at the Ash Pits, Incinerator and Concrete Wash Pad (IHSS's 133.1 through 133.6) are not well known. General combustible wastes from Rocky Flats were burned in the incinerator along with as estimated 100 grams of depleted uranium. Metals were detected in Ash Pit 3. Metals and radionuclides have been detected in groundwater wells near the Ash Pits.

Detention ponds C-1 and C-2 have been regularly sampled in recent years. Water in the ponds is known to contain detectable concentrations of metals and radionuclides, but background levels have not been determined for the Woman Creek area. Sediment samples also contain measurable metals and radionuclides.

3.8 Operable Unit 6 - Walnut Creek Priority Drainage

Information on the nature and extent of contamination is taken from Section 2.0 of the Final Phase I RFI/RI Work Plan, Walnut Creek Priority Drainage (Operable Unit No. 6) (DOE 1991g).

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

Page:

15 of 123

Effective Date: Organization:

Environmental Management

Ponds A-1 and A-2 contain radionuclides including plutonium and uranium in both the water and the sediments. Pond A-3 is reported to contain elevated uranium-233/234 and uranium-238 concentrations like Pond A-2. Water quality in Pond A-4 is similar to background levels. Pond B-1 has moderately elevated uranium-233/234 and uranium-238 concentrations, and plutonium is reported in both the water and the sediments. Pond B-2 water contains background levels for the various radionuclides except plutonium. Pond B-3 has detectable plutonium as well as zinc and nitrates. Ponds B-4 and B-5 have detectable levels of uranium-233/234 and 238. Ground water in the vicinity of the A- and B-series ponds contain several metals and radionuclides above detection limits but these concentrations could represent background levels.

No previous studies have been conducted at the four spray fields. However, analytical results from water samples collected from the East and West Landfill Ponds provide significant data regarding the North, South and Pond Area Spray Fields (IHSS's 167.1-3). Strontium and tritium were detected in the Landfill Ponds water. In addition, minor organics and several metals and radionuclides have been reported in surface water and groundwater samples collected near the spray fields. Analytical data from Pond B-3 water provides data regarding the East Area Spray Field (IHSS 216.1). Radionuclides and metals have been detected in the water from Pond B-3.

Only one previous soils investigation has reportedly been conducted at Trench A. Uranium-233/234 and 238, and several volatile organics were detected in the soils. Metals, radionuclides and one volatile organic compound have been detected in groundwater in the vicinity of the trenches. No previous studies have been conducted at the Sludge Dispersal Area (IHSS 141). A potential for contamination within the drying beds by a variety of chemicals in the sludge, particularly plutonium, is possible. Volatile organics, metals, and radionuclides have been detected in groundwater and surface water samples downgradient of the IHSS.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

0 16 of 123

Effective Date: Organization:

Environmental Management

At the Triangle Area (IHSS 165), previous radiometric soil surveys have indicated the presence of radionuclides. The contaminated soils were removed on several occasions following the soil surveys. Metals, radionuclides and organic compounds have been detected in groundwater near the area.

Previous soils investigations at the Old Outfall (IHSS 143) reported elevated levels of plutonium and organics. Contaminated soils were removed from the site in 1971. Metals and radionuclides have been detected in surface water samples taken downgradient of the IHSS.

No previous investigations have been completed at the Soil Dump Area. The soils may contain plutonium.

3.9 Operable Unit 7 - Present Landfill and Inactive Hazardous Waste Storage Area

Since little direct characterization of the types of contaminants in the landfill or inactive storage area has been conducted to date, most of what is known is based on waste stream identification studies and groundwater and surface water quality monitoring (DOE 1991h). Previous evaluations of groundwater quality from wells at the periphery of the landfill indicate the landfill contributes calcium, bicarbonate, and, to a lesser extent, sulfate, iron, manganese, zinc, and strontium to the groundwater. Volatile contamination, primarily trichloroethylene and 1,1,1-trichloroethane, has been found sporadically and at low concentrations in groundwater in some areas at the landfill periphery. Elevated uranium and tritium levels also exist in some areas. Soil contamination has not been characterized, but it may be reasonable to assume that the nature of contamination is similar to the groundwater contamination.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

17 of 123 3/15/95

Organization:

Environmental Management

The primary mechanism for release of contaminants from the Present Landfill into the affected media appears to be by percolation of groundwater (leachate) through the wastes and then out of the landfill. Groundwater flow exiting the wastes can potentially distribute contamination vertically downward and laterally downgradient.

3.10 Operable Unit 8 - 700 Area

Since previous investigations have not been conducted at these units, the nature and extent of contamination is based on materials stored at the sites and on previous site uses. (Rockwell International 1988, DOE 1987, DOE 1992a, DOE 1992b.)

Materials stored in the tanks involved in the Multiple Solvent Spills (IHSS's 118.1 and 188.2) included carbon tetrachloride, petroleum distillates, paint thinners, 1,1,1-trichloroethane and methyl ethyl ketone. Process wastes, typically containing uranium, solvents, oils, beryllium, nitric acid, hydrochloric acid, and fluoride, were released from Valve Vault 7 (IHSS 123.1). Cooling Tower Blowdown from IHSS's 135, 137, and 138 typically contained algicides and chromates. The 1976 spill from IHSS 138 also contained some radioactivity. The 1990 spill from IHSS 138 contained phosphates. Materials stored in the tanks involved in the Caustic/Acid Spills (IHSS's 139.1 and 139.2) included hydrochloric, hydrofluoric, nitric and sulfuric acids, and sodium hydroxide and potassium hydroxide. Spills of #2 fuel oil were the cause of IHSS 151, Fuel Oil Leak. A spill of a mixture of nitric and hydrochloric acid was the cause of the Acid Leak (IHSS 188).

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0 18 of 123

Page: Effective Date:

3/15/95

Organization:

Environmental Management

The Sewer Line Break (IHSS 144) involved the release of radioactive laundry wastewater. The radioactive Liquid Leaks (IHSS 150.1-8) were primarily releases of liquid process wastes containing radioactive compounds and solutions containing caustics and acids.

The Radioactive Sites - 700 Area (IHSS 163.1 and 163.2) and Radioactive Sites - 900 Area (IHSS 173) may have been contaminated with radioactive compounds including americium. No radioactivity above background levels has been detected by radiometric surveys of the IHSS 163 locations. Radioactivity has been measured at IHSS 173. Radiometric surveys have not detected radioactivity above background levels at the Building 991 Steam Cleaning Area (IHSS 184). The Central Avenue Waste spill (IHSS 172) consisted of less than 100 gallons of plutonium contaminated oils and oils with lathe coolant (hydraulic oil and carbon tetrachloride).

3.11 Operable Unit 9 - Original Process Waste Lines (OPWL)

Information on the nature and extent of contamination is taken from Draft Final Phase I RFI/RI Work Plan, Original Process Waste Lines (Operable Unit No. 9) (DOE 1991i).

Low-level radioactive aqueous wastes with high nitrate concentrations were a primary OPWL waste stream. Volatile and semivolatile organics were transferred through the OPWL in small quantities. Numerous acids were discharged to the OPWL, as well as bases, metals, and small quantities of other liquids, including pickling liquor from foundry operations, medical decontamination fluids, miscellaneous laboratory wastes, and laundry effluent. Releases from the OPWL and associated IHSS's may have occurred as a results of leakage, deterioration of pipes,

ROCKY FLATS **ENVIRONMENTAL** TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

19 of 123

Page:

Effective Date:

Organization:

Environmental Manageme

breakage, and overflows. The lateral and vertical extent of releases are not precisely known but are expected to be largely confined to the pipeline trench backfill materials and adjacent soils.

3.12 Operable Unit 10 - Other Outside Closures

Information on the nature and extent of contamination is taken from Draft Final Phase I RFI/RI Work Plan, Rocky Flats Plant, Other Outside Closures (Operable Unit No. 10) (DOE 1991j).

Analytical results for soil samples taken in the vicinity of the Oil Leak (IHSS 129) indicate the presence of organics including 1,1,1-trichloroethane, methylene chloride, benzene, toluene, ethylbenzene, 2-butanone, and total xylenes, and metals including mercury, cadmium, copper, and lead. Radionuclides were not tested. Groundwater data are not available for this site.

No previous investigations have been performed at the P.U.&D. Storage Yard (IHSS 170) so the nature and extent of contamination is unknown. Soil sampling has been conducted at the Waste Spills (IHSS 174). Soils contain concentrations of volatile organics, metals, nitrates, and radionuclides above background levels. Acetone, methylene chloride and nitrate/nitrite were detected in a groundwater sample from a well northeast of IHSS's 170 and 174.

Soil samples were collected in the S&W Building 980 Container Storage Facility (IHSS 175) area in 1988. Volatile organics, metals, nitrate, and radionuclides were detected above background levels in the samples. No groundwater data are known to have been collected.

Analysis of soil samples taken from borings in the S&W Contractor Storage Yard (IHSS 176) . indicate levels of volatile organics, metals, nitrate, and radionuclides above background

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

0 20 of 123

Effective Date: Organization:

3/15/95 Environmental Management

concentrations. Groundwater data from an upgradient well indicate the presence of metals, other inorganics, and radionuclides above background levels.

Potential contaminants at IHSS 207, Former Building 444 Acid Dumpsters, are cadmium, chromium, lead, silver, and radionuclides. No previous soil or water sampling investigations have been performed at the IHSS.

No previous investigations have been conducted at the Inactive 444/447 Waste Storage Area (IHSS 208) or Unit 16, Building 980 Cargo Container (IHSS 210), so no information is available concerning the nature and extent of contamination.

Analysis of soil samples taken in the area of the Unit 15, 904 Pad Pondcrete Storage Area (IHSS 213) indicated levels above background for gross alpha, gross beta, total plutonium, total uranium, uranium-234, uranium-238, americium-241, and plutonium-239. In addition, analysis of surface water samples taken in the area of IHSS 213 indicates levels above background for nitrate, cyanide, and cadmium. Further data are needed to assess groundwater contamination.

Soil samples taken from the Unit 25, 750 Pad Pondcrete and Saltcrete Storage Area (IHSS 214) indicate levels above background for gross alpha and gross beta. Surface water samples have levels above background for nitrate, cyanide, and cadmium. Further data are needed to assess groundwater contamination.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

21 of 123

Effective Date: Organization:

Environmental Management

3.13 Operable Unit 11 - West Spray Field

Information on the nature and extent of contamination is taken from Final Phase I RFI/RI Work Plan for OU11 (West Spray Field), Rocky Flats Plant (DOE 1991k).

The source of contamination to the West Spray Field is the liquids from the Solar Evaporation Ponds that were sprayed at the spray field. The liquids are known to contain major ions, radionuclides, metals, and some organics. Previous sampling has been done at the West Spray Field, and the results have been compared to background levels in the area.

Soil samples from the spray field show slightly elevated levels of arsenic, lead, manganese, mercury, zinc and several volatile organic compounds. Gross alpha, plutonium, uranium-233, -234, and -238 are also above background levels in soils. Groundwater monitoring wells have been installed in the West Spray Field. Alluvial groundwater quality is affected sporadically by several metals, radionuclides, nitrate, and tetrachloroethylene. Two of the three bedrock wells have occasionally exhibited above-background concentrations of magnesium, strontium, and manganese. The radionuclides and volatile organic compounds were not elevated. Surface water sampling has not been done at the West Spray Field.

3.14 Operable Unit 12 - 400/800 Area

Since previous investigations have not been conducted at these units, the nature and extent of contamination is based on materials stored at the sites and previous site uses (Rockwell International 1988, DOE 1992a).

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

22 of 123

Page: Effective Date: Organization:

Environmental Management

Releases of radionuclides from buildings adjacent to the Multiple Solvent Sites (IHSS's 116.1 and 116.2) may have resulted in soil contamination at these sites. Since the actual contents of the drums stored on the loading docks are unknown, it is assumed that volatile organic compounds may have been stored and may have leaked in the dock areas.

At the Building 664 Fiberglassing Areas (IHSS's 120.1 and 120.2), the chemicals of interest are believed to be polyester resins (styrene monomer) and cleaning solvents. Also, an area of significantly high radiation was measured directly west and overlapping the site.

The potential contaminant at the Cooling Tower Ponds (IHSS's 136.1 and 136.2) is chromium. Blowdown discharged to the ponds contained chromium and algicides. Uranium may also be buried at the pond sites.

The Process Waste Leaks (IHSS 147.2) area may have been contaminated by infiltration of water that contacted equipment stored at the site. The Radioactive Site South Area (IHSS 157.2) may be contaminated by uranium, beryllium and solvents. Plutonium may also be present. Contamination is not expected at the Acid Leak sites (IHSS 187) or the Multiple Acid Spills (IHSS 189) since the acid was likely neutralized in the soil.

3.15 Operable Unit 13 - 100 Area

Since previous investigations have not been conducted at these units, the nature and extent of contamination is based on materials stored at the sites and previous site uses (Rockwell International 1988, DOE 1992a).

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

0 23 of 123

Effective Date:

3/15/95

Organization:

Environmental Management

The Chemical Storage Sites (IHSS 117.1-3) were used for storage of acids, organic solvents, soaps, and oils. These materials are assumed to be the potential contaminants at these IHSS's.

The Oil Burn Pit No. 1 Waste Leak (IHSS 128) is a pit area that contains approximately 70 cubic feet of depleted uranium. The Lithium Metal Destruction Site (IHSS 134) may contain residues of lithium and small amounts of sodium, calcium, and magnesium. The lithium has likely reacted with the soil to form lithium carbonate. Radionuclides may have been spilled at the Waste Spill (IHSS 148) site, although radioactive surveys of the area have found radioactivity levels consistent with background levels.

Fuel oil is the potential contaminant at the Fuel Oil Tank Spill (IHSS 152). The Radioactive Site South Area (IHSS 157.1) may be contaminated by uranium, beryllium and solvents. Plutonium may also be present. The Radioactive Site - Building 551 (IHSS 158) is suspected of being contaminated with uranium. The Waste Drum Peroxide Burial (IHSS 169) may still contain peroxide, which can be an explosion hazard. The site is not considered to be a chemical hazard. Residues of the burning of waste solvents are the concern at the Solvent Burning Ground (IHSS 171).

Radioactive process waste may have contaminated the Valve Vault 12 (IHSS 186) area. Sodium hydroxide is the potential contaminant at IHSS 190, the Caustic Leak. However, it is likely that any sodium hydroxide remaining in the environment would have been neutralized by the buffering action of the soil. The soil also would have buffered any remaining hydrogen peroxide from the Hydrogen Peroxide Spill (IHSS 191).

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

24 of 123

Effective Date: Organization:

3/15/95 Environmental Management

3.16 Operable Unit 14 - Radioactive Sites

Since previous investigations have not been conducted at these units, the nature and extent of contamination is based on materials stored at the sites and previous site uses (Rockwell International 1988, DOE 1992a).

Radioactive Site #1 - 700 Area (IHSS 131) and Radioactive Burial Site - Building 334 Parking Lot (IHSS 156.1) may have been contaminated by plutonium. Small amounts of plutonium and uranium may have remained at the Building 444 Parking Lot (IHSS 160) and Building 664 (IHSS 161); however, no radioactivity above background levels was detected during the radiometric survey of the area. The radioactive hot spots in the pavement on 8th Street may still exist as Radioactive Site #2 - 700 Area (IHSS 162). Radioactivity may also exist at the Radioactive Sites in the 800 Area (IHSS 164.1-3).

3.17 Operable Unit 15 - Inside Building Closures

Since previous investigations have not been conducted at these units, the nature and extent of contamination is based on materials stored at the sites and previous site uses (DOE 1988, DOE 1987, DOE 1992a).

Hazardous wastes such as volatile organic compounds and low-level radioactive waste oil have been stored in the Building 881 Drum Storage Area (IHSS 178). Waste oil contaminated with beryllium, and chlorinated solvents have been stored in the Building 865 Drum Storage Area (IHSS 179). Waste oil contaminated with volatile organic compounds, beryllium and radioactivity have been stored at the Building 883 Drum Storage Area (IHSS 180).

ROCKY FLATS **ENVIRONMENTAL** TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

25 of 123

Page:

Effective Date:

3/*15/95*

Organization:

Environmental Managemen

Uranium chips, coated with freon TF and 1,1,1-trichloroethane, were handled in the Original Chip Roaster (IHSS 204). The freon and 1,1,1-trichloroethane burned away during the roasting process.

Low-level radioactive mixed wastes, including low-level combustibles, low-level metal and glass, low-level combustible hazardous waste and low-level glass and metal hazardous waste, were stored at Unit 26, Building 881 Drum Storage (IHSS 211). Transuranic wastes and solvents such as carbon tetrachloride, 1,1,1-trichloroethane, and toluene are stored in Unit 63, Building 371 Drum Storage (IHSS 212). Up to 4 liters of cyanide- contaminated laboratory wastes were stored in Unit 32, Building 881 Cyanide Bench Scale Treatment (IHSS 217).

3.18 Operable Unit 16 - Low-Priority Sites

Since previous investigations have not been conducted at these units, the nature and extent of contamination is based on materials stored at the sites and previous site uses (Rockwell International 1988, DOE 1992a).

The Solvent Spill (IHSS 185) was a spill of 1,1,1-trichloroethane. The Antifreeze Discharge (IHSS 192) was a spill of ethylene glycol. The spill was contained in Pond B-1. The Steam Condensate Leak (IHSS 193) contained amines. The Steam Condensate Leaks (IHSS 194) contained tritium. Nickel carbonyl is highly volatile and long-term environmental hazard would not result from the Nickel Carbonyl Disposal (IHSS 195).

Based on past uses, the water in the Water Treatment Plant Backwash Pond (IHSS 196) would have contained flocculates (aluminum sulfates and lime), residual chlorine, and suspended solids. Transformers containing PCBs may have been disposed at the Scrap Metal Sites (IHSS 197).

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0 26 of 123

Page: Effective Date:

3/15/95

Organization:

Environmental Management

3.19 Buffer Zone

For the purposes of this Health and Safety Plan, the Buffer Zone is considered to be an area that is not located within either an IHSS or a RCRA-regulated area, does not contain a groundwater contamination plume, and is not considered to be a radiologically controlled area due to surficial soil contamination.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0 7 of 123

Effective Date:

3/15/95

Organization:

Environmental Management

4.0 WORK ACTIVITIES

4.1 <u>Introduction</u>

This Health And Safety Plan (HASP) covers the Groundwater Monitoring Program activities listed in Subsection 4.2 when they are accomplished at Rocky Flats.

4.2 Activities

Procedures for accomplishing the activities covered by this HASP are contained in the EG&G Environmental Management Department (EMD) Operating Procedures Manual (OPM)

Number 5-21000-OPS-FO, Volume I: Field Operations; and EMD OPM Number 5-21000-OPS-GW, Volume II: Groundwater. This HASP addresses activities described in the following EMD OPM standard operating procedures (SOPs) as listed below. Additional SOPs related to the Groundwater Sampling Program will be added to the following list as they are developed and approved. The listed SOPs are incorporated in this HASP by reference.

EG&G ROCKY FLATS PLANT

Manual:

RFP/ER-SAF-94-GMP

Revision No.:

0

Page:

28 of 123

Effective Date: Organization:

3/15/95 Environmental Management

PROCEDURE NUMBER	TITLE		
SOP FO.01	Air Monitoring and Dust Control		
SOP FO.02	Field Document Control		
SOP FO.03	General Equipment Decontamination		
SOP FO.05	Handling of Purge and Development Water		
SOP FO.06	Handling Personal Protective Equipment		
SOP FO.07	Handling of Decontamination Water and Wash Water		
SOP FO.11	Field Communication		
SOP FO.12	Decontamination Facility Operations		
SOP FO.13	Containerization, Preserving, Handling, and Shipping of Soil and Water Samples		
SOP FO.14	Field Data Management		
SOP FO.15	Photoionization Detectors (PIDs) and Flame Ionization Detectors (FIDs)		
SOP FO.16	Field Radiological Measurements		
SOP FO.18	Environmental Sample Radioactivity Content Screening		
SOP FO.19	Base Laboratory Work		
SOP FO.25	Shipment of Radioactive Materials Samples		
SOP GW.01	Water Level Measurements in Wells and Piezometers		
SOP GW.02	Well Development		
SOP GW.03	Pump-in Borehole Packer Testing		
SOP GW.04	Slug Tests		
SOP GW.05	Field Measurements of Groundwater Field Parameters		
SOP GW.06	Groundwater Sampling		
SOP GW.08	Aquifer Pumping Tests		

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0 29 of 123

Effective Date: 3/15/95
Organization: Environmental Management

5.0 <u>HAZARD ASSESSMENT</u>

5.1 Overview

A review of Rocky Flats history, previous studies of the regional animal life and climate, results of previous site investigations, and the general industry-wide experience with using heavy equipment indicate that there are several sources of potential hazards to be assessed. The potential hazards have been placed into one of six classifications listed below.

- Encounters with native wildlife including insects.
- Climatic conditions such as temperature extremes, thunderstorms (lightning), and high winds.
- Physical injury when working with light equipment, handling drums, and operating vehicles.
- Electrical shock when working with equipment.
- Exposure to radioisotopes such as plutonium, americium, and uranium in groundwater and wind-blown dust via absorption, injection, ingestion and inhalation. Appendix B provides information regarding the characteristics of radioisotopes that may be encountered. Appendix B also contains Table B-1, which includes the maximum and minimum radioactivity concentration per radioisotope that has been reported at Rocky Flats.
- Exposure to nonradioactive potentially hazardous substances such as metals and volatile organic compounds in groundwater and wind-blown dust via absorption, injection, ingestion and inhalation. Appendix C contains Table C-1, which includes the maximum and minimum concentration of individual metals and volatile organic compounds reported in groundwater and soils at Rocky Flats.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

30 of 123

Effective Date: Organization:

Environmental Management

5.2 <u>Hazard Assessment Methodologies and Results</u>

The following is a brief summary of hazard assessment methodology and the assessment results. Detailed information regarding how hazard assessments were accomplished is presented in various attachments as specified in the text below.

5.2.1 Methodology Employed to Assess Encounters with Wildlife, Environmental Extremes, Physical Injuries, and Electrical Shock When Working With Equipment

There is a certain likelihood for each of the potential hazard classifications listed in Subsection 5.1 above to become a true hazard. An estimate of the likelihood of such occurrences for all classification of potential hazards has not been attempted. The assessment of the first four classifications of potential hazard (encounters with native wildlife, environmental extremes, physical injuries and electrical shock) is subjective and indicates that they will exist at each work site, and, therefore, that steps must be taken to minimize the hazard. (See Section 6.0, General Health and Safety Requirements; Section 7.0, Site-Specific Health and Safety Requirements; and various SOPs as listed in Section 4.2 and included in this HASP by reference.

5.2.2 <u>Methodology Employed to Assess Exposures to Radioisotopes and Nonradioactive</u> <u>Potentially Hazardous Chemicals</u>

The assessments of the last two classifications of potential hazards (radioisotopes and nonradioactive potentially hazardous chemicals in various environmental media) are presented by discussing the four potential routes of exposure. The routes of exposure discussed are absorption, injection (through the skin), ingestion, and inhalation.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Effective Date:

31 of 123 3/65/95

Organization: Environmental Management

5.2.2.1 The Absorption, Injection, and Ingestion Routes of Exposure

A subjective manner of evaluation was used to assess the absorption, injection, and ingestion routes of exposure. The assessment indicates that these three routes of exposure will exist at each work site, and, therefore, that steps must be taken to minimize exposures by these routes. Methods of decreasing the likelihood of an exposure occurring via these routes are provided in Section 6.0, General Health and Safety Requirements; Section 7.0, Site-Specific Health and Safety Requirements; and various SOPs listed in Section 4.2 and included in this HASP by reference.

5.2.2.2 The Inhalation Route of Exposure

The potential for radioisotopes and nonradioactive metals in surface or groundwater to become airborne during the tasks listed in Section 4 is very low. The potential for these compounds to become airborne has been calculated from Derived Air Concentration (DAC) guidelines set forth in DOE Order 5480.11, "Radiation Protection for Workers." The DAC equation is as follows:

Maximum Expected Airborne Concentration = Soil Concentration x Mass Loading x 30.

Predictions based on application of the DAC equation to historical site data indicate that worker exposures greater than the applicable occupational exposure limit are very unlikely when working with surface or groundwater. However, prudent work practices, occupational exposure monitoring, and respiratory protection requirements to minimize exposures are established in Sections 6 and 7.

Page:

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0 32 of 123

Effective Date:

3/15/95

Organization:

Environmental Management

Worker exposures to materials such as volatile and semivolatile organic compounds (VOCs and SVOCs) in concentrations greater than the applicable occupational exposure limit are very unlikely when working with liquids, soils or sediments. In certain instances, airborne concentrations of these compounds may exceed Permissible Exposure Limits (PELs). Prudent work practices, environmental monitoring and respiratory protection requirements to address potential exposures are established in Sections 6 and 7.

The following list of chemicals has been identified as having the highest potential for exposure while working on the project.

Chemical	Predicted Maximum Airborne Concentration in ppm	PEL* in ppm	Percent Concentration of the PEL*
1,1-Dichloroethene	7.5	1	750%
Benzene	0.082	0.1	82%
Carbon Tetrachloride	0.0153	2	0.77
Methylene Chloride	0.434	25	1.74
Tetrachloroethylene	1.14	25	4.56
Vinyl Chloride	0.291	1	29.1

^{*} PEL = Permissible Exposure Limit

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

33 of 123 3/15/95

Organization:

Environmental Management

6.0 GENERAL SITE-SPECIFIC HEALTH AND SAFETY REQUIREMENTS

6.1 <u>Medical Surveillance</u>

All persons assigned to work at Rocky Flats on the groundwater monitoring program shall be active participants in a medical surveillance program as required by the Rocky Flats Health and Safety Practices Manual (HSP) Section 4.0, and equivalent to the requirements established by 29 CFR 1910.120. All medical examinations and procedures shall be performed by or under the supervision of a licensed physician, preferably an occupational physician. Each subcontractor shall submit a medical surveillance program to EG&G for approval prior to initiating Groundwater Monitoring Program work.

Radiation dosimeters and a Radiological Bioassay Program will be furnished by Rocky Flats and are required for all field workers conducting tasks in Radiologically-Controlled Areas (RCAs), in accordance with the requirements of HSP Sections 18.07 and 18.20.

6.2 Safety Training

Employees shall not participate in field activities until they have been trained to a level required by their job function and responsibility. Trainers will be trained in accordance with the requirements of Environmental Restoration Program Division - Training and Qualification (ERPD-T&Q). All training and field experience shall be documented and records of training documentation will be retained in the subcontractor Base Laboratory office. Training and training records shall meet the

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

34 of 123

Organization:

Environmental Management

requirements of Procedure ER-ADM-2.01, Training. Minimum training requirements are discussed below.

6.2.1 40-hour Basic Training

All on-site employees must have completed the 40-hour basic health and safety training, including Hazard Communication training, for Hazardous Waste Operations required under 29 CFR 1910.120 and receive 8-hour annual refresher training thereafter.

6.2.2 Three-Day On-Site Supervision

All on-site employees shall be required to receive a minimum of 3 days of on-site field experience in compliance with 29 CFR 1910.120 under the supervision of a trained and experienced supervisor. The trained and experienced supervisor will be experienced in the work that the employee is actually being trained in. On-site time under supervision shall be documented using an EG&G-approved form. An example of the EG&G On-the-Job Training (OJT) form is provided in Appendix D.

6.2.3 Radiation Worker Training

All field employees shall be required to receive Radiation Worker Training as required by HSP 18.02.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual:
Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

35 of 123 3/15/95

Organization:

Environmental Management

6.2.4 On-Site Project Manager

The on-site subcontractor Project Manager (PM) must have completed the basic 40-hour training course, 3 days of on-site supervision and at least 8 hours of specialized training in an OSHA-approved course on managing hazardous waste operations. The 8 hours of specialized training shall include instruction covering this Health And Safety Plan, employee training program, personal protective equipment program, spill containment procedures, and health hazard monitoring procedures.

6.2.5 Site Safety Officer (SSO)

The Site Safety Officer must have completed the 40-hour training, 8-hour OSHA Supervisor training, 3-day on-site supervision, first aid training, and training required by 29 CFR 1910.1030, Bloodborne Pathogens. The SSO will be approved as a Health and Safety Specialist (HSS) by Radiological Engineering (RE). The SSO shall also possess current certificates of training in adult CPR and the Standard American Red Cross First Aid.

6.2.6 Health & Safety Specialist (HSS)

The Health and Safety Specialist (HSS) must have completed the 40-hour training, 8-hour OSHA Supervisor training, 3-day on-site supervision, and 3-day Radiation Worker Training. The HSS will be approved by Radiological Engineering and Industrial Hygiene representatives after demonstration of proficiency at HSS tasks. The HSS shall also possess current certificates of training in adult CPR and the Standard American Red Cross First Aid.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0 36 of 123

Effective Date:

3/15/95

Organization:

Environmental Management

6.2.7 Site-Specific Safety Orientation Meeting

Each contractor, subcontractor, and Rocky Flats employee will receive a site-specific safety orientation prior to participation in the Groundwater Monitoring Program. The following topics will be discussed at this meeting:

- Names of health and safety personnel and alternates responsible for site health and safety;
- Health and safety organization;
- Location of Material Safety Data Sheets (MSDSs);
- Hazards at the site;
- Electrocution;
- Exposure risk;
- Personal protective equipment to be used;
- Personnel and equipment decontamination procedures;
- Air monitoring;
- Emergency procedures/contingency plans; and,
- Training requirements to perform tasks.

A copy of this Health and Safety Plan must be made available to all project personnel. At the end of the meeting, attendees should be informally quizzed to assess their understanding of the health and safety requirements, and should sign a safety compliance agreement form stating that they have

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

37 of 123

Organization:

Environmental Management

read, understand, and agree to comply with the provisions of the plan. Anyone refusing to sign the form will be prohibited from working at the site.

If a new employee who has not gone through the site-specific safety orientation meeting is assigned to the site, the SSO must present a similar briefing to the new employee before he or she participates in any field activities. All new employees must sign the safety compliance agreement form before beginning work. A copy of the signed safety compliance agreement will be provided to the SSO prior to beginning work.

6.2.8 Periodic Safety Meetings

Daily tailgate briefings are desirable but, as a minimum, weekly health and safety briefings will be conducted. Additional health and safety briefings will be conducted when the site manager and the SSO agree that a given topic warrants immediate attention.

6.2.9 Lifting

When lifting or carrying items is part of the job, it is each individual's responsibility to use the following guidelines:

- Make sure there are no nails or other items protruding which may cause injury in the lifting and carrying procedure;
- Use a lifting belt when lifting heavy objects;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

38 of 123

Page:

Effective Date: Organization:

3/15/95 Environmental Management

• Do not attempt to lift more than 50 pounds without assistance. Items weighing more than 50 pounds should be lifted by two people, or with a fork lift or hand truck;

- When lifting, crouch as close to the object as practical, get a good grip on it, and keep feet apart, bending at the knees;
- Lift slowly by straightening legs;
- Keep back relatively straight when lifting; and,
- Use leg muscles, not back muscles.

6.3 <u>Visitor Clearances</u>

All visitors to Rocky Flats must be cleared by Rocky Flats security personnel. Visitors will be escorted at all times by site personnel. They will be trained, at a minimum, in hazard recognition and personal protective equipment requirements appropriate for the activities in which they are to participate. In general, visitors will be restricted to support zones; entrance into exclusion zones will require additional training in accordance with 29 CFR 1910.120 and Rocky Flats site- and task-specific training, as described in Section 6.2.

6.4 Buddy System

The "buddy system" and radio communications will be used during all field activities at Rocky Flats. No field activities will be conducted on a "solo" basis.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

Effective Date:

Organization:

Environmental Management

6.5 Work Zones

Work zones pertaining the to groundwater program will be established around each well when conducting Groundwater Monitoring Program tasks at the location. International orange cones will be set out to delineate the work zone and include the truck and well in the work zone. The decon tub(s) will be laid on visqueen or equivalent and will mark the line of most to least clean. Two work zones (exclusion zone [EZ] and support zone [SZ]) will be established for areas which are not Radiologically Controlled Areas (RCAs) or in areas where airborne volatile organic compound (VOC) concentrations do not exceed respiratory protection action levels, as discussed in Section 7.4.2.3.

The three work zones (exclusion zone [EZ], contamination reduction zone [CRZ], and the support zone [SZ], modified to imply the back, or shell of the truck, inclusive of the cab) shall be established and used in RCAs and in areas with airborne VOC concentrations exceeding respiratory protection action levels as described in Section 7.4.2.3. Environmental Management Radiological Guidance 1.3, Section 5.1.1, will be consulted for posting requirements applicable to areas and equipment contaminated or potentially contaminated with radioactive materials.

6.5.1 Exclusion Zone (EZ)

The Exclusion Zone (EZ) is a known contaminated or potentially contaminated area. Exclusion zones established around wells will be clearly marked with international orange cones and be of a sufficient size to permit easy movement of personnel or equipment within the zone. Access control points will be established at the periphery of each EZ to regulate and control the flow of personnel

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

40 of 123

Effective Date:

3/15/95

Organization:

Environmental Management

and equipment into and out of the zone and to help verify that proper procedures for entering and exiting are followed.

When work is to be accomplished within a radiologically controlled area (RCA) or areas with VOC contamination potentially exceeding action levels, the SSO will be notified and will ensure the following actions are taken:

- Identify the area in which work is to be accomplished;
- Determine the radiological contamination or VOC level;
- Prepare a radiological work permit (RWP) if appropriate and contact EG&G Radiological Engineering;
- If appropriate, close off the work area with yellow and magenta tape or rope and post as a RCA with appropriate entrance and exit signs;
- Establish a step-off pad for exiting the area;
- Don appropriate PPE;
- Seal and transport items that cannot be radiologically decontaminated at the step-off pad, per Field Operating Procedure F.O.4, Section 6.4;
- When the item arrives at the decontamination facility, remove material used to seal contaminated area while wearing level of personal protective equipment specified in the RWP;
- Decontaminate item;
- Survey contaminated area to verify decontamination;
- Survey decontamination pad to verify decontamination;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

41 of 123 3/15/95

Organization:

Environmental Management

- SSO will complete forms necessary to remove signs posted to mark the RCA; and,
- Depost the area after proper notification.

6.5.2 Contamination Reduction Zone (CRZ)

In general, the CRZ is established immediately outside the exclusion zone to minimize the migration of contaminants from the exclusion zone to clean or support areas, and to reduce the exposure potential of individuals leaving the exclusion zone. Personnel decontamination will require establishing a step-off pad. Minimum step-off pad requirements differ for radiologically-controlled areas (RCAs) and non-RCAs.

6.5.2.1 RCA Step-off Pad Requirements

Specific personnel decontamination procedures for radiological contamination are outlined in EMRG 2.1 and 2.3. Minimum requirements for a step-off pad such as is required at each radiologically controlled area (RCA) are listed below:

- Place a sign with the proper warnings/notices so that persons cannot enter the RCA without observing the sign. Procedures for exiting the RCA will be posted on the rear of the sign for review by persons exiting the RCA;
- Lay visqueen or other heavy gauge plastic sheeting on the ground so that a few feet of it extends into the RCA;
- Set up a table beside the visqueen so that half of the table is in the RCA and the other half is outside of the RCA;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

42 of 123 3/15/95

Organization:

Environmental Management

- Position two personal protective equipment (PPE) containers with plastic liners beside the table. One PPE container will be labeled "Contaminated PPE" and the other PPE container will be labeled "Uncontaminated PPE." Both containers shall be placed within the RCA;
- Cover the table top with visqueen or other heavy gauge plastic sheeting. Draw a line across the table top to indicate where the RCA boundary crosses the table. That half of the table inside the RCA will be used to place equipment that is to be screened for contamination. Equipment that has been screened and found free of contamination will be placed on the half of the table that is outside of the RCA. Equipment that has been screened and found to be contaminated will be examined for the presence of removable contamination. If contamination is removable, the equipment will be redecontaminated and re-monitored. If the contamination is not removable, the equipment will be disposed of as radioactive waste and a EG&G Radiological Engineer will be notified to take appropriate action;
- The individual responsible for screening personnel as they depart the RCA will wear PPE appropriate for the task, as described in FO.06, and stand on the visqueen immediately outside of the RCA but near enough to the RCA boundary to conduct personnel screening activities;
- PPE found to be contaminated with radioactive materials will be placed inside the "Contaminated PPE" container; other PPE items will be placed in the "Uncontaminated PPE" container. Used PPE will be handled in accordance with the requirements of Standard Operating Procedure Field Operations 06, as summarized in Section 7.5.12:
- If radiological contamination is found, the PPE will be removed and the next layer of PPE monitored. That process will continue until contamination is no longer found. If radiologically-contaminated PPE is found, EG&G Radiological Engineering will be notified upon return from the field. If skin contamination is found, the HSS will notify EG&G Radiological Engineering and Occupational Medicine and provide steps necessary to remove that contamination; and,

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page: **Effective Date:** 43 of 123 3/15/95

Organization:

Environmental Management

Respiratory protection will be the second to last PPE item monitored and removed if it was worn during the course of work within an RCA. Inner gloves will be the last PPE item removed.

6.5.2.2 Non-RCA Step-off Pad Requirements

In general, minimum step-off pad requirements for non-RCAs include:

- Place a sign restricting access to the CRZ to authorized personnel only;
- Position a personal protective equipment (PPE) container with a plastic liner in the CRZ. PPE will be handled in accordance with the requirements of FO.06, summarized in Section 7.5.12;
- Wash and rinse boots upon exiting the CRZ; and,
- Remove PPE, if worn, in the appropriate sequence. Respiratory protection, if worn, will be the second to last PPE item removed. Inner gloves will be the last item removed.

6.5.3 Support Zone

The support zone is located in a clean area, preferably upwind and immediately outside of the CRZ, or in the on-site vehicles. Supplies, first aid kit, eye wash, fire extinguisher, and support personnel are located in the support zone or in the on-site vehicles.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

44 of 123

Effective Date: Organization:

Environmental Managemén

6.6 Field Activities

6.6.1 Personnel Requirements/Prohibitions

- All personnel will carry radios for communication while in the field;
- All personnel will be issued a buffer zone pass by Environmental Operations Management at T891E prior to entry into the buffer zone or will log into the buffer zone daily prior to entry. Buffer zone rules will be obeyed;
- No running or horseplay;
- The required level of PPE must be worn by all on-site personnel;
- Eating, drinking, chewing gum or tobacco, smoking, or any practice that increases the probability of hand-to-mouth transfer and ingestion of material is prohibited in the EZ and the CRZ;
- Smoking is prohibited at the decontamination facility and in the buffer zone;
- No jewelry may be worn by personnel engaged in field work, except for watches, which will be disposed if they become contaminated;
- No facial hair which interferes with a satisfactory fit of the mask-to-face seal isallowed on personnel required to wear respirators;
- Medicine and alcohol can increase the effects from exposure to toxic chemicals. Personnel taking prescription drugs are required to notify EG&G Occupational Health and Safety, and the SSO. Alcoholic beverage intake will not be allowed on Rocky Flats Environmental Technology Site;
- All field personnel will wear occupational protective footwear to comply with ANSI Z41.1:

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

CFP/ER-SAF-94-GMP

Page:

45 of 123

Effective Date: Organization:

3/15/95 Environmental Management

• Any person who has a medical condition or allergy that could render them unconscious or result in a life-threatening situation will notify the Site Manager and the SSO and provide the appropriate response actions before beginning field work;

- Safety devices on equipment must be left intact and used as designed;
- Equipment and tools will be kept clean and in good repair and used only for their intended purpose. Operations and Maintenance manuals for equipment used as part of the Groundwater Monitoring Program shall be available at the subcontractor's Base Laboratory trailer;
- ANSI-approved safety glasses with side shields shall be worn in the exclusion zone and contamination reduction zone;
- Leather gloves must be worn when handling drums;
- Seat belts will be worn at all times while riding in a vehicle;
- Travel only on established roadways;
- Field laboratory type operations may not take place in the rear of the vehicle as the vehicle moves between sites; and,
- Drive slowly in the vicinity of the contractor facilities (5 mph maximum). When on site, park properly and within designated areas and watch for pedestrians and other vehicles.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

46 of 123 3/15/95

Organization:

Environmental Management

6.6.2 Contamination/Exposure Prevention

On-site personnel may become contaminated by:

- Being splashed by contaminated liquids while sampling or handling liquids;
- Coming in contact with contaminated solids or liquids;
- Walking through contaminated materials, either in solid or liquid state;
- Being in contact with contaminated equipment;
- Being in contact with contaminated solid substances in waste piles or on the soil;
- Sitting or kneeling on the ground; and,
- Inhalation.

On-site team members will avoid becoming contaminated as much as possible. This will be accomplished by good work practices, as required by relevant SOPs, and by wearing Personal Protective Equipment (PPE), as described in Section 7.5.

On-site personnel will avoid exposure to hazardous chemicals by strictly adhering to the required personal protection equipment and decontamination procedures.

Care will be taken to prevent equipment damage from the elements or contamination as much as possible. Sampling and monitoring equipment will not be laid on contaminated surfaces. When decontaminating known radiologically-contaminated equipment, monitoring equipment and communication equipment may be bagged, with the bag taped and secured around the instrument. Openings will be made in the bag for sample intake and exhaust ports.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

Page:

Effective Date:

47 of 123 3/15/95

Organization:

Environmental Management

Surfaces will be considered radiologically contaminated if release limits for unrestricted use are exceeded. Release limits for unrestricted use are established in Rocky Flats Environmental Management Radiological Guidance (EMRG) 3.02. Currently, the release limits for unrestricted use are as set forth in the EMRGs.

6.6.3 On-Site Travel

All traffic regulations shall be observed. The following requirements will be observed at all times:

- Seat belt use is required when riding in any motorized vehicle;
- Authorized plant speeds will not be exceeded;
- A safe distance shall be maintained (a minimum of approximately three truck lengths) from the vehicle ahead, and the truck shall be kept under control at all times;
- The right of way shall be yielded to ambulances, fire trucks, or other vehicles in emergency situations;
- Under all travel conditions, the truck shall be operated at a speed that will permit it to be brought to a stop in a safe manner; and,
- No smoking is permitted in government-owned vehicles.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

48 of 123 3/15/95

Organization:

Environmental Management

6.6.4 Housekeeping

Housekeeping is an important aspect of an investigation program and will be strongly stressed in all aspects of field work. Good housekeeping plays a key role in occupational health protection and is a way of preventing dispersion of dangerous contaminants. All work areas will be kept as clean as possible at all times, and spills will be cleaned up immediately. Housekeeping will be the responsibility of all employees.

6.7 Personal Protective Equipment (PPE)

It is expected that there will be a tailoring of Personal Protective Equipment (PPE) requirements for specific sites and seasonal variations. Changes to PPE requirements established in this Health And Safety Plan shall be agreed upon by the On-site Project Manager and the SSO prior to review and approval for implementation by subcontractor HSO, Project Manager, and CHSO, and by the EG&G Project Manager, ERPD HSO, HS Liaison Officer, RE, and IH. A document authorizing such changes will be developed, dated, and signed by the On-site Project Manager and HSO. The SSO shall post PPE requirements in the crew trailer, announce changes and justification for those changes at a site safety meeting, and provide a copy of the change in PPE requirements to the HSO responsible for developing the Health And Safety Plan. Rocky Flats will publish a change to this plan if PPE changes are permanent and if the changes are considered substantive.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

49 of 123

Effective Date: Organization:

3/15/95 Environmental Management

6.7.1 Clothing

Personal protective equipment should be inspected before use. The following checks should be made before use:

- Determine that the clothing material is correct for the specific task at hand;
- Visually inspect for:
 - Imperfect seams;
 - Tears; and,
 - Malfunctioning closures.
- Hold up to light and check for pinholes.

During the work task, periodically inspect for the following:

- Evidence of chemical attack such as discoloration, swelling, stiffening, and softening. Keep in mind, however, that chemical permeation can occur without any visible effects;
- Closure failure;
- Tears;
- Punctures; and,
- Seam discontinuities.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

50 of 123

Page:

Effective Date:

3/15/95

Organization:

Environmental Management

6.7.2 Protective-toe Footware, Safety Glasses, and Hard Hats

Protective toe footwear requirements are identified in HSP 7.02, "Occupational Foot Protection." Appropriate footwear for Groundwater Monitoring Program activities are 16"-high steel toed boots as defined by ANSI Standard Z41.1. Safety glasses requirements are identified in HSP 7.01, "Eye and Face Protection Program," and include ANSI Standard Z87.1 safety glasses with site shields. Hard hats will comply with HSP 7.07, "Head Protection," satisfy ANSI Standard Z89.1, and be worn whenever overhead hazards are present.

6.7.3 Respirators

Respirators are to be inspected by looking for missing or damaged inhalation/exhalation values, straps, buckles, and face shields, as well as their overall cleanliness. Respirators will be inspected according to an Rocky Flats-approved schedule established by the subcontractor, as outlined in Section 7.4.2.

6.8 Emergency Equipment

The following emergency equipment will be readily available at the subcontractor Base Laboratory trailer and in each field vehicle.

- First aid kit;
- Eye wash, 15 minute supply;
- Potable water, Gatoradetm, or equivalent;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

51 of 122

Page:

51 of 123

Effective Date: Organization:

Environmental Management

- Fire extinguisher (10 lb. ABC); and,
- An extra full set of the appropriate PPE for each team member.

6.9 <u>Temperature Stress</u>

Temperature stress can be induced by both hot and cold environmental conditions.

6.9.1 Heat Stress

Heat stress is probably one of the most common illnesses experienced by outdoor workers wearing PPE. Health effects resulting from heat stress can range from transient heat fatigue to serious illness and death. Signs and symptoms of the stages of heat stress, presented in order of progression, are provide in the following paragraphs. This information is duplicated in Table 6-1 for easy reference.

Heat Rash

Heat rash may result from continuous exposure to heat or humid air. Signs of heat rash include reddening of the skin and increased sweating.

Heat Cramps

Heat cramps are caused by heavy sweating with inadequate electrolyte replacement. Signs and symptoms of heat cramps include muscle spasms and pain in the hands, feet, or abdomen.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

52 of 123

Effective Date: Organization:

Environmental Management

Heat Exhaustion

Heat exhaustion occurs from increased stress on various body organs including inadequate blood circulation due to cardiovascular insufficiency or dehydration. Signs and symptoms of heat exhaustion include:

- Pale, cool, moist skin;
- Heavy sweating;
- Dizziness;
- Nausea; and,
- Fainting.

Heat Stroke

Heat stroke is the most serious form of heat stress. Temperature regulation fails and the body temperature rises to critical levels. Immediate action must be taken to cool the body before serous injury or death occur. Medical help must be obtained. Signs and symptoms of heat stroke include:

- Red, hot, usually dry skin;
- Lack of or reduced perspiration;
- Nausea;
- Dizziness and confusion;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual:

RFP/ER-SAF-94-GMP

O

Revision No.: Page:

age:

53 of 123

Effective Date: Organization:

• Strong, rapid pulse; and,

Coma.

Heat stress monitoring, as described in the following section, will assist in identify or preventing the progression of heat stress stages identified above.

6.9.2 Heat Stress Monitoring

A Wet Bulb Globe Temperature (WBGT) Instrument will be used to monitor employee exposure to heat stress condition, with the action level and work/rest regimen being based on the latest published values by the American Conference of Governmental Industrial Hygienists. Monitoring for heat stress will begin at 70 degrees Fahrenheit. Personnel should be alert for the signs and symptoms of heat stress, as described above and in Table 6-1.

Since measurement of deep body temperature is impractical for monitoring the employees' heat load, the measurement of environmental factors which most nearly correlate with deep body temperature and other physiological responses to heat is required. At the present time, WBGT Index is the simplest and most suitable technique to measure the environmental factors. WBGT values are calculated by the following equations:

Outdoors with solar load:
 WBGT = 0.7 NWB + 0.2 GT + 0.1 DB

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

Page:

54 of 123 3/15/95

Effective Date: Organization:

Environmental Management

Indoors or outdoors with no solar load:
 WBGT = 0.7 NWB + 0.3 GT

where:

WBGT =

Wet Bulb Glove Temperature Index

Natural Wet-Bulb Temperature

DB GT

NWB

= Dry-Bulb Temperature

= Globe Temperature

The determination of WBGT requires the use of a black globe thermometer, a natural (static) wetbulb thermometer, and a dry-bulb thermometer, such as the Reuter-Stokes Thermo-environmental Monitor. Calculated WBGT values will be compared to the permissible heat exposure limits provided in Table 6-2 (adapted from ACGIH 1993-1994 TLVs) and utilized to determine work/rest regimes, as described in the following paragraphs.

As previously stated, heat stress monitoring will begin when ambient air temperatures exceed 70°F. Heat stress will be monitored by checking Heart Rate during a 30 second period as early as possible in the rest period. If the heart rate exceeds 110 beats per minute or 75 beats per 30 seconds, the next work cycle will be shortened by one-third. Oral temperature will be taken with clinical thermometer (3 minutes under the tongue) at the end of each work cycle after appropriate documentation (before drinking water). If oral temperature exceeds 99.6°F, the next work cycle will be shortened by an additional one-third without changing the rest period. If at any time oral temperature exceed 100.4°F, work will be stopped and the person will not be allowed to work with impermeable PPE clothing such as Tyvektm.

Work schedules and work/rest schedules will be adjusted and modified according to monitoring requirements. Work slowdowns will be mandated as needed.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

55 of 123

Organization:

Environmental Management

Personnel will be rotated to alternate job functions and minimize overexertion at one task.

Additional personnel will be added to work teams as needed. Shelter will be provided during break periods; crew members may sit inside trucks with air conditioning going. Care will be taken to avoid shocking temperature extremes: workers will be instructed to gradually decrease temperature in air conditioned trucks at the initiation of break periods, and gradually increase the temperature before resuming work. Crew members will be required to drink plenty of water before going out into field and at break time. At lunch time, workers will be encouraged to salt their foods.

As many of the following control measures as are appropriate to site conditions shall be utilized to aid in controlling heat stress:

- Provide adequate liquids to replace lost body fluids and replace water and salt lost from sweating. Encourage personnel to drink more than the amount required to satisfy thirst. Thirst satisfaction is not an accurate indicator of adequate salt and fluid replacement;
- Replace fluids with water, commercial mixes such as Gatoradetm or Quick Kicktm, or a combination of these;
- Establish a work regimen that will provide adequate rest periods for cooling down.
 This may require additional shifts of workers;
- Take all breaks in a cool rest area (approximately 77 degrees Fahrenheit);
- Remove impermeable protective garments such as Tvyektm or Saranextm during rest periods;
- Do not assign other tasks to personnel during rest periods; and,
- Inform personnel of the importance of adequate rest, acclimation, and proper diet in the prevention of heat stress.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0 56 of 123

Page:

Effective Date: Organization:

3/15/95 Environmental Management

6.9.3 Cold Stress

Fatal exposure to cold among workers has almost always resulted from accidental exposures involving failure to escape from low air temperatures or immersion in low temperature water. The single most important aspect of life-threatening hypothermia is the fall in deep core temperature of the body. Employees should be protected from exposure to cold so that the deep core temperature does not fall below 97°F. Lower body temperature will very likely result in reduced mental alertness, reduction in rational decision making, or loss of consciousness with the threat of death. Adequate dry clothing must be provided to workers if work is to be performed in air temperatures below 40°F (4°C).

6.9.4 Cold Stress Monitoring

For exposed skin, continuous exposure should not be permitted when the air speed and temperature results in an equivalent chill temperature of 40°F (4°C). At temperatures of 36°F (2°C) or less, it is imperative that employees who become immersed in water or whose clothing becomes wet be immediately provided with a change of clothing and be treated for hypothermia. Special protection of the hands is required to maintain manual dexterity for the prevention of accidents.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

57 of 123

Effective Date: Organization:

3/15/95 Environmental Management

- Work Below 40 Degrees Fahrenheit (4°C) (including wind chill). Provisions for additional total body protection is required if work is performed at or below 40 degrees Fahrenheit as follows:
 - The employees shall wear cold-protective clothing appropriate for the level of cold and physical activity.
 - If the air velocity at the site is increased by wind or artificial ventilation, the cooling effect of the wind shall be reduced by wearing a removable outer windbreak garment.
 - If the clothing on the employee may become wet on the job site, the outer layer of the clothing used should be water repellent.
 - If the available clothing does not give adequate protection to prevent hypothermia or frostbite, work shall be modified or suspended until adequate clothing is made available or until weather conditions improve.
 - Employees handling evaporative liquids at temperatures below 4 degrees Celsius shall take special precautions to avoid soaking of clothing or gloves due to the added danger of cold injury due to the evaporative cooling.
- Work Below 10 Degrees Fahrenheit (-12°C) (including wind chill). For work practices at or below 10°F (-12°C), the following shall apply:
 - The worker shall be under constant protective observation (buddy system).
 - If work must be done, rest periods must be taken in heated shelters and opportunity for changing into dry clothing shall be provided.
 - New employees shall not be required to work full-time in cold the first few days until they become accustomed to the working conditions and required protective clothing.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

58 of 123

Effective Date: Organization:

Environmental Management

- The work shall be arranged in such a way that sitting still or standing still for long periods is minimized.
- The workers shall be instructed in health and safety procedures.

6.9.5 Training

The training program for temperature stress shall include as a minimum, instruction in:

- Proper rewarming procedures and appropriate first aid treatment;
- Proper clothing practices;
- Proper eating and drinking habits;
- Recognition of impending frostbite;
- Recognition signs and symptoms of hypothermia or excessive cooling of the body even when shivering does not occur; and,
- Safe work practices.

6.10 Work During Darkness

This health and safety plan does not cover field work after daylight hours. Accordingly, no field work shall be conducted during darkness.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page: Effective Date: 59 of 123 3/15/95

Organization:

Environmental Management

6.11 Confined Space Work

No work in confined spaces or places with limited egress is permitted by this plan.

According to the final regulations from OSHA on confined spaces (29 CFR 1910.146), a "permit required" confined space is an enclosed space which:

- Is large enough and so configured that an employee can bodily enter and perform assigned work;
- Has limited or restricted means for entry and exit (e.g., tanks, vessels, silos, storage bins, hoppers, vaults, pits, and diked areas);
- Is not designed for continuous employee occupancy; and,
- Has one or more of the following characteristics:
 - Contains or has a known potential to contain a hazardous atmosphere
 - Contains a material with the potential for engulfment of an entrant
 - Has an internal configuration such that an entrant could be trapped or asphyxiated by inward converging walls, or a floor which slopes downward and tapers to a smaller cross-section
 - Contains any other recognized serious safety and health hazard

No confined spaces have been identified as work areas under this HASP. If additional sites are added, they will have to be evaluated for confined space entry requirements.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0 60 of 123

Page:

Effective Date:

3/15/95

Organization:

Environmental Management

6.12 Thunderstorms and Tornadoes

Meteorological conditions shall be closely watched, especially in the spring, when severe thunderstorms, lightning and tornadoes are most likely to occur. Thunderstorms, lightning and tornadoes often occur late in the afternoon on hot spring days, but can occur at any time of the day in any season of the year. Tornadoes are usually preceded by severe thunderstorms with frequent lightning, heavy rains, and strong winds.

A severe thunderstorm watch or a tornado watch announcement on the radio indicates that a severe thunderstorm or tornado is possible. Normally work will continue at the work site during severe thunderstorm watches or tornado watches. A severe thunderstorm warning or a tornado warning signifies that a severe thunderstorm or a tornado has been sighted or detected by radar and may be approaching. Normally, work on site shall cease during a severe thunderstorm warning or tornado warning. Decisions to cease work will be made after consultation between the SSO and the site manager. Emergency actions to be taken during a tornado are provided in Section 8.0. High wind warning levels, alarms, and responses are described in FO.01, "Air Monitoring and Dust Control," incorporated in this HASP by reference.

6.13 Hand Tools and Portable Power Tools

Hand tools are non-powered. They include anything from axes to wrenches. The greatest hazards posed by hand tools result from misuse and improper maintenance. Power tools can be hazardous when improperly used. There are several types of power tools, based on the power source they use: electric, pneumatic, liquid fuel, hydraulic, and power-actuated.

ROCKY FLATS **ENVIRONMENTAL TECHNOLOGY SITE** Manual: Revision No.: RFP/ER-SAF-94-GMP

61 of 123

Effective Date: Organization:

3/15/95 Environmental Management

6.13.1 General Requirements

- Hazardous moving parts must be covered/guarded if such parts are exposed to contact by workers. Safety guards will not be removed when a tool is being used;
- Keep all tools in good condition with regular maintenance;
- Use the right tool for the job;
- Examine each tool for damage before use;
- Operate according to the manufacturer's instructions;
- Provide and use the right protective equipment;
- Compressed air will not be used for cleaning purposes except where reduced to less than 30 pounds per square inch (psi) and then only with effective personal protective equipment;
- The use of compressed air for blowing dirt from hands, face, or clothing is prohibited; and,
- Liquid fueled tools will be shut off and allowed to cool before fuel is added.

6.13.2 Hand Tool Requirements

- All hand tools shall be in good repair and used only for the purpose for which designed;
- Tools having defects that will impair their strength or render them unsafe shall be removed from service:

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0 62 of 123

Page:

Effective Date:

7/15/91

Effective Date: Organization:

: Environmental Management

- When work is being performed overhead, tools not in use shall be secured or placed in holders;
- Throwing tools or materials from one location to another, from one person to another, or dropping them to lower levels, shall not be permitted;
- Only nonsparking tools shall be used in locations where sources of ignition may cause a fire or explosion; and,
- Tools requiring heat treating shall be tempered, formed, dressed, and sharpened by personnel who are experienced in these operations.

6.13.3 Power Tool Requirements

- Rotating or reciprocating portable power tools shall be guarded with manufacturer provided guards;
- Power tools shall be inspected, tested, and determined to be in safe operating condition prior to use. Continued periodic inspections shall be made to ensure safe operating condition and proper maintenance;
- Rotating or reciprocating portable power tools shall have a constant pressure switch that will shut off the power when the tool is released by the operator. A portable power tool may have a lock-on control provided turn-off can be accomplished by a single motion of the same finger or fingers that turned it on;
- Loose and frayed clothing, loose long hair, dangling jewelry, rings, chains, and wrist watches shall not be worn while working with any power tool or machine;
- Never carry a tool by the cord or hose;
- Never yank the cord or the hose to disconnect it from the receptacle;
- Keep cords and hoses away from heat, oil, and sharp edges;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

63 of 123

Effective Date:

3/15/95

Organization: Environmental Management

- Disconnect tools when not in use, before servicing, and when changing accessories such as blades, bits and cutters:
- All observers should be kept at a safe distance away from the work area;
- Secure work with clamps or a vise, freeing both hands to operate the tool;
- Avoid accidental starting. The worker should not hold a finger on the switch button while carrying a plugged-in tool;
- Tools should be maintained with care. They should be kept sharp and clean for the best performance. Follow instructions in the user's manual for lubricating and changing accessories;
- Be sure to keep good footing and maintain good balance;
- The proper apparel should be worn. Loose clothing, ties, or jewelry can become caught in moving parts;
- All portable electric tools that are damaged shall be removed from use and tagged "Do Not Use";
- Electric tools must either have a three-wire cord with ground and be grounded or be double insulated. And, each electric tool used at the decontamination facility will have a ground-fault circuit interrupter placed in line between the tool and the power source; and,
- The pressurized steam cleaner at the decontamination facility shall be inspected prior to use for evidence of loose or frayed electrical connections, corroded or baking water connections, and fuel or oil leakage. The cleaner will not be used if any of these conditions exist; the conditions will be corrected prior to use. Care shall be taken when operating the steam cleaner, with special attention paid to hazards presented by high pressure and temperature. Operators shall be aware of burn and cut potentials associated with steam cleaner operation. Under no circumstances will the wand be pointed at any body part. Operators will be especially careful to avoid contacting extremities with the wash stream.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

64 of 123 3/15/95

Organization:

Environmental Management

6.14 Electrical Safety

The use of electrical energy always entails a potential for electrical shock. The use of electrical energy in a damp/moist environment such as outdoors during inclement weather or when processing water samples that could be spilled results in an increased potential for electrical shock. The following requirements will be implemented:

- All electrical wiring and equipment shall be a type listed by the Underwriters Laboratory (UL) or Factory Mutual Engineering Corporation (FM);
- Electrical wire or flexible cord passing through work areas shall be covered or elevated to protect it from damage by foot traffic, vehicles, sharp corners, projections, or pinching;
- Attachment plugs shall be constructed so that they will endure rough use and be equipped with a cord grip to prevent strain on the terminal screws;
- Flexible cord shall be used only in continuous lengths. Splicing of flexible cords is not permitted;
- Patched, oil soaked, worn, or frayed electrical cords shall not be used;
- Electrical cords will not be fastened with staples, hung from nails, or suspended by bare wire;
- Plugs and receptacles shall be of an approved submersible type;
- Ground fault circuit interrupters (GFCIs) are required in all circuits used for portable tools. GFCIs shall be trip tested before use (each day of use) by pressing the test button. If a test button is not present, the manufacturer instructions for testing will be followed;
- A ground strap will be used between the frame of portable generators and a grounding rod if required by the manufacturer. Grounding rods must be 5/8-inch

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

65 of 123 3/15/95

Organization:

Environmental Management

diameter steel or iron rods, 1/2-inch diameter copper clad steel, or 3/4-inch diameter galvanized pipe. They shall be in unbroken 8-foot lengths and driven to full depth;

- Grounding clamps/clips shall be attached before circuits are energized. A secure and
 positive metal-to-metal contact shall be made. Grounding clamps/clips shall not be
 removed until the circuits are de-energized;
- Weatherproof wiring shall be used. Receptacles shall be contained in a weatherproof enclosure the integrity of which is not affected when an attachment plug is inserted;
- Wiring used outdoors shall be hard usage or extra hard usage. Approved cords may be identified by the word "outdoor" or letters "WA" on the jacket;
- Flexible cords shall be connected to devices and fittings to provide strain relief to prevent pull from being transmitted to joints or terminal screws;
- Keep all electrical equipment and hands dry;
- Do not attempt to repair electrical equipment. Electrical equipment that fails will be disposed of or repaired by a qualified person;
- Never try to bypass any safety device on electrical equipment; and,
- In case of fire on or near any electrical equipment, use only a carbon dioxide or dry chemical fire extinguisher.

Emergency procedures for dealing with electrical shock are provided in Section 8.0.

ROCKY FLATS **ENVIRONMENTAL** TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

Effective Date:

66 of 123 3/15/95

Organization:

Environmental Management

Laboratory Safety 6.15

6.15.1 Base Laboratory

Various analytical methods require that a preservative be added to the sample to be analyzed. These preservatives will be added to empty sample containers by the sample manager working in the Base Laboratory. Those preservatives being used are:

- Nitric Acid (HNO₃);
- Sulfuric Acid (H₂SO₄);
- Sodium Hydroxide pellets (NaOH);
- Sodium Thiosulfate granular (Na₂S₂O₃);
- Hydrochloric Acid (HCl);
- Ascorbic Acid powder (C₆H₈O₆); and,
- Zinc Acetate ($Zn (C_2H_3O_2)$.

Material Safety Data Sheets (MSDSs) for these preservatives will be retained on file in the subcontractor Base Laboratory trailer. Only those personnel directly involved in the process of adding the preservatives to the containers will be allowed in the properly ventilated clean room while this activity is being performed. No one shall handle preservatives while alone in the trailer. Preservatives will not be handled without the SSO being on site and knowledgeable that preservatives are being handled. All persons working with acids will wear chemical-resistant apron and gloves and Class III eye protection (chemical goggles and a face shield). Those responsible for dispensing the preservatives will be thoroughly trained by an experienced sample manager in the conduct of these operations, the safety aspects of the job, and in emergency procedures.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

Revision No Page:

67 of 123

Effective Date: Organization:

3/15/95 Environmental Management

Sample containers made of glass require the wearing of protective eyewear whether they contain preservatives or not. All containers should be handled with protective gloves in order to prevent possible contamination of the container prior to sampling. Samples being brought in from the field for packaging and distribution will be handled only by personnel wearing protective eyewear and protective gloves.

Accuvactm reagent vials will be handled and disposed of according to SOP FO.21 (proposed).

6.15.2 General Safety

These general safety rules and precautions are applicable to all employees regardless of work areas. In addition to the general rules, employees who perform specialized jobs are to be thoroughly familiar with the safety rules pertaining to their unique tasks as outlined in the various sections.

- Warn a person in the immediate vicinity of unsafe conditions;
- No person shall proceed against or disregard any warning given by word of mouth, sign, or signal;
- Everyone is responsible for keeping his or her working place clean. Keep tripping hazards out of places where employees walk;
- Whenever stacking is part of your assigned task, it is your responsibility not only to stack material so that there is no danger of its falling, but also to stack it within prescribed areas allowing all aisles and work spaces to remain free;
- Always use the stair handrails and never jump from platforms, scaffolds, loading docks, or other elevations;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

68 of 123

Organization:

3/15/95 Environmental Management

- Chemical labels shall be read and followed, particularly those which contain instructions in the use of the chemical to avoid harmful exposure to the employee;
- Employees must use a face shield when handling, pipetting, or pouring containers of acid, caustics, or other corrosive liquids;
- Eating or drinking in the laboratory areas is absolutely prohibited;
- At no time is a person to perform laboratory work while alone in the building;
- Never use mouth suction to pipette; a pipette bulb, or repeated use of a pipette will be used;
- Laboratory benches and aisles should not be used as storage areas;
- Fire extinguisher and eyewash fountains with 15-minute irrigation capacities are to be kept clear and readily accessible;
- Do not pick up broken glass with bare hands; use gloves or sweep it up. Fine glass particles should be picked up with wet paper towels; and,
- All preserved bottles will have full name or chemical formula written on the container.

6.15.3 Storage and Handling of Chemicals

- Generally, heavy items or large containers should be stored on or as near the floor as possible with smaller items and containers on the upper shelves;
- Chemicals which might react together to produce dangerous fumes, fire, or explosion must not be stored in the same container cabinet;
- Acids and bases should be stored separately in cabinets designed for such use;
- All containers must be labeled plainly;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

n - GMI

Page:

69 of 123

Effective Date: Organization:

3/15/95 Environmental Management

- If exact information is not received with shipment of new or unfamiliar types and potencies of chemicals, request the manufacturer/supplier furnish a Material Safety Data Sheet (MSDS) with his recommendations before proceeding with laboratory use:
- When diluting acid, always pour the acid into water; never pour water into acid.
 Pouring water into acid may cause a reaction. In the case of field sampling, it has been determined that adding sample water to acid-prepared sample containers poses no significant risk, although care should be taken not to have sample containers and sample water near sampler's face during filling operations;
- Always flush or wipe down (with premoistened towelettes) the outside of acid bottles before opening them. Do not lay the stopper down on any surface where another person may rest his hand or arm. Keep acid bottles stoppered tightly, and flush and dry them before replacement on the reagent shelf. Make certain that no spillage remains on tables, floors, or bottles; and,
- Never carry open containers of dangerous chemicals from place to place; containers should always be covered or sealed.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Effective Date:

70 of 123 3//5/95

Organization:

Environmental Management

7.0 <u>SITE-SPECIFIC PERSONAL PROTECTIVE EQUIPMENT</u> <u>REQUIREMENTS</u>

7.1 Introduction

This section describes the specific health and safety requirements of the Groundwater Monitoring Program operations. Activities conducted as regular part of the Groundwater Monitoring Program include water level measurements in wells and piezometers, well development, field measurement of groundwater field parameters, and groundwater sampling. Other, less common activities include packer tests, slug tests, and aquifer pumping tests. Procedures for the specific tasks are provided in the EMD Manual Operation Standard Operating Procedures (SOP) Groundwater (GW) guidance document. Additional procedures for general tasks are provided in the SOP Field Operations (FO) guidance document and include requirements for decontamination, instrument use, sample shipping, and other tasks. Described in the following sections are:

- Monitoring instruments utilized to detect the presence of radioactive and chemical substances potentially presenting a risk to human health and the environment;
- Outline monitoring strategies utilized by health and safety personnel;
- Explain personnel protective equipment (PPE) ensembles designed to protect field personnel from identified health risks; and,
- Provide specific information about personal protective equipment ensembles utilized while performing Groundwater Monitoring Program tasks as described in SOP GWs and FOs.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

174-GWIF

Page:

71 of 123

Effective Date:

3/15/95

Organization:

Environmental Management

7.2 Monitoring Instruments

7.2.1 Radioactive Substance Monitoring Instruments

Various instruments are used to monitor for the presence of radioactive substances on equipment and personnel conducting Groundwater Monitoring Program activities. The following instrumentation is used:

- A Bicrontm Field Instrument for the Detection of Low Energy Radiation (FIDLER) (or equivalent) is used to prescreen sites and monitor low level gamma radiation on PPE prior to disposal;
- A Ludlumtm Model 12-1A (or equivalent) is used to monitor alpha radiation on personnel exiting radiologically controlled areas (RCAs) or any other area of radiological concern;
- A Ludlumtm Model 31 (or equivalent) with a 44-9 "pancake" probe is used to
 monitor any beta or gamma radiation on personnel or sample coolers exiting RCAs
 or any other area of radiological concern;
- A Ludlumtm Model 2929 (or equivalent) is used to survey smear samples for alpha, beta, and gamma radiation contamination on various items for release to an unrestricted environment;
- A Bicrontm A-100 (or equivalent) is used to detect alpha contaminants during any survey of personnel or equipment; and,
- A Bicrontm B-50 (or equivalent) is used to detect beta contaminants during any survey of personnel or equipment.

The FIDLER is calibrated and source-checked by Rocky Flats Radiation Instrumentation (RI) on a 24-hour usage basis. All other instrumentation is calibrated and source-checked by the

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

72 of 123

Effective Date:

3/15/95

Organization: E

Environmental Management

subcontractor HSS. Such calibration is approved and reviewed by RI or HPIC. Radiological instruments will be performance-checked against a radiation source of know radiation activity levels in accordance with the following schedule. All radiological instruments except the Ludlumtm 2929 are performance-checked by RI on a semiannual basis, or when calibration expires. The Ludlumtm 2929 is performance-checked on an annual basis by the manufacturer, or when calibration expires. All instruments except the FIDLER will be performance-checked, in accordance with EMRG 6.1, 6.3, 6.4, and 6.5, daily or when in use by the HSS.

A brief summary of EMRGs relevant to the use and operation of the radioactive substance monitoring equipment is provided in Section 7.3.1.

7.2.2 <u>Chemical Substance Monitoring Instruments</u>

Instruments utilized to monitor chemical substances include organic vapor detectors, colormetric detector tubes, and combustible gas indicators:

- An HNutm PA-101 (or equivalent such as a ThermoDynamicstm Organic Vapor Monitor or RAE Systemstm Mini-RAE) photoionization detector (PID) is utilized to detect organic vapors when opening well casings. The HNutm is capable of ionizing compounds with an ionization potential of less than 11.27 eV (electron volts);
- Drägertm colormetric detector tubes (or equivalent) are utilized to detect the presence of and quantify volatile organic compounds of concern (see Table 5-1) in the event of positive readings observed during PID monitoring; and,
- A Bacharachtm Sentinel 44 (or equivalent) combustible gas indicator (CGI) is used to monitor oxygen and explosive gas concentrations in "methane wells" located in or near the site landfill.

ROCKY FLATS **ENVIRONMENTAL** TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

73 of 123

Effective Date:

Organization:

Environmental Managemen

The use and operation of the PID is outlined in Field Operations guidance FO.15. The PID and the CGI are calibrated by the subcontractor HSS on a daily or as-needed basis.

7.3 Monitoring Strategies

The objectives of site monitoring are to provide a rational basis for the selection of appropriate levels of personal protective equipment and work practice controls, and to document and verify that the selected hazard control procedures are appropriate for actual site conditions.

Real-time monitoring activities conducted as part of the Groundwater Monitoring Program includes field screening of equipment and sample containers for the presence of radioactive substances. Additionally, wells are surveyed for the presence of volatile organic compounds (VOCs) inside the well casing prior to initiating any intrusive activities. Historical air monitoring data, as discussed in Section 7.4.2.2, will also be utilized to assess the potential for the presence of VOCs at well sites. Furthermore, the presence of explosive concentrations of gases is measured in "methane wells" located in or near the site landfill prior to initiating any intrusive activities. Health and safety practices to be utilized when conducting field screening are provided in the following subsections.

7.3.1 Monitoring for Radioactive Substances

Field screening for radioactive substances will be performed in accordance with appropriate Environmental Management Radiological Guidance (EMRG) documents. Detailed usage

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

0 74 of 123

Effective Date: Organization:

Environmental Management

methodologies and action levels are provided in the EMRGs. The HSS will maintain a set of current EMRGs to serve as ready reference; a listing of EMRGs is provided in Table 7-1.

Frequencies of radiological surveys will be determined by the subcontractor HSS in consultation with Radiological Engineering (RE), and in accordance with EMRG 3.1, EMRG 3.2, and HSP 18.01.

7.3.2 Monitoring for Chemical Substances

Real-time air monitoring will be conducted with the photoionization detector (PID) to provide an indication of potential volatile organic compound (VOC) hazards. Historical air monitoring data, as discussed in Section 7.4.2.2, will also be utilized to identify the potential for the presence of VOCs. The PID will be used as a screening device while performing activities having a reasonable potential for exposure to organic vapors, such as opening groundwater monitoring well casings. If levels of organic vapors above background levels are detected, Drägertm colormetric detector tubes (or equivalent) will be utilized to assist in the identification and quantification of the specific compounds. The results of the monitoring will be compared to action levels to determine the appropriate level of PPE according to the decision logic provided in Section 7.4.2.2. Action levels for chemical substances are discussed in Section 7.4.2.3 and provided in Table 7-2. The following paragraphs describe monitoring strategies used for detecting chemical substances. The reader is instructed to refer to Section 7.4.3 for definitions of PPE ensembles.

Field personnel will follow the monitoring procedures detailed below when opening well casings prior to conducting any intrusive activities. Available data will be reviewed for information about

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

75 of 123 3/15/95

Organization:

Environmental Management

potentially hazardous VOCs associated with the well. Data may be obtained from the previous laboratory analytical results, if prior sampling and analysis has been conducted. If no data is available, the "worst case" scenario will be assumed.

7.3.2.1 Photoionization Detector Monitoring

PID monitoring will be conducted only with a PID utilizing a lamp of at least 11.7 eV. Field personnel will verify the use of correct lamp prior to any monitoring.

The well will be approached from upwind while wearing Level D PPE and conducting continuous air monitoring with the PID. The well casing will be opened the minimum amount necessary to insert the PID probe and conduct headspace monitoring. Positive headspace readings will require immediate breathing zone monitoring. If PID readings indicate that breathing zone VOC levels are at or below background readings, work may proceed. Breathing zone VOC concentrations above background levels will warrant the workers exiting the work zone, contacting the HSS, and conducting colormetric detector tube monitoring for compounds of concern if requested, as described below.

7.3.2.2 Colormetric Detector Tube Monitoring

The following volatile organic compounds of concern have been identified as reasonably anticipated to be present:

- Benzene;
- Carbon Tetrachloride:

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

76 of 123

Page: Effective Date: Organization:

Environmental Management

- Chloroform;
- 1,1-Dichloroethene (vinylidene chloride);
- Methylene Chloride;
- Tetrachloroethane; and,
- Vinyl Chloride.

Colormetric detector tube monitoring will be conducted if requested by the HSS in order to verify or eliminate the presence of these compounds. Readings at concentrations which exceed action levels presented in Section 7.4.2.3 for these compounds will require workers to exit the work zone. Workers will contact the HSS for instruction on the procedures to follow. The HSS, at his discretion, may elect to either allow the well to vent, with periodic monitoring to measure VOC and compound of concern concentrations, or require workers to conduct activities in Level C respiratory protection. In no case will the HSS require Level C work if concentrations of compounds of concern exceed maximum use concentrations for air purifying respirators. The presence of compounds with poor warning qualities, such as benzene, carbon tetrachloride, methylene chloride, chloroform, or vinyl chloride, will require the utilization of Level B respiratory protection. Level C (or lower) respiratory protection may not be utilized in the presence of these compounds. If such conditions exist, the well will be allowed to vent until concentrations less than maximum use concentrations are attained prior to continuation of work at that site.

7.3.2.3 Combustible Gas Indicator Monitoring

When conducting Groundwater Monitoring Program activities at "methane wells" in or near the site landfill, the combustible gas indicator (CGI) will be utilized to measure the presence of explosive

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

. 0

Page: Effective Date:

77 of 123 3/15/95

Organization:

Environmental Management

gases in the well casing and breathing zone. The CGI measures percent oxygen and percent of lower explosive limit (LEL) of explosive gases, relative to a methane gas calibration standard. The presence of explosive gases in excess of 25% of the LEL will require field crews to allow the well to vent, to ensure that all equipment utilized in the immediate vicinity of the well is intrinsically safe, and that no potential ignition sources are located near the well.

It should be noted that oxygen-deficient atmospheres, such as those potentially encountered in the "methane wells," may adversely affect the performance of the CGI. Accordingly, the percent of oxygen concentration in the well should be measured prior to measurement of explosive gas concentrations. Oxygen concentrations less than 19.5% may render LEL readings invalid.

Intrusive tasks conducted at the "methane wells" are to be conducted only when local wind speed exceeds 15 miles per hour. Field crews will measure local wind speed with a handheld anemometer when conducting activities at "methane wells." If local wind speed drops below 15 miles per hour, work at that site will be terminated and resume only when the minimum threshold is reached. Only intrinsically safe instruments will be used in the methane wells. A PID and CGI will be utilized to monitor air quality in the "methane wells" and the worker breathing zones.

7.4 Personal Protective Equipment

Personal Protective Equipment (PPE) comprises the "last line of defense" against health hazards, following engineering controls and good work practices. Engineering controls are not applicable to intrusive activities conducted as part of the Groundwater Monitoring Program. Good work

ROCKY FLATS **ENVIRONMENTAL** TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

Effective Date:

Organization:

Environmental Managen

practices are identified in appropriate SOP GWs and FOs. PPE for Groundwater Monitoring Program activities consists of clothing to protect the workers from physical, radiological, or chemical hazards, and respiratory protection to reduce or eliminate the potential for inhalation of hazardous substances.

The following subsections describe general PPE clothing and respirator requirements for Groundwater Monitoring Program operations. PPE ensembles (complementary clothing and respirator requirements) are outlined in Section 7.4.3. PPE requirements for Groundwater Monitoring Program tasks are provided in Section 7.5.

7.4.1 Clothing

PPE clothing consists of items designed to protect the worker from physical, radiological, and chemical hazards. The basic field work uniform consists of Department of Energy (DOE) cotton coveralls, steel-toed work boots, and safety glasses. Cotton surgical "scrubs" may be worn as an alternative to DOEs. A personal radiation dosimetry badge will be worn when conducting any RCA activities. Hard hats are to be worn in situations presenting a potential hazard from falling objects, and leather gloves may be warranted for activities with the potential for cuts or puncture wounds to the hands.

Upgrading the basic uniform will provide additional protection from dust and liquid hazards. Disposable chemical-resistant coveralls, such as Tyvektm or equivalent, protect the worker from skin contact with airborne contaminants. If a splash hazard is present, the coveralls may be further upgraded to a coated material such as Saranextm or equivalent. Alternatively, splash protection may be afforded by wearing an apron.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

Organization:

RFP/ER-SAF-94-GMP

Environmental Managemen

Effective Date:

79 of 123 3/15/95

Hand, foot, and face protection may be similarly upgraded. Surgical rubber inner gloves, possibly combined with nitrile or butyl outer gloves, provide hand protection from dust or liquid chemical hazards. Foot protection may be upgraded with chemical-resistant boots. The face may be

protected from splash hazards by a face shield or a full-face respirator.

It should be noted that coverall sleeves and legs will be worn over or under the cuffs of gloves and boots depending on the specific hazard presented by a given task. If a splash hazard exists, sleeves and pant legs will be worn outside gloves and boot covers. If a dust hazard is present, the coverall sleeves and pant legs will be worn <u>inside</u> glove cuffs and boot covers. Tape will be used to seal the joints between coveralls, protective gloves, and cuffs.

7.4.2 Respirators

Respirators provide workers with protection from the inhalation of hazardous substances. Respiratory protection at Rocky Flats includes half- or full-face air-purifying respirators (APR), and self-contained breathing apparatus (SCBA) or supplied-air line with escape SCBA. For Groundwater Monitoring Program operations, respiratory protection is generally not necessary unless air monitoring, as described above, indicates that respiratory protection is required. A fullface respirator with organic vapor/acid gas and radionuclide cartridges will be utilized if air monitoring indicates that action levels for compounds of concern (listed in Table 7-2) are exceeded.

APRs will be maintained in accordance with a Rocky Flats-approved Respiratory Protection Program maintenance schedule. Respirators will be inspected on a semi-annual basis at a minimum. If used as part of an Emergency Response program, respirators will be inspected on a

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

80 of 123 3/15/95

Organization:

Environmental Management

monthly basis at a minimum. The respirations shall be stored properly: in a sealed plastic bag, facedown, and not stacked.

Before being taken in the field, each APR will be inspected, appropriate cartridges installed, a positive and negative pressure check conducted, and the entire APR assembly will be sealed in a plastic bag. The APR will remain in the sealed bag until needed. If the APR is not used and the sealed bag is not damaged, the respirator may remain at the work site inside an area protected from weather. The enclosed cab of a vehicle is considered to be one example of a protected area.

After the APR has been used, the following cleaning and maintenance procedures will be followed:

- Cartridges from the APR will be removed and disposed of as contaminated PPE weekly, or whenever monitoring indicates that the cartridges have been exposed to concentrations of contaminants above Permissible Exposure Limits (PELs);
- The APR interior and exterior will be wipe-tested for radioisotopes before being cleaned if radioactivity was detected while the APR was being used or whenever crew members exit on RCA. If the wipe test indicates the presence of radioactivity, EMRG 2.2 will be consulted for appropriate procedures to be utilized in response to potential inhalation of radioactive materials. The APR will be thoroughly cleaned with premoistened towellettes and wipe-tested again. The used towellettes will be disposed of as contaminated PPE;
- If the second wipe test indicates the presence of radioactivity, the APR will be sealed in a plastic bag, the bag will be labelled to indicate the presence of radioactivity on the APR, and the SSO notified. APRs found to be radiologically contaminated will not be placed in the cleaning and rinse solutions at the shower trailer;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

81 of 123

Organization:

3/15/95 Environmental Management

- For APRs not exposed to radiological contamination, the APR facepiece interior and exterior will be wiped down with premoistened towellettes and subsequently sealed in a plastic bag for transport to the APR cleaning station at the shower trailer; and,
- After the APR has been cleaned and rinsed, it will be dried with a clean towel and stored in a clean, sealed plastic bag.

7.4.2.1 Respiratory Protection Program

Personnel performing tasks which require respiratory protection will be trained and fitted for respirators in accordance with a Rocky Flats-approved Respiratory Protection Program. Subcontractors may either submit their own Respiratory Protection Programs for Rocky Flats approval or comply with the Rocky Flats Respiratory Protection Program provided in HSP 1-G2200-HSP-7.03. Subcontractors are responsible for ensuring that their employees comply with their respiratory program. Each individual is responsible for the cleaning, inspection, maintenance, and storage of any APR they use.

7.4.2.2 Respirator Decision Logic

The decision to wear respiratory protection is based on the potential for hazardous constituents to be present in the breathing zone of the worker. Situations with a known potential for the presence of such constituents, such as intrusive activities at wells with a previous history of compound of concern concentrations above permissible exposure limits in the breathing zone, require respiratory protection while conducting real-time monitoring with an PID. Other situations, such as intrusive activities at wells which have not yet been characterized by an analytical laboratory and are in locations reasonably anticipated to high concentrations of compounds of concern, have an

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

82 of 123

Effective Date:

3/15/95

Organization: Environmental Management

unknown potential for the presence of airborne hazardous constituents and may require respiratory protection. Finally, some situations have no potential for the presence of airborne hazardous constituents and require no respiratory protection. Situations with no potential for the presence of airborne hazardous constituents include well casing headspace and breathing zone analysis for wells with no history or reasonable likelihood of contamination, such as those located in the Buffer Zone.

Each of these situations requires a different response by the field worker. The field worker, in conjunction with the HSS, will utilize the monitoring strategies presented in Section 7.3 to determine appropriate respiratory protection.

Historical data detailing air monitoring results for well casing and breathing zone surveys are provided in Appendix E. These data will be utilized during pre-sampling planning to determine appropriate respiratory protection levels for each sampling location.

The data provided in Appendix E were obtained by air monitoring with a PID. In accordance with the action levels presented in Table 7-2, any well listed as exhibiting PID readings above background should be approached from upwind while monitoring air quality with colormetric detector tubes, following procedures outlined in Section 7.3.2.2.

7.4.2.3 Respirator Action Levels

Real-time air monitoring, as described in Section 7.3, will provide field workers with information necessary to determine appropriate respiratory protection. Certain threshold values have been established for particular compounds; the exceedance of these values requires a specific action.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

83 of 123

Effective Date:

3/15/95

Organization:

Environmental Management

Accordingly, these values are termed "action levels." Action levels have been set requiring the upgrade from no respiratory protection (Level D and Modified Level D) to APRs (Level C).

Action levels for radioisotopes are defined in EMRGs 3.1 and 3.2; action levels for organic compounds have been set at one half of the permissible exposure limits (PELs) for specific compounds as set by OSHA.

PIDs respond to various compounds according to the calibration standard for the instrument, the power of the instrument, and the compound's ionization potential. Because PIDs provide only a qualitative measure of the presence of volatile organic compounds, action levels for PID instrument use have been set at any reading in the breathing zone above background. The required action when this level is attained is to relocate upwind of the source, allow the well to vent, contact the HSS, and, if requested, conduct colormetric detector tube monitoring. Colormetric detector tubes provide quantitative data about concentrations of particular compounds of concern. Action levels for volatile organic compounds of concern are provided in Table 7-2.

7.4.3 Personal Protective Equipment Ensembles

PPE ensembles consist of certain clothing and respiratory protection elements which, in combination, protect the wearer against certain physical, radiological, and chemical hazards. Established PPE ensembles are summarized below; it should be noted that each ensemble may be modified slightly by task-specific requirements to address particular hazards associated with that task. Task-specific PPE requirements are provided in Section 7.5 and summarized in Table 7-3.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

Page:

84 of 123

Effective Date: Organization:

3/15/95 Environmental Management

7.4.3.1 <u>Level D</u>

Level D PPE is worn while performing tasks with little or no potential for exposure to contaminants. It is the basic work uniform.

Level D PPE consists of:

- Rocky Flats-provided Department of Energy (DOE) cotton coveralls, to be changed daily;
- Minimum 16"-high steel-toed boots;
- Safety glasses with side shields or equivalent;
- Additional seasonal items, as necessary;
- Leather gloves (when handling sharp objects); and,
- Hard hat if an overhead hazard is present.

It should be noted that if a dust hazard is present in an RCA-environment, PPE should be upgraded to Level C if exposure limits established in EMRG 3.1 and 3.2 for radioactive materials are exceeded.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

85 of 123 3/15/95

Organization:

Environmental Management

7.4.3.2 Modified Level D

Modified Level D PPE represents an upgrade of Level D PPE to address possible skin contact with contaminants. Modified Level D PPE is to be worn when conducting tasks with the potential for splash or dust exposure to hazardous constituents, but when no respiratory protection is necessary.

Modified Level D PPE consists of Level D PPE and the following additional items:

- Disposable chemical-resistant gloves (nitrile or equivalent);
- Minimum 16"-high steel-toed, steel shank boots;
- Uncoated chemical-resistant disposable coveralls (Tyvektm or equivalent) or coated chemical-resistant disposable coveralls (Saranextm or equivalent);
- Coverall sleeves and legs will be worn over or under the cuffs of gloves and boots depending on the specific hazard presented by a given task. If a splash hazard exists, sleeves and pant legs will be worn <u>outside</u> gloves and boot covers. If a dust hazard is present, the coverall sleeves and pant legs will be worn <u>inside</u> glove cuffs and boot covers. Tape will be used to seal the joints between coveralls, protective gloves, and cuffs; and,
- Additional seasonal items, as necessary. Any such items will be worn under the disposable coverall.

It should be noted that if a dust hazard is present in an RCA-environment, PPE should be upgraded to Level C if exposure limits established in EMRG 3.1 and 3.2 for radioactive materials are exceeded.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

86 of 123

Page: Effective Date: Organization:

3/15/95 Environmental Management

7.4.3.3 Level C

Level C PPE provides protection from contaminants by using chemical-resistant coveralls and respiratory protection. Level C PPE is to be worn when conducting operations with the potential for exposure to airborne hazardous constituents requiring respiratory protection.

Level C PPE consists of:

- Rocky Flats-supplied DOE cotton coveralls to be changed daily;
- Uncoated chemical-resistant disposable coveralls (Tyvektm or equivalent), or coated chemical-resistant disposable coveralls (Saranextm or equivalent);
- Coverall sleeves and legs will be worn over or under the cuffs of gloves and boots depending on the specific hazard presented by a given task. If a splash hazard exists, sleeves and pant legs will be worn <u>outside</u> gloves and boot covers. If a dust hazard is present, the coverall sleeves and pant legs will be worn <u>inside</u> glove cuffs and boot covers. Tape will be used to seal the joints between coveralls, protective gloves, and cuffs;
- Disposable chemical resistant inner gloves (as necessary);
- Butyl or nitrile outer gloves;
- Minimum 16"-high steel-toed, steel shank boots;
- Full-face APR with appropriate high-efficiency particulate air (HEPA) cartridges that provide protection against organic vapors, acid gases, and radioisotopes; and,
- Additional seasonal items, as necessary. Any such items will be worn under the disposable coverall.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

87 of 123 3/15/95

Organization:

Environmental Management

7.5 Required Levels of Personal Protective Equipment Per Task

Tasks performed at or associated with Groundwater Monitoring Program activities are conducted in accordance with appropriate SOP GWs and FOs. A listing of SOP GWs and FOs relevant to Groundwater Monitoring Program operations is provided in Table 7-3. Any task performed by the subcontractor not listed in Table 7-3 may be considered a special circumstance and require consultation with the HSO and EG&G PM to identify health and safety issues associated with the task. As described in Section 7.5.23, special circumstances will require preparation of a task-specific Health and Safety Plan by the subcontractor HSO.

This section briefly outlines activities associated with each task, and identifies PPE requirements to perform those activities. PPE requirements for each task are also presented in Table 7-3. <u>In all cases where air monitoring is required, the monitoring strategies provided in Section 7.3 will be utilized prior to initiation of intrusive activities.</u> Additionally, in all cases where intrusive activities involving designated "methane" wells, the monitoring strategies provided in Section 7.3.2.3 will be followed.

7.5.1 SOP GW.1: Water Level Measurements in Wells and Piezometers

Task Description

The Groundwater Monitoring Program subcontractor conducts water level measurements in site monitoring wells and piezometers on a scheduled basis. Air monitoring is conducted prior to water level measurement. Water level measurement consists of placing an electronic water level probe in the well and recording the depth to water based on an audible alarm which sounds when the probe contacts the water surface. The measurement is recorded on the appropriate field data form.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

88 of 123

Effective Date: Organization:

Environmental Manageme

Refer to Section 7.3.2.3 for information on conducting water level measurements in "methane" wells.

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

In general, performing this task requires the use of Level D PPE with nitrile or butyl gloves. Consult the radiation work permit (RWP) for PPE requirements when conducting in water level measurements in wells or piezometers in RCAs or any other areas with known radiological contamination, such as IHSSs.

7.5.2 SOP GW.2: Well Development

Task Description

Well development is undertaken on new wells to remove drilling fluids and mobile particulates, and on old wells to remove sediment, from the water column in the well. Water level measurement in accordance with SOP GW.1 is performed, and groundwater is evacuated from the well using a bailer or inertial pump. Recovered groundwater is retained in a graduated container to measure quantity, transferred to a tank in the field vehicle, and transported to the Main Decontamination Facility (MDF) for disposal.

Refer to Section 7.3.2.3 when conducting well development in "methane" wells.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

89 of 123

Page: Effectiv

3/15/95

Effective Date: Organization:

Environmental Management

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

In general, Level D PPE with nitrile or butyl gloves will be worn when conducting well development activities. Consult the radiation work permit (RWP) for PPE requirements when conducting well development in RCAs or any other areas with known radiological contamination.

7.5.3 SOP GW.3: Pump-in Borehole Packer Testing

Task Description

Pump-in borehole packer testing is occasionally utilized at Rocky Flats to evaluate aquifer characteristics such as hydraulic conductivity. Associated tasks include SOP GW.1. Three types of packer tests are used: constant head, constant rate of flow, and pressure pulse tests. Each of these tests require placing the packer in an open borehole, inflating the packer, and monitoring measurements of water levels or pressure differentials as stress is induced on a portion of the borehole.

Refer to Section 7.3.2.3 when conducting packer testing in "methane" wells.

ROCKY FLATS ENVIRONMENTAL **TECHNOLOGY SITE** Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

90 of 123 **Effective Date:**

Organization:

Environmental Managemen

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

In general, PPE appropriate for conducting pump-in borehole packer testing consists of Level D with nitrile or butyl gloves. Consult the radiation work permit (RWP) for PPE requirements when conducting pump-in borehole packer tests in RCAs or any other areas with known radiological contamination.

7.5.4 SOP GW.4: Slug Tests

Task Description

Slug tests are occasionally performed in site monitoring wells and piezometers to measure the rate of water level recovery in the well. Associated tasks include SOP GW.1. The procedure involves the introduction of a solid slug into the standing water column in the well while simultaneously measuring water levels during the period of recovery to static conditions.

Refer to Section 7.3.2.3 when conducting slug tests in "methane" wells.

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

Effective Date:

91 of 123

Organization:

Environmental Manageme

In general, slug tests will be performed in Level D PPE with the addition of nitrile or butyl gloves. Consult the radiation work permit (RWP) for PPE requirements when conducting slug tests in RCAs or any other areas with known radiological contamination.

7.5.5 SOP GW.5: Field Measurement of Groundwater Field Parameters

Task Description

Field crews are required to measure certain chemical and physical characteristics of groundwater during well development and purge activities. Associated tasks include SOP GW.1 and SOP GW.2. These characteristics include temperature, pH, specific conductance, nitrate, and turbidity. Field crews measure these parameters at established volumetric intervals using field instruments such as the Hach DR2000 Spectrophotometer (or equivalent).

Refer to Section 7.3.2.3 when conducting field measurement of groundwater field parameters in "methane" wells.

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

In general, field measurement of groundwater field parameters shall be conducted in Level D PPE. Consult the radiation work permit (RWP) for PPE requirements when conducting field measurement of groundwater field parameters in RCAs or any other areas with known radiological contamination.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

92 of 123

Effective Date: Organization:

Environmental Management

7.5.6 SOP GW.6: Groundwater Sampling

Task Description

Groundwater sampling is the primary task of the Groundwater Monitoring Program subcontractor. Associated tasks include SOP GW.1, SOP GW.2, and SOP GW.5. The wells are purged and samples collected with bailers and a hand reel system.

Refer to Section 7.3.2.3 when conducting groundwater sampling in "methane" wells.

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

In general, groundwater sampling will be conducted in Level D PPE with the addition of nitrile or butyl gloves. Consult the radiation work permit (RWP) for PPE requirements when conducting groundwater sampling in RCAs or any other areas with known radiological contamination.

7.5.7 SOP GW.8: Aquifer Pumping Tests

Task Description

Step-drawdown and constant rate discharge pumping tests are performed in well points and completed wells. Aquifer pumping tests are performed by pumping wells at fractions of full capacity while varying pumping rates in a time step fashion, and/or pumping at a constant rate.

ROCKY FLATS **ENVIRONMENTAL** TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

93 of 123

Effective Date: Organization:

3115195 **Environmental Management**

Water levels are simultaneously measured in the production well or nearby observation wells.

Water level measurements are conducted in accordance with SOP GW.1.

Refer to Section 7.3.2.3 when conducting aquifer pumping tests in "methane" wells.

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

In general, aquifer pumping tests will be conducted in Level D PPE with the addition of nitrile or butyl gloves. Consult the radiation work permit (RWP) for PPE requirements when conducting aquifer pumping tests in RCAs or any other areas with known radiological contamination.

7.5.8 SOP FO.01: Air Monitoring and Dust Control

Task Description

Air monitoring and dust control activities are generally not conducted by the Groundwater Monitoring Program subcontractor. However, intrusive activities conducted at "methane wells" in the vicinity of the site landfill are to be conducted only when wind velocity exceeds 14 miles per hour. A hand-held anemometer will be utilized by field crews to verify wind speed prior to conducting intrusive activities at these locations.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

TIME-PC-TAG-AG

Page:

94 of 123

Effective Date: Organization:

3/15/95 Environmental Management

PPE Requirements

At a minimum, Level D PPE is required for this task.

7.5.9 SOP FO.02: Transmittal of Field OA Records

Task Description

Field QA records must be properly completed, authenticated, and provided with a unique identification number. A package of QA records is to be transmitted to the responsible EG&G project manager at least once every seven days. This task is conducted in the subcontractor Base Laboratory.

PPE Requirements

At a minimum, Level D PPE is required for this task.

7.5.10 SOP FO.03: General Equipment Decontamination

Task Description

General equipment decontaminated in the field and at the Main Decontamination Facility (MDF) consists of sampling and monitoring equipment utilized by the field crews. Decontamination activities will be conducted in accordance with the Decontamination Facility HASP. Procedures to conduct equipment decontamination depend upon the specific piece of equipment, the location in which the equipment was used, and the location where the decontamination activity is conducted.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

95 of 123 **Effective Date:** 3/15/95

Organization:

Environmental Management

Procedures to conduct general equipment decontamination include the following steps:

- Prior to arriving at the MDF, the user will conduct a pre-decontamination radiological survey for alpha, beta, and gamma contamination, including an equipment frisk and a smear sample for removable contamination. Additionally, the user will conduct an organic vapor monitoring survey with an Organic Vapor Detector;
- Survey results will be reviewed by the Decontamination Facility Subcontractor (DFSC) and user HSSs for elevated levels of contamination (above EMRG 3.1 guidelines for radiological parameters or above action levels provided in Table 7-2 for organic vapors). RE and/or IH will be notified if elevated levels are identified;
- If the equipment to be decontaminated originates in an RCA, an RWP will be developed and the MDF will be posted as an RCA during decontamination activities. If the equipment does not originate from an RCA, no special posting is required unless directed by RE;
- Following acceptance of survey results, the equipment will be decontaminated by the user, using the pressurized steam cleaner. General procedures for equipment decontamination require removal of residual contaminants, placement of the equipment on the wash rack with open end down (if applicable), and standing upwind or crosswind of the equipment while using the steam cleaner. The equipment is to be placed in a clean area to air dry, or the equipment is dried using disposable towels;
- The DFSC or user HSS will conduct a post-decontamination radiological survey of the equipment if radiological contamination was detected prior to decontamination; and.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

96 of 123

Effective Date: Organization:

3/15/95 Environmental Management

The DFSC or user HSS will conduct a post-decontamination radiological survey of the MDF if the MDF was posted as an RCA or radiological contamination was detected on equipment prior to decontamination, and provide the results to the DFSC HSS.

PPE Requirements

In general, PPE required for field decontamination consists of Level D with the addition of nitrile or butyl gloves. Consult the radiation work permit (RWP) for PPE requirements when conducting field general equipment decontamination in RCAs or any other areas with known radiological contamination.

For decontamination activities at the MDF, PPE utilized to conduct the pre- and post-decontamination radiological surveys consists of Level D. If the radiological frisk identifies contamination above EMRG 3.1 or 3.2 limits, the survey will be temporarily discontinued and the MDF posted as an RCA. Level C PPE will be donned and the survey completed.

PPE utilized while performing decontamination activities at the MDF is comprised of Modified Level D, with coated disposable chemical-resistant coveralls such as Saranextm or equivalent. Additionally, a faceshield and nitrile or butyl gloves will be worn. PPE may be upgraded to Level C if the MDF is designated as an RCA.

ROCKY FLATS **ENVIRONMENTAL** TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

Effective Date: Organization:

Environmental Management

7.5.11 SOP FO.05: Handling of Purge and Development Water

Task Description

Purge and development water originating from groundwater monitoring wells is collected in buckets during purge and development activities at each well. Water is transferred to a holding tank in the field vehicle, and transported to the MDF for disposal in the MDF sedimentation tanks. The water is transferred into the sedimentation tanks by the field crew and the MDF subcontractor through a pump and purge hose.

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

In general, PPE requirements for collection of purge and development water at each well location consists of Level D PPE. Consult the radiation work permit (RWP) for PPE requirements when handling purge and development water in RCAs or any other areas with known radiological contamination.

PPE requirements for purge and development water transfer operations is comprised of Level D PPE with the addition of ear plugs (when using a gasoline-powered pump), nitrile or butyl gloves, and a splash apron.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

3/15/95

Organization: Environmental Management

7.5.12 SOP FO.06: Handling Personal Protective Equipment

Task Description

PPE generated from Groundwater Monitoring Program operations is disposed of at the subcontractor Base Laboratory. PPE disposal requirements vary according to whether the PPE is radiologically contaminated or not. When the container is full, the subcontractor HSS will conduct a Bicrontm Frisk-tech survey of the PPE. If the PPE is identified as contaminated or potentially contaminated, RE will be notified and the subcontractor will dispose of the PPE according to RE guidelines. If the results of the FIDLER gamma survey indicate that the PPE is not radiologically contaminated, the PPE will be disposed of as uncontaminated material. Disposal for uncontaminated PPE consists of placing the PPE in double plastic bags, sealing the bags, labelling them as uncontaminated PPE, and transferring the PPE to Rocky Flats Environmental Operations Personnel.

PPE Requirements

PPE to be utilized for handling used PPE consists of Level D with nitrile or butyl gloves.

7.5.13 SOP FO.07: Handling of Decontamination Water and Wash Water

Task Description

Water generated from decontamination and wash activities is disposed of at the MDF. Water may be generated from field activities or from MDF pad activities. The water flows to or is placed in

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

99 of 123 3/*15/95*

Effective Date: Organization:

Environmental Management

the MDF sump, and is pumped through the separators to Sedimentation Tank 1. Subsequent handling of decontamination water and wash water is conducted by the MDF operator.

PPE Requirements

PPE required for handling decontamination and wash water consists of Level D with the addition of ear plugs (when using a gasoline-powered pump), nitrile or butyl gloves, and a splash apron. Consult the radiation work permit (RWP) for PPE requirements when handling decontamination water or wash water in RCAs or any other areas with known radiological contamination.

7.5.14 SOP FO.11: Field Communications

Task Description

Field crews will utilize the buddy system, and radio communication is required. Knowledge of audible alarms, as described in Section 8.4, is required. Hand signals may be appropriate in high noise situations. LS/DW (Life Safety/Disaster Warning) announcements will be relayed via radio to field crews by their supervisor.

PPE Requirements

At a minimum, Level D (standard work uniform) will be worn when conducting field communications.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

17/ER-SAF-94-GWIF 0

Page:

100 of 123

Effective Date: Organization:

Environmental Management

7.5.15 SOP FO.12: Decontamination Facility Operations

Task Description

General equipment and heavy equipment decontamination activities not conducted in the field are performed at the Main Decontamination Facility (MDF) or Protected Area Decontamination Facility (PADF). Decontamination operations at either facility require pre- and post-decontamination radiological surveys by an HSS. Decontamination operations will be performed in accordance with FO.3 and FO.4 requirements, and in accordance with the requirements of the Decontamination Facility HASP.

PPE Requirements

PPE requirements for Groundwater Monitoring Program personnel conducting FO.12 tasks includes Level D clothing with butyl or nitrile gloves, and ear plugs. If actual decontamination activities requiring the use of the steam cleaner will be performed, Modified Level D PPE is required. Respiratory protection will be upgraded according to RWP requirements if the Decontamination Facility is designated as an RCA.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

rage:

101 of 123

Effective Date: Organization:

3/15/95 Environmental Management

7.5.16 SOP FO.13: Containerization, Preserving, Handling and Shipping of Soil and Water Samples

Task Description

Groundwater samples are preserved by the placement of liquid preservatives in the bottles prior to sample collection. Placement of the preservative is performed in the subcontractor preservative room laboratory. The preservative room is ventilated with a positive-pressure blower. A pipette is used to place the preservative in the bottle.

Groundwater samples collected from monitoring wells are shipped to analytical laboratories for analysis. Samples are collected from the monitoring wells, placed in appropriate sample bottles, and the bottles are placed in a shipping cooler. The exteriors of the bottles and the shipping cooler are surveyed for radiological contamination and decontaminated as necessary. Sample bottle and cooler handling includes a direct frisk and swipe sample radiological survey for alpha, beta, and gamma contamination. The sample bottles and coolers are decontaminated as necessary; the bottles are placed in sealed plastic bags, and shipped in a sealed cooler. Water used for decontaminating bottle and cooler exteriors is disposed in the MDF sump. At no time will sample bottles or coolers be shipped prior to the HSS determination, through radiological survey, that EMRG 3.1 and 3.2 limits have not been exceeded. Shipped samples will have a PRE and Transfer tag.

Shipping requirements for soil and water samples includes preparation of appropriate paperwork and assurance that the shipment is in compliance with relevant DOT shipping regulations.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

102 of 123

Effective Date: Organization:

3/15/95 Environmental Management

PPE Requirements

In general, water sample containerizing and handling will be conducted in Level D PPE with nitrile or butyl gloves. Refer to Section 7.5.6, "SOP GW.6: Groundwater Sampling," for additional details on PPE requirements when containerizing and handling water samples.

Sample preservation PPE requirements consist of Level D with nitrile or butyl gloves, a splash apron, and a faceshield.

At a minimum, Level D PPE is required when shipping sample containers.

7.5.17 SOP FO.14: Field Data Management

Task Description

Field data management is comprised of data entry into the Rocky Flats Environmental Data System (RFEDS). This task is an office activity conducted by the subcontractor.

PPE Requirements

An office work uniform is appropriate for this task; no special PPE is required.

ROCKY FLATS ENVIRONMENTAL **TECHNOLOGY SITE** Manual: Revision No.: RFP/ER-SAF-94-GMP

103 of 123

Effective Date: Organization:

Environmental Managem

7.5.18 SOP FO.15: Photoionization Detectors (PID) and Flame Ionization Detectors (FID)

Task Description

Photoionization Detectors (PIDs) are used by the Groundwater Monitoring Program subcontractor when conducting well casing headspace analysis prior to water level measurement, well development, or sample collection. Specific monitoring strategies for these instruments are described in Section 7.3.2.

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

PPE required to perform PID monitoring generally consists of Level D during monitoring prior to sampling. Refer to task-specific descriptions for PPE requirements during PID monitoring.

7.5.19 SOP FO.16: Field Radiological Measurements

Task Description

Field radiological measurements are performed by RPTs or the subcontractor HSS. Measurements include collection and survey of smear samples, as well as field frisks of personnel and equipment. The results of the surveys are typically compared to EMRG 3.1 and 3.02 release criteria.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

Effective Date: Organization: **Environmental Management**

104 of 123

PPE Requirements

In general, PPE requirements for conducting field radiological measurements consists of Level D with nitrile or butyl gloves. Consult the radiation work permit (RWP) for PPE requirements when conducting field radiological measurements in RCAs or any other areas with known radiological contamination.

7.5.20 SOP FO.18: Environmental Sample Radioactivity Content Screening

Task Description

Environmental sample radioactivity content screening is conducted on sample containers and sample coolers by the subcontractor HSS prior to shipment to analytical laboratories.

PPE Requirements

In general, PPE requirements for conducting environmental sample radioactivity content screening consists of Level D with nitrile or butyl gloves.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

CFP/ER-SAF-94-GMP

Page:

105 of 123

Effective Date: Organization:

3/15/95 Environmental Management

7.5.21 SOP FO.19: Base Laboratory Work

Task Description

Base Laboratory work is conducted at the subcontractor trailer and consists of staging equipment for sampling activities, storing and preparing sample containers and sample sets, receiving, preparing, and shipping samples, and equipment storing and calibration.

PPE Requirements

Base Laboratory work will be conducted in Level D PPE.

7.5.22 SOP FO.25: Shipment of Radioactive Materials Samples

Task Description

Radioactive materials samples are shipped to analytical laboratories for analysis. Samples are shipped after appropriate survey and decontamination, if necessary, as described in Section 7.5.20.

PPE Requirements

At a minimum, Level D PPE will be worn by personnel conducting FO.25 tasks.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

106 of 123

Effective Date: Organization:

3/15/95 Environmental Management

7.5.23 Special Tasks Conducted by the Groundwater Monitoring Program Subcontractor

Task Description

The Groundwater Monitoring Program subcontractor may be required by Rocky Flats to perform tasks which are not specifically provided for in the GW SOPs and FOs listed above. In the event that the subcontractor is requested to perform "out of scope" tasks, the individual requesting performance of the task will complete a Health and Safety information form for the subcontractor. A Special Task Health and Safety Plan will be prepared by the subcontractor Health and Safety Officer. The information form and Special Task Health and Safety Plan are provided in Appendix E.

PPE Requirements

Refer to Section 7.3.2 for air monitoring PPE requirements.

The specific risks associated with each task must be assessed based on information provided by the requestor, and appropriate PPE selected by the HSO in consultation with the EG&G PM, if necessary.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

107 of 123

Effective Date: Organization:

Environmental Management

8.0 EMERGENCY RESPONSE PROCEDURES

8.1 Radio Communications

Field teams will have a method of communicating with both the field office trailer and other field teams. Radio communications are required. Each field crew will be issued a radio for communication with the subcontractor Base Laboratory trailer office. Field crews will be required to utilize assigned open channel radio frequencies, and "check in" with the subcontractor office at least every two hours. The Base Laboratory will utilize the radios to relay messages, such as LS/DW announcements, to field crews.

8.2 <u>Emergency Telephone</u>

Emergency help is accessed by any Rocky Flats phone or field radios. The closest accessible telephone during all work hours will be identified by the HSS before beginning field activities in case radio communication with the communication center is not possible. All Rocky Flats guard posts have telephones.

The subcontractor Base Laboratory trailer office will be equipped with telephone communications and shall be attended at all times during operations. Emergency telephone numbers, as listed below and in Table 8-1, are posted near the office telephones and at the office entrances.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

108 of 123 3/15/95

Organization:

Environmental Management

Site Health and Safety Officer	(303) 966-6079
24-Hour Installation Health/Safety Coordinator	(303) 966-2911
Fire	(303) 966-2911
Ambulance	(303) 966-2911
Poison Center	(303) 629-1123
Security	(303) 966-2911
Police	(303) 966-2911
Medical Facility General Information	(303) 966-2594
NEAREST MEDICAL SERVICES ARE LOCATED AT:	Building 122

8.3 Medical Facilities

The Rocky Flats Medical Facility provides emergency care and ambulance service for on-site incidents. Telephone numbers for the Rocky Flats Medical Facility are provided below:

•	General Information	966-2594
•	Ambulance Service	966-2911
•	Emergency Telephone	966-2911
•	Fire/Explosion	966-2911

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

109 of 123

115

Effective Date:

Organization:

Environmental Mánagemen

Directions to the Medical Facility (Building 122, Central Avenue, Figure 8-1) are as follows:

From the Contractor's trailer compound, take a northbound street to Central Avenue and turn left onto Central Avenue: Building 122 will be on the left side and slightly west of a guard building on the right after approximately 1.25 miles.

From the Rocky Flats eastern boundary, upon entering Rocky Flats from Indiana Street, you will be on Central Avenue. Proceed approximately 3.5 miles: Building 122 will be on the left side.

From the Rocky Flats western boundary at Hwy. 93, proceed along the entrance road to just past the gate, at which time you will be eastbound on Cactus Avenue. Then turn left onto the first street past Second Street, (Third Street, which is not marked). Proceed up Third Street past Building 125, which is on the left: the next building on the left will be the medical facility (Building 122).

8.4 **Emergency Response Procedures**

The On-site Project Manager, with assistance from the SSO, has responsibility and authority for coordinating all emergency response activities until proper authorities arrive and assume control.

The subcontractor will develop an Emergency Response Exercise program, submitted to the EG&G Project Manager and Environmental Restoration Health and Safety Officer for approval, in order to practice Emergency Response procedures prior to an actual emergency. At a minimum, the Emergency Response Exercise should involve a reasonable emergency scenario that requires actions in the following areas:

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

110 of 123 3/15/95

Organization:

Environmental Management

- Emergency recognition;
- Safe distance and place of refuge (assembly area) designation;
- Site security and control;
- Evacuation routes;
- Emergency treatment and first aid;
- Personnel and equipment decontamination;
- Emergency communication;
- PPE and emergency equipment uses; and,
- A follow-up meeting to discuss effectiveness of the exercise and recommended actions.

The exercise will be conducted at a minimum frequency of every 6 months.

Audible emergency alarms are used at Rocky Flats to alert personnel of specific emergencies. A list of the specific warnings, associated sound, and instructions for response, is provided in Table 8-2.

8.4.1 <u>Fire/Explosion</u>

Fire emergencies will be handled by immediately notifying the fire department (2911). Only if a fire appears to be small and easily extinguishable will personnel attempt to control it with fire extinguishers available in the work area. Otherwise, immediate evacuation of the area is required.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

Effective Date:

111 of 123

Organization:

Environmental Managemen

In the event of an explosion, all personnel shall be evacuated and the fire department notified. No one shall re-enter the area until re-entry has been cleared by the fire department.

8.4.2 Physical Injury

In case of injuries to personnel, the SSO will be notified first, then first aid treatment will be initiated immediately by trained personnel. In case of serious injuries, the SSO/base lab shall call 2911. As groundwater sites are often in remote areas, the emergency personnel may respond faster by coming to the base lab and getting a knowledgeable escort. All serious injuries (e.g., snake bites) will be transported by Rocky Flats Emergency response personnel and vehicles. Minor injuries may be treated on site (first aid), but all injuries will be evaluated by Rocky Flats medical personnel.

In the event the injured person is contaminated with chemicals or radionuclides, decontamination will be performed to prevent further exposure only if it will not further aggravate the injury.

8.4.3 Injury Due to Heat

If a person is suffering from heat exhaustion (profuse perspiration, normal body temperature), the following procedures will be taken:

- Remove the person to a cooler, shaded area;
- Give 8 ounces of Gatorade (if available) every 15 minutes for three or four doses. Drinking water will be used if Gatoradem is not readily available;
- Allow the person to rest; and,

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

112 of 123 3/15/95

Organization:

Environmental Management

 If the person is suffering from cramps, press warm, wet towels over the cramped area.

A life threatening situation exists and immediate action is indicated if a person is suffering from <u>heat stroke</u> (skin hot and dry, very high body temperature); the following procedures will be taken:

- Immediately contact the HSS and request that medical facility personnel be contacted and respond to the accident location, and take instructions from the medical personnel for care of the victim until their arrival;
- Cool the victim quickly by soaking the person in cool (but not cold) water, sponging the body with rubbing alcohol or cool water, or pouring water on the body; and,
- Transport to hospital for medical attention as quickly as possible.

8.4.4 Injury Due to Cold

First aid for <u>frostbite</u> consists of the following procedures:

- Notify the On-site Project Manager or HSS, and Rocky Flats Occupational Medicine (OM);
- Bring the victim indoors and quickly rewarm the affected areas in water between 102° to 105°F;
- Give victim a warm drink--NOT coffee, tea, or alcohol;
- Do <u>not</u> permit the victim to smoke;

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

3/15/95

Organization:

Environmental Management

- Keep the frozen parts in warm water or covered with warm cloths for 30 minutes, even though the tissue will be painful as it thaws;
- Evaluate the injured areas and cover with sterile, soft, dry material;
- Keep the victim warm and get immediate medical care;
- Do <u>not</u> rub the frostbitten part;
- Do <u>not</u> allow blisters to be broken;
- Do <u>not</u> use ice, snow, or anything cold on frostbite;
- Do not use heat lamps or hot water bottles to rewarm the body part; and,
- Do <u>not</u> place the affected part near a hot stove.

First aid for excessive exposure to cold (hypothermia) consists of the following procedures:

- Contact SSO, who will call paramedics (2911) so victim can be moved safely and quickly;
- Bring victim into a warm area as quickly as possible;
- Remove wet or cold garments;
- Dry the person thoroughly;
- Provide warm, dry clothing or covering;
- Provide rapid but gentle rewarming;
- Give victim a warm drink--NOT coffee, tea, or alcohol;
- Keep the victim warm; and,

Page:

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

on No.:

114 of 123

Effective Date: Organization:

3//5/ 95 Environmental Management

 Decontaminate the victim only after the frostbite situation is rectified and initiation of decontamination is approved by a physician.

8.4.5 Reporting and Notification

Reporting and notification of emergency situations shall be carried out in accordance with Chain of Command requirements in Department of Energy (DOE) Order 5484.1. In the event of an emergency, a crew member of the field team involved will notify the Site Safety Officer who will notify the appropriate emergency assistance personnel (for example, fire, police, ambulance) at extension 2911 immediately, and then notify the Site Manager. The Site Manager will notify the Rocky Flats Environmental Restoration (ER) Program Field Supervisor, PM, and Health and Safety Administrator. The responsibility of the SSO is to implement notification and reporting requirements of DOE Order 5484.1.

8.4.6 Thunderstorms and Tornadoes

A severe thunderstorm watch or a tornado watch announcement on radio or television indicates that a severe thunderstorm or tornado is possible. Work will continue at the work site during severe thunderstorm watches or tornado watches. A severe thunderstorm warning or a tornado warning signifies that a severe thunderstorm or a tornado has been sighted or detected by radar and may be approaching. All work on site shall cease during a thunderstorm, severe thunderstorm warning, or tornado warning.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

-SAF-94-GMP 0

Page:

115 of 123

Effective Date: Organization:

Environmental Management

Personnel on site during a tornado shall take the following steps:

- Evacuate office trailers or vehicles:
- If outdoors, lie flat in a nearby ditch;
- Stay away from power poles, electrical appliances, and metal objects; and,
- Do not try to outrun a tornado.

8.4.7 Other Adverse Weather

In the event of adverse weather, the SSO will determine if work can continue without sacrificing the health and safety of site personnel. Some of the items to be considered prior to determining if work should continue are:

- High winds;
- Heavy rainfall;
- Potential for heat stress:
- Potential for cold stress;
- Limited visibility;
- Potential for accidents; and,
- The malfunctioning of monitoring equipment.

8.4.8 Electric Shock

All electrical shocks shall be considered as a physical injury and will be handled as described in Subsection 8.4.2. In addition, the following requirements will be followed:

ROCKY FLATS **ENVIRONMENTAL TECHNOLOGY SITE**

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

116 of 123

Effective Date: Organization:

Environmental Management

- All electric shocks are accidents and must be reported to the Field Supervisor;
- Employees who attempt to rescue shock victims must not endanger themselves or others; and,
- The electrical source should be de-energized immediately if the victim is still in contact with electrical energy.

ROCKY FLATS ENVIRONMENTAL **TECHNOLOGY SITE**

Manual: Revision No.: RFP/ER-SAF-94-GMP

Page:

Effective Date:

117 of 123 3/ 15/9.5

Organization:

Environmental Managemen

9.0 LOGS, REPORTS, AND RECORDKEEPING

9.1 General

Records shall be kept documenting the site safety program, health and safety audits, training meetings (weekly/tailgates), Radiation Work Permits, and radiological surveys. A bound logbook will be used by the HSS/HSST to record results of each environmental monitoring event within the exclusion zone. All records shall be maintained and handled in accordance with applicable Rocky Flats procedures. As a minimum, the requirements of Procedure 2-G18-ER-ADM-17.01 and the Rocky Flats Quality Assurance Manual shall be met.

9.2 Personnel Records

Records shall be kept on each on-site individual. Records include a medical clearance statement from a qualified physician, fit test, and training documentation. When site safety meetings are conducted, an attendance sheet that includes the subjects briefed must be kept.

9.3 Calibration Records

All radiological monitoring equipment will be calibrated as described in ANSI N323-1978 "Radiation Protection Instrument Test and Calibration" and Rocky Flats directives. All monitoring equipment used for health and safety purposes will be calibrated as suggested by the manufacturer. Records of all calibrations will be maintained.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: Page: RFP/ER-SAF-94-GMP

0 118 of 123

Effective Date: Organization:

3/15/95 Environmental Management

9.4 Occupational Safety and Health Administration Form 200

An OSHA Form 200 will be posted in an area frequented by all subcontractor personnel. The HSS will be responsible for maintaining this form.

9.5 Health and Safety Logbook

A separate health and safety logbook and sign in/sign out log shall be maintained by the SSO throughout the project and turned in to the EG&G Project Manager after the project is completed. Logged information shall include:

- Names of all personnel entering and leaving the site each day;
- Daily listing of site numbers to be visited by field teams;
- Description of unforeseen hazards and steps taken to mitigate hazards;
- VOC readings taken in the breathing zone if above background;
- Summary of telephone conversations regarding health and safety;
- Safety infractions, if any;
- Accidents and injuries; and,
- All other significant health and safety items.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

Effective Date:

119 of 123 3/15/95

Organization:

Environmental Management

9.6 Accident/Incident Reporting

9.6.1 Subcontractor Procedures

In the event of an accident or incident, the HSS will immediately notify the On-site Project Manager and the Health and Safety Officer (HSO) after appropriate emergency personnel have been notified. Types of accidents or incidents that are considered reportable are listed in ADM 1601.

Work will be suspended until the cause of the accident/incident is canceled and to modify this HASP as necessary.

A accident/incident report form (DOE Form F 5484.X) must be submitted to the EG&G Project Manager (PM) and HSO within 24 hours of occurrence.

9.6.2 Rocky Flats Procedures

In accordance with the Site Health and Safety Plan (HSP) Section 3.03, the SSO or HSS will notify the appropriate emergency personnel at extension 2911. The Site Manager will notify the Rocky Flats Environmental Restoration (ER) Program Field Supervisor, the Rocky Flats ER Program Manager, Rocky Flats Site Health and Safety Coordinator of any accidents or incidents that occur during field activities that fall into the following classifications. The Site Safety Officer will also submit a completed DOE Form F 5484.X for any of the following incidents:

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.: RFP/ER-SAF-94-GMP

0

Page:

120 of 123

Effective Date: Organization:

3/15/95 Environmental Management

1. "Recordable" occupational injuries or illnesses as defined below:

OCCUPATIONAL INJURY is any injury such as a cut, fracture, sprain, or amputation that results from a work accident or from an exposure involving a single incident in the work environment. NOTE: Conditions resulting from animal or insect bites, or one-time exposure to chemicals, are considered to be injuries.

OCCUPATIONAL ILLNESS of an employee is any abnormal condition or disorder, other than one resulting from an occupational injury, caused by exposure to environmental factors associated with employment. It includes acute and chronic illnesses or diseases that may be caused by inhalation, absorption, ingestion, or direct contact with a toxic material.

- 2. PROPERTY DAMAGE LOSSES of \$1,000 or more are reported as follows: accidents that cause damage to Department of Energy (DOE) property, regardless of fault, or accident wherein DOE may be liable for damage to a second party, are reportable if damage is \$1,000 or more. Include damage to facilities, inventories, equipment, and properly parked motor vehicles. Exclude damage resulting from a DOE-reportable vehicle accident.
- 3. GOVERNMENT MOTOR VEHICLE ACCIDENTS resulting in damages of \$500 or more, or involving injury, are reported unless the government vehicle is not at fault, damage of less than \$500 is sustained by the government vehicle, or no injury is inflicted on the government vehicle occupants. Accidents are also reportable to DOE if:
 - Damage to DOE property is greater than or equal to \$500 and the driver of a government vehicle is at fault
 - Damage to any private property or vehicle is greater than or equal to \$500 and the driver of a government vehicle is at fault
 - Any person is injured and the driver of a government vehicle is at fault

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

0

Page:

121 of 123

Effective Date: Organization:

3/15/95 Environmental Management

10.0 REFERENCES

- Interagency Agreement (IAG), 1990. Draft. The U.S. Department of Energy, U.S. Environmental Protection Agency, and the Colorado Department of Health.
- Interagency Agreement (IAG), 1991. Final. The U.S. Department of Energy, U.S. Environmental Protection Agency, and the Colorado Department of Health.
- Rockwell International Corporation, 1988. Draft Remedial Investigation and Feasibility Study Plans for Low Priority Sites. Volume I. Site Descriptions, Groupings and Prioritization.
- U.S. Department of Energy (DOE), 1980. Final Environmental Impact Statement. Rocky Flats Plant Site, Golden, Colorado (Final Statement to ERDA 1545-D), 3 volumes. DOE/EIS-0064, UC-2, 11. April.
- U.S. Department of Energy (DOE), 1986a. Comprehensive Environmental Assessment and Response Program (CEARP), Phase I Installation Assessment. Rocky Flats Plant, Albuquerque Operations Office.
- U.S. Department of Energy (DOE), 1986b. Resource Conservation and Recovery Act (RCRA), Part B Operating Permit Application for Rocky Flats Plant Hazardous and Radioactive Mixed Wastes. CO7890010526.
- U.S. Department of Energy (DOE), 1986c. Resource Conservation and Recovery Act (RCRA), Part B Operating Permit Application for Rocky Flats Plant Transuranic (TRU) Mixed Wastes. CO7890010526.
- U.S. Department of Energy (DOE), 1987. RCRA 3004(u) Waste Management Units. Appendix 1 of the Rocky Flats Plant RCRA Part B Operating Permit Application.
- U.S. Department of Energy (DOE), 1988. Closure Plan, Container Storage Facilities: Property Utilization and Disposal Container Storage Facilities, Swinerton and Walberg Building 980 Container Storage Facility, Swinerton and Walberg Contractor Storage Yard, Building 885 Drum Storage Area, Building 881 Drum Storage Area, Building 865 Drum Storage Area, Building 883 Drum Storage Area, Building 334 Cargo Container Area, Building 444/453 Drum Storage Area, Rocky Flats Plant.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE Manual: Revision No.:

RFP/ER-SAF-94-GMP

122 of 123

Page:

Effective Date: Organization:

3//5/95 Environmental Management

- U.S. Department of Energy (DOE), 1990. Final Phase III RFI/RI Work Plan, Rocky Flats Plant 881 Hillside Area (Operable Unit No. 1). Rocky Flats Plant, Golden, Colorado. October.
- U.S. Department of Energy (DOE), 1991a. Phase II RFI/RI/FS Work Plan (Alluvial), 903 Pad, Mound, and East Trenches Areas (Operable Unit 2). Rocky Flats Plant, Golden, Colorado.
- U.S. Department of Energy (DOE), 1991b. Phase II RFI/RI Work Plan (Bedrock), 903 Pad, Mound, and East Trenches Areas (Operable Unit 2). Rocky Flats Plant, Golden, Colorado.
- U.S. Department of Energy (DOE), 1991c. Draft Final RFI/RI Work Plan for Operable Unit 3. Rocky Flats Plant, Golden, Colorado.
- U.S. Department of Energy (DOE), 1991d. Draft Final Phase I RFI/RI Work Plan, Solar Evaporation Ponds (Operable Unit No. 4). Rocky Flats Plant, Golden, Colorado.
- U.S. Department of Energy (DOE), 1991e. Environmental Assessment, Dewatering and RCRA Partial Closure Action on Solar Evaporation Ponds. Rocky Flats Plant, Golden, Colorado, DOE/EA-0487. June.
- U.S. Department of Energy (DOE), 1991f. Final Phase I RFI/RI Work Plan, Rocky Flats Plant Woman Creek Priority Drainage (Operable Unit No. 5). Rocky Flats Plant, Golden, Colorado. October.
- U.S. Department of Energy (DOE), 1991g. Final Phase I RFI/RI Work Plan, Rocky Flats Plant Walnut Creek Priority Drainage (Operable Unit No. 6). Rocky Flats Plant, Golden, Colorado. Vol. 1. September.
- U.S. Department of Energy (DOE), 1991h. Phase I RFI/RI Work Plan, Present Landfill, IHSS 1:14, and Inactive Waste Storage area, IHSS 203 (Operable Unit No. 7).
- U.S. Department of Energy (DOE), 1991i. Final Phase I RFI/RI Work Plan, Rocky Flats Plant Original Process Waste Lines (Operable Unit No. 9). Rocky Flats Plant, Golden, Colorado. November.
- U.S. Department of Energy (DOE), 1991j. Draft Final Phase I RFI/RI Work Plan, Rocky Flats Plant Other Outside Closures (Operable Unit No. 10). Rocky Flats Plant, Golden, Colorado. November.

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Manual: Revision No.:

RFP/ER-SAF-94-GMP

O THE PERSON I

Page:

123 of 123

Effective Date: Organization:

Environmental Management

- U.S. Department of Energy (DOE), 1991k. Final Phase I RFI/RI Work Plan, West Spray Field (Operable Unit No. 11). Rocky Flats Plant, Golden, Colorado. December 18.
- U.S. Department of Energy (DOE), 1992a. Draft Historical Release Report for the Rocky Flats Plant.
- U.S. Department of Energy (DOE), 1992b. Draft Phase I RFI/RI Work Plan, Rocky Flats Plant Site 700 Area (Operable Unit 8). Rocky Flats Plant, Golden, Colorado.
- U.S. Department of Health and Human Services, 1985. Occupational Safety and Health Guidance Manual for Hazardous Waste Site Activities.
- Woodward-Clyde, 1993. Health & Safety Plan (Accident Prevention Safety Program Plan), Rocky Flats Plant, Groundwater Monitoring Program.

TABLE 6-1 SIGNS AND SYMPTOMS OF HEAT STRESS

Stress Type	Cause	Symptoms
Heat rash	Continuous exposure to heat or humid air	red, itchy rash on the body
Heat cramps	Heavy sweating with inadequate electrolyte replacement	muscle spasms, pain in the hands, feet, and abdomen
Heat exhaustion	Increased stress on various body organs including inadequate blood circulation due to cardiovascular insufficiency or dehydration	pale, cool, moist skin, heavy sweating, dizziness, nausea, fainting
Heat stroke	The most serious form of heat stress. Temperature regulation fails, and the body temperature rises to critical levels. Immediate action must be taken to cool the body before serious injury and death occur. Competent medical help must be obtained.	red, hot, and usually dry skin, lack of or reduced perspiration, nausea, dizziness or confusion, strong and rapid pulse, coma

TABLE 6-2 PERMISSIBLE HEAT EXPOSURE LIMITS Adapted From the ACGIH 1993-1994 TLVs (Values are given in °C and °F WBGT)*

		Work Load in WBGT							
Level of PPE	Work-Rest Regimen each hour	Lig	Light ^(a)		Moderate ^(b)		Heavy ^(c)		
		°C	°F	°C	۰F	°C	°F		
Summer work	Continuous Work	30.0	86	26.7	80	25.0	77		
Uniform	75% Work / 25% Rest	30.6	87	28.0	82	25.9	78		
	50% Work / 50% Rest	31.4	89	29.4	85	27.9	82		
	25% Work / 75% Rest	32.2	90	31.1	88	30.0	86		
Cotton	Continuous Work	28.0	82	24.7	76	23.0	73		
Coveralls	75% Work / 25% Rest	28.6	83	26.0	78	23.9	74		
	50% Work / 50% Rest	29.4	85	27.4	81	25.9	78		
	25% Work / 75% Rest	30.2	86	29.1	84	28.0	82		
Winter work	Continuous Work	26.0	79	22.7	73	21.0	70		
Uniform	75% Work / 25% Rest	26.6	80	24.0	75	21.9	71		
	50% Work / 50% Rest	27.4	82	25.4	78	23.9	75		
	25% Work / 75% Rest	28.2	83	27.1	81	26.0	79		
Water barrier,	Continuous Work	24.0	75	20.7	69	19.0	66		
permeable	75% Work / 25% Rest	24.6	76	22.0	71	19.9	67		
50% Work / 50% Rest		25.4	78	23.4	74	21.9	71		
	25% Work / 75% Rest	26.2	79	25.1	77	24	75		

^{*} As workload increase, the heat stress impact on an unacclimated worker is exacerbated. For unacclimatized workers performing a moderate level of work the permissible heat exposure TLV should be reduced by approximately 2.5°C.

Comments:_	For	situations	other	than	those	listed	above,	personal	heat	stress	monito	ring is
required						,	<u> </u>					

January 1995 933-2715.003

⁽a) Light = sitting or standing to control machinery, performing light hand or arm work.

⁽b) Moderate = walking about with moderate lifting or pushing

⁽c) Heavy = pick and shovel work, hand augering

TABLE 7-1
ENVIRONMENTAL MANAGEMENT RADIOLOGICAL GUIDELINES

EMRG No.	Title			
EMRG 1.0	Organization and Responsibilities			
EMRG 1.1	Gama Radiation Surveys			
EMRG 1.2	Beta Radiation Surveys			
EMRG 1.3	Posting of Radiation Protection Requirements			
EMRG 2.1	Personnel Contamination Monitoring			
EMRG 2.2	Possible Inhalation Exposure			
EMRG 2.3	Wounds and Skin Contamination			
EMRG 3.1	Performance of Surface Contamination Surveys			
EMRG 3.02	Survey Requirements for Conditional and Unrestricted Use			
EMRG 3.5	Handling of Contaminated Dosimetry/Security Badges			
EMRG 6.1	Performance Test and Operational Checks for Ludlum Model 12-A, Model 12, and Model 31 Survey Instruments			
EMRG 6.3	Performance Checking and Operation of the Eberline SAC-4 Alpha- Scintillation Smear Counting Instrumentation			
EMRG 6.4	Performance Testing and Operation of the Eberline BC-4 Beta Smear Counting Instrumentation			
EMRG 6.5	Use of the Bicron Frisk-Tech with the A-100 and B-50 Detectors			
EMRG 6.6	Use of the Bicron Fidler (Field Instrument for the Detection of Low-Energy Radiation)			
EMRG 9.1	Respiratory Protection Requirements and Posting			
EMRG 10.1	Radiological Deficiency Reporting Program			

January 1995 933-2715.003

TABLE 7-2
ACTION LEVELS FOR NONRADIOACTIVE ISSUES

Indicator	Action Level in the Breathing Zone	Action						
Photoionization	Photoionization Detector							
OVD with an 11.7 eV lamp	> Background	Stop work and notify the HSS; work may be conducted in Level B PPE at the discretion of the HSS						
Colormetric Dete	ector Tubes							
Benzene Detector Tubes	> 0.5 ppm	Stop work and notify the HSS; work may be conducted in Level B PPE at the discretion of the HSS						
Carbon Tetrachloride Detector Tubes	> 1 ppm	Stop work and notify the HSS; work may be conducted in Level B PPE at the discretion of the HSS						
Chloroform Detector Tubes	> 1 ppm	Stop work and notify the HSS; work may be conducted in Level B PPE at the discretion of the HSS						
1,1-Dichloroethene Detector Tubes	> 0.5 ppm	Stop work and notify the HSS; work may be conducted in Level B PPE at the discretion of the HSS						
Methylene Chloride Detector Tubes	> 12 ppm	Stop work and notify the HSS; work may be conducted in Level B PPE at the discretion of the HSS						
Tetrachloroethene Detector Tubes	> 0.5 ppm	Stop work and notify the HSS; work may be conducted in Level B PPE at the discretion of the HSS						
Vinyl Chloride Detector Tubes	> 0.5 ppm	Stop work and notify the HSS; work may be conducted in Level B PPE at the discretion of the HSS						
Combustible Gas	Combustible Gas Indicator							
CGI	Greater than 10% of the LEL	Exit exclusion zone and review Subsection 7.3.2						

TABLE 7-3
TASK-SPECIFIC PPE REQUIREMENTS

	Task and Activity	PPE Requirements	Text Reference
SOP GW.1	Water Level Measurements in Wells and Piezometers	Air monitoring, then Level D with nitrile or butyl gloves, or according to RWP requirements.	7.3.2, 7.5.1
SOP GW.2	Well Development	Air monitoring, then Level D with nitrile or butyl gloves, or according to RWP requirements.	7.3.2, 7.5.2
SOP GW.3	Pump in Borehole Packer Testing	Air monitoring, then Level D with nitrile or butyl gloves, or according to RWP requirements.	7.3.2, 7.5.3
SOP GW.4	Slug Tests	Air monitoring, then Level D with nitrile or butyl gloves, or according to RWP requirements.	7.3.2, 7.5.4
SOP GW.5	Field Measurement of Groundwater Field Parameters	Air monitoring, then Level D with nitrile or butyl gloves, or according to RWP requirements.	7.3.2, 7.5.5
SOP GW.6	Groundwater Sampling	Air monitoring, then Level D with nitrile or butyl gloves, or according to RWP requirements.	7.3.2, 7.5.6
SOP GW.8	Aquifer Pumping Tests	Air monitoring, then Level D with nitrile or butyl gloves, or according to RWP requirements.	7.3.2, 7.5.7
SOP FO.01	Air Monitoring and Dust Control	Level D	7.5.8
SOP FO.02	Transmittal of Field QA Records	Level D	7.5.9
SOP FO.03	General Equipment Decontamina	tion	7.3.2, 7.5.10
-	Radiological Surveys	Level D unless results exceed EMRG 3.1, then Level C or B as appropriate, or according to RWP requirements.	

TABLE 7-3
TASK-SPECIFIC PPE REQUIREMENTS

Task and Activity	PPE Requirements	Text Reference
- VOC Surveys	Level D, upgrading to Level C or B as appropriate.	
- Decontamination	Modified Level D, with coated chemical - resistant disposable coveralls, face shield, and nitrile or butyl gloves, or according to RWP requirements.	
SOP FO.05 Handling of Purge and Develop	ment Water	7.3.2, 7.5.11
- Collection	Air monitoring, then Level D, or according to RWP requirements.	
- Transfer	Air monitoring, then Level D, with ear plugs, nitrile or butyl gloves, splash apron, or according to RWP requirements.	
SOP FO.06 Handling Personal Protective Equipment	Level D with nitrile or butyl gloves.	7.5.12
SOP FO.07 Handling and Decontamination of Water and Wash Water	Level D with ear plugs, nitrile or butyl gloves, splash apron, or according to RWP requirements.	7.5.13
SOP FO.11 Field Communications	Level D.	7.5.14
SOP FO.12 Decontamination Facility Opera	tions	7.5.15
- Non-steam cleaner use	Level D with nitrile or butyl gloves and ear plugs, or according to RWP requirements.	
- Steam cleaner use	Modified Level D, or according to RWP requirements	
SOP FO.13 Containerization, Preserving, H	andling and Shipping of Soil and Water Samples	7.5.16

TABLE 7-3
TASK-SPECIFIC PPE REQUIREMENTS

	Task and Activity	PPE Requirements	Text Reference
-	Containerization and handling	Level D with nitrile or butyl gloves.	
-	Preservation	Level D with nitrile or butyl gloves, splash apron, and faceshield.	
-	Shipping	Level D	
SOP FO.14	Field Data Management	Office work uniform.	7.5.17
SOP FO.15	Photoionization Detectors (PID and Flame Ionization Detectors (FID)	Air monitoring, then Level D, or according to task-specific requirements.	7.3.2, 7.5.18
SOP FO.16	Field Radiological Measurements	Level D with nitrile or butyl gloves, or according to RWP requirements	7.5.19
SOP FO.18	Environmental Sample Radioactivity Content Screening	Level D with nitrile or butyl gloves	7.5.20
SOP FO.19	Base Laboratory Waste	Level D	7.5.21
SOP FO.25	Shipment of Radioactive Materials Samples	Level D	7.5.22
Special Tasks	;	Air monitoring (if required), then Level D, or as required by the Special Task Health and Safety Plan	7.3.2, 7.5.23

TABLE 8-1
EMERGENCY TELEPHONE NUMBERS

	
Site Health and Safety Officer	(303) 966-6079
24-Hour Installation Health/Safety Coordinator	(303) 966-2911
Fire	(303) 966-2911
Ambulance	(303) 966-2911
Poison Center	(303) 629-1123
Security	(303) 966-2911
Police	(303) 966-2911
Medical Facility General Information	(303) 966-2594
NEAREST MEDICAL SERVICES ARE LOCATED AT:	Building 122

Directions to Medical Services:

From the Contractor's trailer compound, take a northbound street to Central Avenue and turn left onto Central Avenue: Building 122 will be on the left side and slightly west of a guard building on the right after approximately 1.25 miles.

From the RFP eastern boundary, upon entering RFP from Indiana Street, you will be on Central Avenue. Proceed approximately 3.5 miles: Building 122 will be on the left side.


From the RFP western boundary at Hwy. 93, proceed along the entrance road to just past the gate, at which time you will be eastbound on Cactus Avenue. Then turn left onto the first street past Second Street, (Third Street, which is not marked). Proceed up Third Street past Building 125, which is on the left: the next building on the left will be the medical facility (Building 122).

TABLE 8-2

EMERGENCY ALARMS

WARNING	SOUND	INSTRUCTIONS
Fire Alarm	Bell	Evacuate area
Civil Defense Warning Alarm	High Frequency Pitch Steady Tone	Follow public address instruction and building announcements
Civil Defense Attack Alarm	Wailing Siren	Follow public address instructions
Criticality Alarm	Wailing Tone	Evacuate building and assemble in evacuation area

An Emergency Alarm Overview training tape is available for audio review at 966-7541.

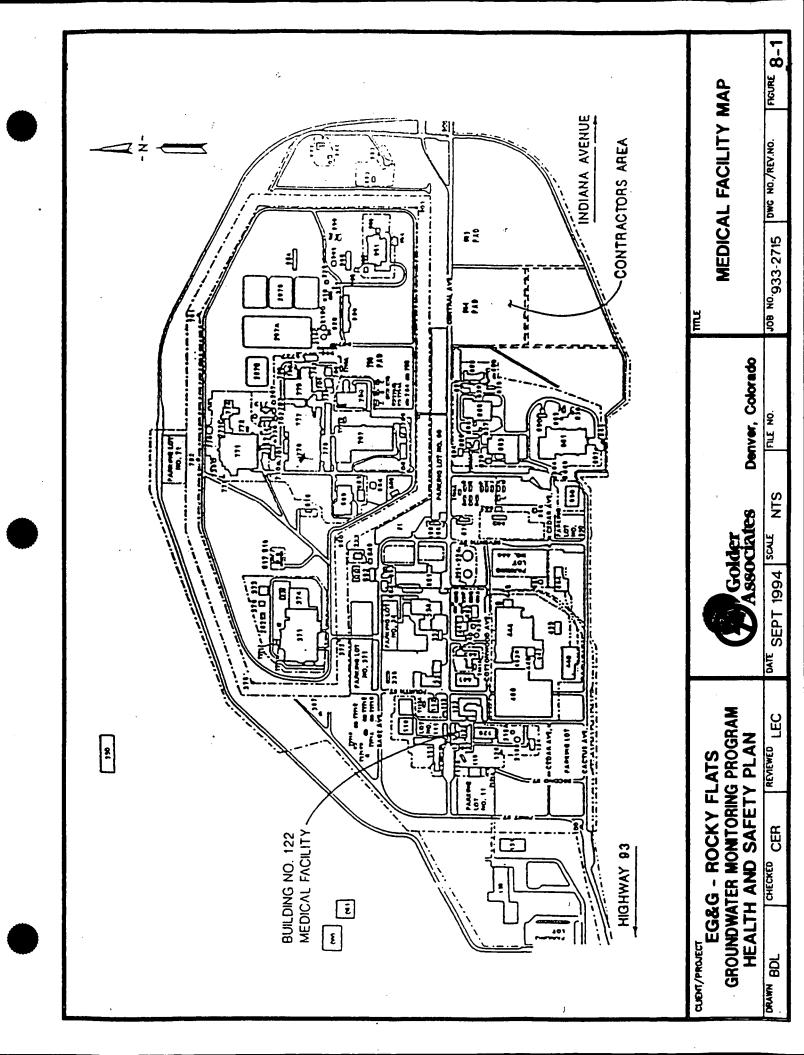

APPENDIX A

RESPONSIBILITIES AND AUTHORITY OF HEALTH AND SAFETY PERSONNEL

EM HEALTH & **EM RADIOLOGICAL** SAFETY OFFICER: Keith Anderson Rick Gentry ENGINEER: 966-6979 966-8349 -Ensures that radiological aspects of -Resposible for HSS program project specific documents meet -Prepares EMRGs & ensures compliance criteria of SOPs -Oversees RWP and RDR program EM PROJECT MANAGER Steve Singer 966-8635 -Implements HSO & RE directives EG&G Subcontractor CORPORATE HEALTH SUBCONTRACTOR PROJECT MANAGER AND SAFETY OFFICER Larry Cope 980-0540 Bill Hager (206)883-0777 -Implements EM-PM directives -Oversees HASP SITE MANAGER Kerry Bayer 966-6079 -Assures compliance with HASP PROJECT HEALTH AND -Supports SSO and HSS SAFETY OFFICER Christopher Rife 980-0540 -Develops project Health SITE SAFETY OFFICER and Safety program Harold Sanchez 966-6079 -Implements HASP -Supervises HSSs -Generates, reviews, and/or maintains database referencing Health and Safety subjects -Interfaces with EM-RE and CHSO HEALTH AND SAFETY SPECIALIST Harold Sanchez 966-6079 -Conducts surveys and documents results -Supervises HSSTs -Directs implementation of HASP to field crews FIELD CREWS -Conduct tasks in accordance with HASP Note: Responsibilities presented herein are summarized from Appendix A data. For full details, please refer to specific titles and responsibilities presented in Appendix A. TITLE HEALTH AND SAFETY RESPONSIBILITY FLOW CHART Denver, Colorado DRAWN DATE PGQ JOB NO. SEPT 1994 933-2715 EGAG - ROCKY FLATS CHECKED SCALE DWG NO./REV. NO. CER 2715A001 GROUNDWATER MONITORING PROGRAM

REVIEWED

HEALTH AND SAFETY PLAN

FILE NO.

2715A001

LEC

IGURE NO.

APPENDIX A

RESPONSIBILITIES AND AUTHORITY OF HEALTH AND SAFETY PERSONNEL

ENVIRONMENTAL MANAGEMENT (EM) HEALTH AND SAFETY OFFICER (HSO)

Responsibilities

The HSO will ensure that the radiological aspects of project-specific documents meet the criteria established in EG&G Rocky Flats Plant Site-Wide Standard Operating Procedures (SOPs).

EM RADIOLOGICAL ENGINEER (EMRE)

- Establish qualifications for the Health and Safety Specialist (HSS) position.
- Review the credentials of prospective HSSs and, when appropriate, approve individuals to complete tasks reserved for HSSs.
- Review and approve subcontractor-prepared training programs that are designed to qualify a subcontractor employee to serve as an HSS.
- Prepare Environmental Management Radiological Guidelines (EMRGs) that address subjects such as, but not limited to, survey methods, documentation, frequencies, and locations.
- Establish survey and sampling strategies for property that cannot be surveyed in accordance with the standard techniques outlined in existing EMRGs, and ensure that property to be released for unrestricted use does not exceed the limits specified in DOE Order 5400.5 (Reference 5.2).
- Provide guidance on the performance of the procedures and techniques utilized in field operations for surface contamination surveys.
- Specify work controls for radiologically controlled areas, or review and approve work controls prepared by Subcontractors.
- Review and approve selected radiation survey reports.
- Investigate unanticipated survey results such as a lack of radioactivity when radioactivity is known to be present, or radiation levels exceeding anticipated levels.

- Oversee Radiation Work Permit (RWP) program administration.
- Oversee Radiological Deficiency Report (RDR) program administration.
- Sign, or designate a representative to sign, forms such as property releases.
- Perform dose reconstruction for personnel whose dosimeters have been contaminated or are deemed "unreadable."
- Determine the appropriate posting and control of radiologically contaminated sites and approve the deposting of signs.
- Evaluate Possible Inhalation Exposures and decide on appropriate actions.
- Evaluate possible wound and skin contamination incidents.
- Provide support for the evaluation and control of work requiring respiratory protection.
- Perform all additional specific procedural duties relating to EM field activities detailed in the Radiological Engineering Procedures Manual, applicable Radiological Engineering documents, and the applicable HSP manual.
- Anticipate, recognize, and evaluate radiological health hazards, and recommend control measures as necessary. Engineering controls shall be emphasized.
- Perform quarterly inspections of OUs and Hazardous Waste Areas (HWAs) to determine compliance with the Health and Safety Plans.
- Ensure, in conjunction with Industrial Hygiene and Environmental Management, that site characterization and analysis, in accordance with 29 CFR 1910.120, is performed to identify specific site radiological hazards at OUs and to determine the necessary safety and health control procedures to protect personnel from the identified hazards.
- Ensure, in conjunction with Industrial Hygiene and Environmental Management, that appropriate site control procedures are implemented before cleanup work begins to control personnel exposure to radiological hazards.

- Provide technical review of all Health and Safety Plans, Job Safety Analyses (JSAs), Integrated Work Control Programs (IWCPs), and procedures as necessary.
- Implement Radiological Protection Program.

INDUSTRIAL HYGIENE (IH)

- Anticipate, recognize, and evaluate non-radiological health hazards, and recommend control measures as necessary. Engineering controls shall be emphasized, rather than administrative or personal protective equipment (PPE) controls.
- Perform quarterly inspections of OUs and HWAs to determine compliance with the Health and Safety Plan.
- Ensure, in conjunction with Environmental Management and Radiological Engineering, that site characterization and analysis, in accordance with 29 CFR 1910.120, is performed to identify specific site health hazards at OUs and to determine the necessary safety and health control procedures to protect personnel from identified hazards.
- Ensure, in conjunction with Environmental Management and Radiological Engineering, that appropriate site control procedures for OUs are implemented before cleanup work begins, to control personnel exposure to hazardous substances.
- Ensure, in conjunction with Waste Operations, Radiological Engineering, Waste Programs, Environmental Management, and Occupational Safety personnel, that specific site health hazards at HWAs and OUs are identified, and to determine necessary safety and health control procedures to protect personnel from the identified hazards.
- Provide a Subject Matter Expert (SME) for technical input to all plant training applicable to 29 CFR 1910.120.
- Provide technical review of all Health and Safety Plans, JSAs, IWCP documents, and procedures, as necessary.

Provide the H&S Liaison Officer

- The Liaison Officer's responsibilities include the following:
- Coordinate health and safety activities with the Environmental Management H&S Officer and the Environmental Management Site Project Managers.
- Supervise the EG&G Site H&S Coordinators at each OU.
- Coordinate health and safety guidance for hazardous waste operations in HWAs.
- ► Coordinate preparation and approval of OU and HWA Health and Safety Plans.
- Coordinate quarterly health and safety audits and inspections of health and safety programs and program documentation for subcontractors for hazardous waste operations.
- Coordinate review of OU workplans with the Environmental Management H&S Officer.
- Perform formal audits of EG&G Hazardous Waste Operations Training Courses on an annual basis. The purpose of these audits is to ensure compliance with OSHA requirements for hazardous waste operations training.
- Coordinate review and approval of Health and Safety Plan field changes.
- Provide Site Health and Safety Coordinators (SHSCs) for OUs.
 - The SHSCs' duties include the following:
 - Oversee EG&G and subcontractor work to verify compliance with the requirements of Health and Safety Plans.
 - Perform audits for proper and appropriate use of PPE, monitoring and decontamination procedures, site control, and all required documentation.

NOTE

Radiological decontamination procedures shall be reviewed by Radiological Engineering personnel.

- Alert the OU Site Project Manager, H&S Liaison Officer, and the Environmental Operations Manager of health and safety violations at OUs.
- Provide health and safety support for EG&G employees.

OCCUPATIONAL SAFETY (OS)

Responsibilities

- Anticipate, recognize, and evaluate safety hazards, and recommend control measures as necessary. Engineering controls shall be emphasized.
- Perform quarterly inspections of OUs and HWAs to determine compliance with Health and Safety Plans.
- Ensure, in conjunction with Waste Operations, Radiological Engineering, Waste Programs, Environmental Management, and Industrial Hygiene personnel, that specific site health hazards at HWAs and OUs are identified, and determine necessary safety and health control procedures to protect personnel from the identified hazards.
- Provide technical review of all Health and Safety Plants, JSAs, IWCPs, and procedures as necessary.

GROUNDWATER MONITORING PROGRAM (GMP)- PROJECT MANAGER

- Direct the development of a formal training program designed to qualify subcontractor employees to be designated as HSSs by the EMRE. The training program will include classroom sessions and supervised field work, and will be submitted to the EMRE for approval.
- Direct and monitor the implementation of the health and safety program.

- Advise personnel on health and safety matters.
- Issue directives, advisories, and information to the Corporate Health and Safety Manager (CHSM).
- Advise the CHSM on the policy, liability, and professional issues.
- Assure that adequate funds are allocated to fully implement project health and safety plans.
- Nominate Site Safety Officer (SSOs) and Health and Safety Specialists (HSSs) for EMRE approval.

Authority

- Direct changes in the health and safety program.
- Determine and implement personnel disciplinary actions, as required.
- Approve and audit project health and safety expenditures.

CORPORATE HEALTH AND SAFETY MANAGER (CHSM)

- Track health and safety regulations and implement improvements to the health and safety program.
- Ensure records are maintained pertaining to medical surveillance, training, fit testing, chemical exposure, and incidents.
- Update health and safety manual.
- Manage medical surveillance program.
- Ensure health and safety training is obtained.
- Provide industrial hygiene/chemical safety guidance to SSOs.
- Audit key aspects of health and safety program and report effectiveness to project manager.

- Investigate reports of incidents or accidents.
- Provide guidance on radiological issues.

Authority

- Approve the qualifications of employees to work at the decontamination pads.
- Establish employee training and medical surveillance procedures.
- Suspend work on any project that jeopardizes the health and safety of personnel.
- Access project files to perform health and safety audits or investigate accidents/incidents.
- Remove individuals from projects if their conduct jeopardizes their health and safety or that of co-workers.

SITE SAFETY OFFICER (SSO)

- Implement the applicable Site-Specific HSP (SSHSP) and verify compliance with all applicable health and safety requirements.
- Ensure that updated copies of the Health and Safety Plan (HSP), applicable SSHSP, EMRGs, and all documents referenced by the EMRGs, are available to subcontractor employees.
- Supervise HSSs in the performance of their responsibilities.
- Ensure HSSs and subcontractor employees are advised of the radiological hazards, both expected and suspected, by posting and controlling radiological areas according to EMRG instructions.
- Ensure that HSP 18.19, "Criteria and Actions for Potential Intakes," is adhered to for the duration of the project.
- Verify that performance of EG&G and subcontractor-owned instruments has been conducted in accordance with the manufacturer's recommendations. The SSO

will also ensure that the test results are recorded daily in a calibration log specific to each instrument.

- Review and approve completed survey reports/forms. If an unsatisfactory report/form is received, it will be returned to the appropriate individual(s) for correction. When conducting that review the SSO will ensure that:
 - the correct report/form is complete
 - the entries are reasonable
 - the required signatures are affixed to the report
- Forward approved survey reports/forms to the EMRE and maintain a file of all completed Radiological Survey Forms. This file will be organized by survey areas, with an index placed in the front of the file.
- Immediately contact the EMR by phone when survey results indicate radiation levels exceeding 5 millirems/hour (mrem/h). For contaminant radiation levels requiring access controls not already established, or levels exceeding an established action level, the EMRE will also be notified.
- Maintain an Instrumentation Field Log Book which documents the specific equipment used at the work site.
- Interface with project manager in matters of health and safety.
- Report to CHSM and project manager on health and safety matters.
- Develop or review project health and safety plans prior to submittal to EG&G for review.
- Conduct staff training and orientation on health and safety related activities.
- Monitor compliance with health and safety plans and conduct site audits.
- Assist project managers with obtaining required health and safety equipment.
- Ensure compliance to relevant and appropriate OSHA requirements.

Authority

- Suspend work or otherwise limit exposures to personnel if health and safety plans appear to be unsuitable or inadequate or if health or safety of personnel is endangered.
- Direct personnel to change work practices if existing practices are deemed to be hazardous to health and safety of personnel.
- Remove personnel from projects if their actions or condition endanger their health and safety or the health and safety of co-workers.

SITE MANAGER

Responsibilities

- Assure that the project is performed in a manner consistent with the health and safety program.
- Assure that the project health and safety plan is prepared, approved, and properly implemented.
- Provide the SSO with the information needed to develop health and safety plans.
- Coordinate with the SSO and project manager on health and safety matters.
- Assure compliance with health and safety plans.
- Assure that Environmental Management Division Operating Procedures are maintained and that the Health and Safety Specialist (HSS) reviews Document Change Notices for any health and safety implications.

Authority (Safety Related)

- Assign SSO-approved HSS to project and, if necessary, assign a suitably qualified replacement.
- Temporarily suspend field activities if health and safety of personnel are endangered, pending an evaluation by the SSO or CHSM.
- Temporarily suspend an individual from field activities for infractions of the Health and Safety Plan, pending an evaluation by the SSO or CHSM.

HEALTH AND SAFETY SPECIALIST (HSS)

- Conduct surveys and document the results, as required by the EMRGs, the applicable SSHSP, and the EG&G Rocky Flats Plant Site-Wide SOPs.
- Supervise Health and Safety Specialist-in-Training (HSST) during field activities.
- Countersign all reports/forms completed by the HSST.
- Forward completed survey reports/forms to the SSO.
- Notify the SSO of survey results that indicate radiation levels exceeding 5 mrem/h, levels requiring access controls not already established, or levels exceeding an established action level.
- Control access and advise all personnel when radiological precautions are required.
- Complete performance and operational checks required for radiation instruments and make entries in the Instrumentation Field Log Book.
- Direct health and safety activities on site.
- Provide a copy of the Health And Safety Plan to all field crews.
- Report immediately all safety-related incidents or accidents to the SSO and project manager.
- Assist project managers in all aspects of implementing health and safety plans.
- Maintain health and safety equipment on site.
- Implement emergency procedures as required.
- Be approved by EG&G Radiological Engineering and Industrial Hygiene to conduct radiological monitoring procedures as outlined by EMRGs and complete all other related tasks assigned to Health and Safety Specialist-in-Training (HSST).
- Maintain a file of Environmental Management Radiological Guidelines (EMRGs) and complete all responsibilities assigned to the Health and Safety Specialist.

- Review Document Change Notices (DCNs) to Environmental Management Division Operating Procedures and, when necessary, implement appropriate health and safety procedures.
- Conduct monitoring for chemical and physical hazards.

Authority

- Temporarily suspend field activities if health and safety of personnel are endangered, pending further consideration by the HSO and/or CHMS.
- Temporarily suspend an individual from field activities for infractions of the Health and Safety Plan, pending further consideration by the HSO and/or CHMS.

HEALTH AND SAFETY SPECIALIST-IN-TRAINING (HSST):

The HSST shall assist the HSS in implementing this plan. An HSST will be present in the immediate vicinity during all field activities.

- Participate in a formal training program designed to qualify subcontractor employees to be designated as Health and Safety Specialists by the EMRE.
- Conduct surveys and document the results as required by the EMRGs, the applicable SSHSP, and the EG&G Rocky Flats Plant Site-Wide SOPs.
- Notify the HSS of unanticipated radiation and contamination levels such as a lack of radioactivity where radioactivity is known to be present, or radiation or contamination levels exceeding anticipated levels.
- Request HSS countersignatures on all survey reports.
- Post required signs according to EMRG instructions.
- Ensure that each individual within his/her jurisdiction complies with the provisions of this plan.
- Audit safety practices used by on-site teams.
- Provide on-site air monitoring during field activities, if necessary.

- Communicate with command post for on-site activities.
- Supervise decontamination, monitor workers for heat or cold stress, and distribute health and safety equipment if certified by RE and IH to perform these tasks.
- Document safety practices.
- Initiate appropriate emergency procedures.
- Be in an approved program by EG&G Radiological Engineering to conduct radiological monitoring procedures as outlined by EMRGs and complete all other related tasks assigned to Health and Safety Specialist-in-Training (HSST).

Authority

• The HSST shall have the authority to stop work in case of an imminent safety hazard or potentially dangerous situation; after stopping work, the HSST shall immediately consult the HSS and EG&G project manager.

APPENDIX B

HISTORICAL CHARACTERISTICS OF RADIOISOTOPES FOUND AT THE ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE The DOE Rocky Flats Plant produces "triggers" for nuclear weapons, which involves the processing and machining of plutonium, as well as the use of beryllium and other materials. Uranium and other radionuclides are known to be present on the site, either from process operations or from the disposal of wastes from other facilities.

Normal process releases from this facility are reported to be minimal, although there are several historical incidents that have released significant quantities of contaminants.

Plutonium can spontaneously combust in air, a characteristic which contributed to serious fires that released plutonium to the environment in 1957 and 1969. In 1969 a glovebox fire resulted in the release of several kilograms of plutonium to the environment. Analysis of soil samples, taken mostly east of DOE property, found up to 6 pCi/g on the top centimeter of soil (background is 0.04 pCi/g) shortly after this fire. In 1974 there was another accidental release of plutonium to the air.

Starting in 1958, barrels containing used machining fluids were stored outdoors at a location now called the 903 Pad. Leakage from the barrels was discovered in 1964. By 1968, the last barrels had been removed and the area was monitored for alpha activity. Levels of up to 13.5 μ Ci/g of soil were found, with activity penetrating to 8 inches deep. Rocks were removed from the area and fill was applied to the storage area, which was then paved. Additional fill was added to the area surrounding the 903 Pad in 1970 after soil sample analysis revealed greater than 50 pCi/g of alpha activity.

Other sites on the facility that may be significant contaminant sources include the West Spray Fields, an area east of the plant used for burial called the East Mounds, the 881 Hillside area, and the solar evaporation ponds. With the exception of the West Spray Fields, all of these locations are to the east of the new sanitary landfill sites.

The distribution of radioactive dusts in the environment is driven by prevailing wind patterns and drainage patterns at the Plant site. Both the prevailing winds and drainage patterns are west-to-east, with a significant north/south component for prevailing winds. This can be verified

by the distribution of radionuclides in the soil as reported by Rocky Flats Plant annual environmental reports.

Expected concentrations of plutonium near the areas of this work is thought to be approximately 0.05 pCi/gm (0.02 pCi/g [0.04 dis/min/g] is considered background). This level is well below levels considered hazardous. Reasonable dust control measures in areas containing 0.05 pCi/gm will provide adequate protection against exposure to plutonium by inhalation.

Elevated levels of plutonium have been measured in various areas in the buffer zone around the Rocky Flats Plant, primarily to the east of the facility. The highest levels of plutonium measured are to the east and south of the Plant, with the principal source being the 903 Pad. Soils at Indiana Avenue have been found to have an activity of 7.34 pCi/g.

Radionuclides of Concern

Pu²³⁹

The predominant isotope present as an environmental contaminant is Pu²⁹. Major radiations from this material include the following:

Pu²⁹ emits very little gamma (photons) of low energy, the most important being:

Pu²³⁹ is beta (e⁻) stable.

The radiation of concern (alpha) is not sufficiently penetrating to penetrate the dead layers of the skin, which means Pu²³⁹ is not an external hazard. However, it is very important to avoid

inhalation or ingestion of this material, as alpha radiation may be very damaging from within the body.

Am²⁴¹

Am²⁴¹ is a contaminant of weapons-grade plutonium, present at less than 20% of the concentration of Pu²⁵⁹. Major radiations from this material include the following:

alpha (He²+)

5.49 MeV (85%)

5.44 MeV (13%)

Am241 emits some gamma (photons) of low energy, the most important being:

0.060 MeV (36%)

Am²⁴¹ is beta stable.

The radiation of concern (alpha) is not sufficiently penetrating to penetrate the dead layers of the skin, which means Am²⁴¹ is not an external hazard. However, it is very important to avoid inhalation or ingestion of this material, as alpha radiation may be very damaging from within the body.

U²³⁵

U²³⁵ is also known to be present in some soils at this site. U²³⁵ is normally present as 0.7 percent of the total uranium present. Major radiations from this material include the following:

alpha (He2+

4.58 MeV (8%)

4.40 MeV (57%)

4.37 MeV (18%)

Gamma emissions are principally due to the presence of thorium daughter radiations, the most important being:

0.143 MeV (11%) 0.185 MeV (54%) 0.204 MeV (5%)

U²³⁵ is beta stable.

The radiation of concern (alpha) is not sufficiently penetrating to penetrate the dead layers of the skin, which means U²³⁵ is not an external hazard. However, it is very important to avoid inhalation or ingestion of this material, as alpha radiation may be very damaging from within the body. At concentrations much higher than are expected to be present at this site, U²³⁵ can be an external hazard from daughter gamma emissions.

U²³⁸

U²³⁸ is also known to be present in some soils at this site. U²³⁸ is normally present as 99.276 percent of the total uranium present. Major radiations from this material include the following:

Gamma emissions are principally due to the presence of daughter radiations, principally from Th²⁴ and Pa^{24a}.

Beta emissions include:

The radiation of concern (alpha) is not sufficiently penetrating to penetrate the dead layers of the skin, which means U²³⁸ is not an external hazard. However, it is very important to avoid inhalation or ingestion of this material, as alpha radiation may be very damaging from within

the body. At concentrations much higher than are expected to be present at this site, U²³⁴ can be an external hazard from daughter gamma emissions. The beta emissions are not sufficiently energetic to penetrate the outer (dead) layers of skin.

APPENDIX C

LIST OF CHEMICAL SUBSTANCES FOUND AT ROCKY FLATS PLANT

Note:

The reader should keep in mind that a material safety data sheet (MSDS) for a given substance provides information concerning the substance in a relatively pure from and that the substances that may be encountered during this project will be at very low concentrations from the view point of significant occupational exposures. MSDSs for chemicals of concern are kept on EG&G Environmental Restoration Office (T891E). Analyte concentrations for combined operable units 1-6 and Upper and Lower Interceptor ditches are provided in Table B-1.

APPENDIX D

EXAMPLE ON-THE-JOB TRAINING (OJT) FORM

Name:	Extension				<u>. </u>
Job Title: Job Code: Employee #/SSN	Department or Company: Organization Code:	· ·			
Supervisor:	Extension	Mail	Stop _		· · · · · · · · · · · · · · · · · · ·
PART ONE	Required for Admittance to RFP Co	urses 01	3-691-0	2 and	018-691-03
TSD WORKERS At RFP, hazardous waste generators place RCRA haz generators are not generally considered "hazardous waste generators are not generally considered "hazardous waste generators are not generally considered the hazards of	vaste workers" under OSHA. (Hazardo	us waste			
1. Will you repackage drums of RCRA regulated v	vaste after they				
have been initially packaged by the generator? 2. Will you be directly involved in RCRA hazardou If 'Yes', at what location?	is waste treatment?	<u> </u>	No No		Yes Yes
3. Are you potentially exposed to hazardous waste a TSD storage area during routine (non-emergence)		۵	No	•	Yes
ENVIRONMENTAL RESTORATION SITE WORK At RFP, environmental restoration sites are referred exists in a building, <i>only</i> the portion of the building remediation is considered the OU.	to as "operable units" or OU's. When a				
4. Will you perform or field supervise environment	al investigation or remediation	_		_	
activities at an OU? 5. Will you perform maintenance or other non-environment of 'Yes', what activities?	ironmental activities at an OU?		No No		Yes Yes
6. Will you tour or audit an OU?			No		Yes
If You Checked "Yes" to Anv of Items 4-6. Com 7. Will you be required to wear Level A or B PPE at 8. Will you be required to wear Level C PPE at an	at an OU?	0	No No	0 0	Yes Yes
IF YOU CHECKED "YES" TO ANY OF ITEMS 1-3. Are you likely to perform any of tasks 1-5 for 30. 9. Are you likely to wear a respirator for 30 or more	or more days per year?	00	No No	00	Yes Yes
Supervisor Print Name	Signature	Date			_
Employee Print Name	Signature	Date	 :		-
FOR INDUSTRIAL HYGIENE REPRESENTATIVE	ONLY				
Date Form Received	Date Form Completed				
Employee Requires: (check one) 24-Hour, #01 (check one) 1 Day Field E	xperience		ield Ex	perien	æ
Industrial Hygiene Rep. Print Name	Signature				

PART TWO: FIELD EXPERIENCE CERTIFICATION FOR HAZARDOUS WASTE OPERATIONS INITIAL TRAINING

	——————————————————————————————————————		
* Part Two is only requir	ed for work in an OU	J, it is not required for work in a TSD	
FOR PERFORMANCE BA	SED TRAINING RE	PRESENTATIVE ONLY	
Employee has Completed: and per Part One requires:	(check one) (check one)	☐ 24-Hour, #018-691-02 ☐ 1 Day Field Experience	☐ 40-Hour, #018-691-03 ☐ 3 Day Field Experience
PBT Print N	ame	Signature	Date
TO DOCUMENT TRAIN	NG FROM SOURCE	OTHER THAN ROCKY FLATS PL	ANT
Employee has Completed: Course Source	(check one)	□ 24-Hour Cour	☐ 40-Hour se Date
and requires: or has attached proof o	(check one) f: (check one)	☐ 1 Day Field Experience ☐ 1 Day Field Experience	☐ 3 Day Field Experience ☐ 3 Day Field Experience
Supervisor			
Print N	ame	Signature	Date
 a. Site reconnaissance, in b. Drilling or similar action soil boring, well instal c. Environmental medians soil, soil gas, surface well d. Excavation e. Contaminant treatment operation or maintenant f. Other, specify 	vity lation, cone penetron sampling vater, groundwater t system installation, nce	g. Utilities s water, ele h. Soil distu excavatio i. Equipmer j. Other, spe	ns, grading, hand digging nt maintenance ecify
Cor	Tasks O	U# Date(s) Ti	me (Hours)
Total	al Time (Hours)	elika esa produken e e unanadaga pradus.	n was through the
Student has completed at (check one)	least: 1 D Cou	ay (8 hours)	4 hours) of supervised work in an OU 018-691-07
Supervisor Print Name		Signanae	Date
Employee		·	

APPENDIX E AIR MONITORING SURVEY RESULTS

Historical Air Monitoring Results

Results of air monitoring surveys conducted at wells in the Groundwater Monitoring Program have been compiled for utilization in determining future air monitoring and PPE requirements at these wells. Table E-1 lists all wells currently included in the program. Table E-2 provides results of air monitoring at all wells, upon opening and after venting. Background, breathing zone, and well head readings are also provided in Table E-2. Table E-3 provides similar data, but only for wells with positive readings. Additionally, variances between background and breathing zone or well head readings are provided in Table E-3.

Following is an explanation of codes utilized in Tables E-1, E-2, and E-3.

Well ID:

Identification number for well.

Status:

Sample = well is included in the sampling program.

WLM = well is included only in the Water Level Measurement program.

ND = well has not been developed.

Year:

Year in which air monitoring was conducted.

Qtr:

Quarter in which air monitoring was conducted.

Survey Results:

Results of air monitoring survey, as provided by air HNu PA-101 photoionization detector. All results provided in parts per million (ppm)

At opening = air monitoring results from survey conducted immediately after opening the well casing cap.

BG = Background. Reading from survey conducted in airspace upwind and away from well.

BZ = Breathing Zone. Reading from survey conducted in the field crew breathing zone.

WH = Wellhead. Reading from survey conducted at the top of the well casing.

BZ Diff = Breathing Zone Difference. Variance between background and breathing zone readings. Negative value indicates that the breathing zone reading was below the background reading.

WH Diff = Wellhead Difference. Variance between background and wellhead readings. Negative value indicates that the wellhead reading was below the background reading.

TABLE E-1 ROCKY FLATS GROUNDWATER WELLS RESEARCHED FOR AIR MONITORING DATA

							UK MUNIT(DRING DATA	A.					
L	Well ID	Status	Well ID	Status	Well ID	Status	Well ID	Status	Well ID	Status	Well ID	Status	Well ID	Status
	5070	WLM	1487BR	SAMPLE	B203789	WLM	P114989	SAMPLE	04591	SAMPLE	38291	SAMPLE	43993	WLM
	5074 5174	WLM WLM	1587 1687BR	SAMPLE SAMPLE	B203889 B203989	WLM WLM	P115089 B315289	SAMPLE WLM	04691 04891	SAMPLE WLM	38591 38891	SAMPLE SAMPLE	44893 44993	WLM WLM
	5274	WLM	1887BR	SAMPLE	B204089	WLM	P115489	SAMPLE	04991	SAMPLE	38991	SAMPLE	45093	WLM
	5374	WLM	1987	SAMPLE	B204189	WLM	P115589	SAMPLE	05091	SAMPLE	39191	SAMPLE	45293	WLM
	5474	WLM	2087BR	WLM	B304789	WLM	P115689	SAMPLE	05191	SAMPLE	39291	SAMPLE	45393	WLM
	5774	WLM	2187	SAMPLE	B304889	WLM	P215789	SAMPLE	05291	ND	39691	SAMPLE	45593	WLM
	5874	WLM	2287BR	SAMPLE	B304989	WLM	P415889	SAMPLE	05391	SAMPLE	40491	WLM	45693	WLM
İ	5974	WLM	2387BR	WLM	B405189	WLM	P415989	SAMPLE	05691	SAMPLE	40791	WLM	45793	WLM
	6074 6174	WLM WLM	2487 2587BR	SAMPLE SAMPLE	B405289 B305389	WLM WLM	P416089 P416189	SAMPLE SAMPLE	05991 06091	WLM SAMPLE	40991 41091	WLM SAMPLE	45893 45993	WLM WLM
-	6274	WLM	2687	WLM	B405489	WLM	P416289	SAMPLE	06191	SAMPLE	41491	SAMPLE	46093	WLM
1	6374	WLM	2787	WLM	B205589	WLM	P416389	SAMPLE	06291	SAMPLE	41591	SAMPLE	46193	WLM
.	0186	SAMPLE	2887BR	SAMPLE	B405689	WLM	P416489	SAMPLE	06391	`WLM	41691	SAMPLE	46293	WLM
	0386	SAMPLE	2987	SAMPLE	B405789	WLM	P416589	SAMPLE	06491	SAMPLE	45391	SAMPLE	46393	WLM
	0586	SAMPLE	3087BR	SAMPLE	B405889	WLM	P416689	SAMPLE	06591	SAMPLE	03092	ND	46493	WLM
-	0686 0786	WLM. SAMPLE	3187BR 3287	SAMPLE WLM	B405989 B106089	WLM SAMPLE	P416789 P416889	SAMPLE SAMPLE	06691 06791	SAMPLE SAMPLE	03192 10092	ND SAMPLE	51193 58793	SAMPLE SAMPLE
1	0886	SAMPLE	3387	SAMPLE	B206289	SAMPLE	P416989	SAMPLE	06891	SAMPLE	10192	SAMPLE	59093	ND .
1	0986	SAMPLE	3487BR	SAMPLE	B206489	SAMPLE	B317189	WLM	06991	SAMPLE	10292	SAMPLE	59393	SAMPLE
	1086	SAMPLE	3587	WLM	B206589	SAMPLE	B217289	SAMPLE	07191	SAMPLE	10392	SAMPLE	59493	SAMPLE
	1386	SAMPLE	3687BR	SAMPLE	B206689	SAMPLE	B217489	WLM	07291	SAMPLE	10492	SAMPLE	59593	SAMPLE
	1486	SAMPLE	3887	SAMPLE	B206789	SAMPLE	B217789	WLM	07391	SAMPLE	10592	SAMPLE	59793	ND.
	1586 1686	SAMPLE SAMPLE	3987 4087	SAMPLE WLM	B206889 B206989	SAMPLE SAMPLE	P317989 P218089	WLM WLM	07891 07991	SAMPLE SAMPLE	10692 10792	SAMPLE SAMPLE	61293 63093	ND SAMPLE
	1786	SAMPLE	4087 4187BR	SAMPLE	B200989 B207089	SAMPLE	P218089 P218289	SAMPLE	08091	SAMPLE	10792	SAMPLE	70093	SAMPLE
	1886	WLM	4287	SAMPLE	B207289	WLM	P218389	SAMPLE	08291	WLM	10992	SAMPLE	70193	SAMPLE
	1986	SAMPLE	4387	WLM	P207389	SAMPLE	B218789	WLM	08391	WLM	11092	SAMPLE	70293	SAMPLE
	2186	SAMPLE	4487	WLM	P207589	SAMPLE	P219189	SAMPLE	08491	WLM	43392	SAMPLE	70393	SAMPLE
	2286	SAMPLE	4587BR	SAMPLE	P207689	SAMPLE	P119389	SAMPLE	08591	WLM	43492	SAMPLE	70493	SAMPLE
	2386	SAMPLE	4787	WLM	P207789	SAMPLE	P219489	SAMPLE	08891	SAMPLE	46192	SAMPLE	70593	SAMPLE
	2486 2586	SAMPLE SAMPLE	4887 4987	WLM WLM	P207889 P207989	SAMPLE SAMPLE	P219589 P419689	SAMPLE SAMPLE	09091 09691	SAMPLE SAMPLE	46292 46392	SAMPLE SAMPLE	70693 70893	SAMPLE SAMPLE
	2686	SAMPLE	5087	WLM	B208089	SAMPLE	P320089	SAMPLE	10991	SAMPLE	46492	SAMPLE	71193	SAMPLE
	2786	SAMPLE	5187	SAMPLE	B208189	SAMPLE	B220189	WLM	11291	WLM	46692	SAMPLE	71493	SAMPLE
	2986	WLM	5287	SAMPLE	B208289	SAMPLE	B220489	WLM	11491	WLM	46792	SAMPLE	71693	SAMPLE
	3086	SAMPLE	5387	WLM	B208389	WLM	0190	SAMPLE	11691	SAMPLE	46892	SAMPLE	71893	SAMPLE
	3186	WLM	5487	SAMPLE	B208489	WLM	0290	SAMPLE	11791	SAMPLE	49192	SAMPLE	72093	SAMPLE
	3286	SAMPLE	5587	SAMPLE	B208589	WLM	0390	SAMPLE	11891	SAMPLE	49292	SAMPLE	72293 72393	SAMPLE
	3386 3486	SAMPLE SAMPLE	5687 5887	SAMPLE SAMPLE	B208689 B208789	SAMPLE WLM	0590 0690	WLM WLM	12091 12191	SAMPLE SAMPLE	50092 50192	SAMPLE ND	72393 72493	SAMPLE ND
	3586	SAMPLE	6087	SAMPLE	P208889	SAMPLE	0790	WLM	12291	SAMPLE	50292	ND	72475	
	3686	SAMPLE	6187	SAMPLE	P208989	SAMPLE	0990	WLM	12391	SAMPLE	75092	SAMPLE		İ
	3786	SAMPLE	6287	WLM	P209089	SAMPLE	1490	SAMPLE	12491	SAMPLE	75292	SAMPLE		
	3886	SAMPLE	6487	SAMPLE	P209189	WLM	00191	SAMPLE	12691	SAMPLE	75892	ND		
ı	3986	SAMPLE	6587	SAMPLE	P209289	SAMPLE	00291	SAMPLE	12891	WLM	75992	SAMPLE		
- 1	4086 4186	SAMPLE WLM	6687 6887	SAMPLE SAMPLE	P209389 P209489	SAMPLE SAMPLE	00391 00491	SAMPLE SAMPLE	12991 13091	SAMPLE SAMPLE	76192 76292	ND SAMPLE		į
- (4286	SAMPLE	7087	SAMPLE	P209589	SAMPLE	00691	SAMPLE	13191	SAMPLE	76792	ND		į
	4386	SAMPLE	7187	SAMPLE	P209689	SAMPLE	00791	WLM	13291	SAMPLE	76992	ND		1
	4486	WLM	7287	SAMPLE	P209789	SAMPLE	00891	WLM	13391	SAMPLE	77192	ND		
	4686	SAMPLE	B400089	WLM	P209889	SAMPLE	00991	WLM	13491	SAMPLE	77392	ND		·
	4786	SAMPLE	B400189	WLM	P209989	WLM	01291	SAMPLE	13591	WLM	77492	SAMPLE		1
	4886	SAMPLE	B400289	WLM	P210089	SAMPLE	01391	SAMPLE	20591	WLM	00193	ND		ļ
	4986 5086	SAMPLE SAMPLE	B400389 B400489	WLM WLM	P210189 B210389	SAMPLE WLM	01491 01791	SAMPLE SAMPLE	20691 20791	WLM WLM	00293 00393	SAMPLE SAMPLE		Ì
	5186	SAMPLE	B200589	WLM	B210389 B210489	SAMPLE	01/91	SAMPLE	30991	SAMPLE	00393	ND ND		
	5286	WLM	B200689	WLM	B410589	SAMPLE	01991	SAMPLE	31491	WLM	05093	SAMPLE		
	5386	SAMPLE	B200789	WLM	B410689	SAMPLE	02091	SAMPLE	31791	SAMPLE	05193	SAMPLE		
	5486	WLM	B200889	WLM	B410789	SAMPLE	02191	WLM	31891	SAMPLE	05293	SAMPLE		
	B405586	WLM	B201089	WLM	B110889	SAMPLE	02291	SAMPLE	32591	SAMPLE	05393	ND		ļ
1	5686 5786	SAMPLE	B201189	WLM	B110989	SAMPLE	02391	WLM	33491	SAMPLE	22093	SAMPLE		
	5786 5886	SAMPLE WLM	B201289 B201589	WLM WLM	B111189 B411289	SAMPLE SAMPLE	02491 02591	SAMPLE SAMPLE	33691 33891	WLM SAMPLE	22193 22293	SAMPLE SAMPLE		
	6186	SAMPLE	B401989	WLM	B411389	SAMPLE	02591	SAMPLE	34591	WLM	22393	SAMPLE		ļ
	6286	SAMPLE	B302089	WLM	P313489	SAMPLE	02791	WLM	34791	SAMPLE	22593	SAMPLE		
	6386	SAMPLE	B402189	WLM	P313589	SAMPLE	02891	WLM	35391	SAMPLE	23193	SAMPLE		
	6486	SAMPLE	B102289	WLM	P213689	SAMPLE	02991	SAMPLE	35691	SAMPLE	23293	ND		
	6586	SAMPLE	B102389	WLM	B213789	SAMPLE	03091	SAMPLE	35991	WLM	40193	WLM		
-	6686	SAMPLE	B202489	WLM	P213889	WLM	03191	WLM	36191	SAMPLE	40293	WLM		
	6786 6886	WLM SAMPLE	B202589 B402689	WLM WLM	P213989 P314089	WLM SAMPLE	03391 03591	SAMPLE SAMPLE	36391 36691	SAMPLE SAMPLE	40393 40593	WLM WLM		
	7086	SAMPLE	B402689 B302789	WLM	P314089 P414189	SAMPLE	03591	SAMPLE	36991	WLM	40393	WLM		
	0187	SAMPLE	B302889	WLM	P314289	SAMPLE	03791	SAMPLE	37191	SAMPLE	41693	WLM		
	0487	SAMPLE	B302989	WLM	P114389	SAMPLE	03891	WLM	37591	SAMPLE	41993	WLM		
	058 7 BR	SAMPLE	B303089	WLM	P114489	SAMPLE	03991	SAMPLE	37691	SAMPLE	42393	WLM		
	0987	SAMPLE	B203189	WLM	P114589	SAMPLE	04091	SAMPLE	37791	SAMPLE	42993	WLM		
	1087	SAMPLE	B203289	WLM	P114689	SAMPLE	04191	SAMPLE	37891	SAMPLE	43293	WLM		
	1187 1287	SAMPLE	B203489	WLM	P114789	SAMPLE	04291	SAMPLE	37991	SAMPLE	43593	WLM		ļ
	140/	SAMPLE	B203589	WLM	P114889	SAMPLE	04491	SAMPLE	38191	SAMPLE	43893	WLM		

r————			ROCKY FI	LATS GRO				READING	<u>s</u>	
1						Survey Res	ults			
Well	_				At Opening			After Venti		
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
5070	WLM	1994	2	0	0	0				
		1994	1	0	0	0				
5074	WLM	1994	2	0	0	0				•
5174	WLM	1994	2	0	0	0	1			
5274	WLM	1994	2	0	0	0				
5374	WLM	1994	2	0	0	0			1	
		1993	4	5	5	5				
5474	WLM	1994	2	O	0	0		İ		
		1996	4	5	5	5				
5774	WLM	1994	2	0	0	0				
5874	WLM	1994	2	0	0	0				
		1993	4	5	5	5				
5974	WLM	1994	2	0	0	이		}		
·		1994	1	0	0	0		,		·
		1993	4	5	5	5				
6074	WLM	1994	2	0	0	0				
6174	WLM	1994	2	0	0	0				
6274	WLM	1994	2	0	0	0		1	:	
		1993	4	5	5	5				
6374	WLM	1994	2	· 0	0	0				
		1993	4	4.2	4.2	4.2				
0186	SAMPLE	1994	2	0	0	0				
		1994	1	0	0	0				
		1993	4	0.4	0.4	0.4				
		1993	3	0.2	0.2	0.2				
		1993	2	0.2	0.2	0.2		ĺ		
		1993	1	0.6	0.6	0.6				·
		1992	3	0.1	0.1	0.1				
		1992	2	0.1	0.1	0.1		,		
0386	SAMPLE	1994	2	0	o	o				
		1994	1	0	0	o				
		1993	3	0.2	0.2	0.2				
		1993	2	0.2	0.2	0.2				
		1993	1	0.2	0.2	0.2				
		1992	3	0.2	0.2	0.2				
		1992	2	0.4	0.4	0.4				
		1992	1	o	o	o				
0586	SAMPLE	1994	2	o	o	o				
		1994	1	0.6	0.6	0.6				
		1993	4	1.2	1.2	3	0.2	0.2	0.2	
		1993	3	0.3	0.3	0.3	0.2	J	· · · ·	
		1993	1	0.6	0.6	0.6		,		
		1993	2	0.4	0.4	0.4	į			
		1992	3	0.4	0.4	0.4				
		1992	2	0.4	0.4	0.4				·
0686	WLM	1			1					
0080	WLM	1994	2	0	0	0				
		1992	3	0.2	0.2	0.2				
		1992	2	0.4	0.4	0.4				
_	İ	1992	1	0.2	0.2	0.2				
		1991	4	0.2	0.2	0.2				
		1991	3	0.3	0.3	0.3				
		1991	2	2	1.8	0.4				
0786	SAMPLE	1994	2	0	0	0				
		1994	1	10.8	10.8	10.8	1			
		1993	4	0.2	0.2	0.2				

			ROCKY FL	ATS GRO	UNDWAT	ER SAMPL	ING HNu	READINGS	<u> </u>	•	
			Ļ		:	Survey Resi					
Well			ļ		At Opening			After Ventin			- 14
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	`
		1993	3	0.2	0.2	0.2					
		1993	1	0.8	0.8	0.8					
		1992	3	0.2	0.2	0.2					
		1992	2	1.4	1.4	3.2	0.5	0.5	0.5		
		1992	1	0.3	0.2	0.2					
0886	SAMPLE	1994	2	0	0	0					
		1994	1	2	2	2					i
		1993	4	0.3	0.3	0.3					
		1993	3	0.2	0.2	0.2					
		1993	2	0.4	0.4	0.4					
		1993	1	0.8	0.8	0.8					
		1992	3	0.2	0.2	0.2					
2006	C 43 (77) E	1992	2	1.6	1.6	1.6		·			
0986	SAMPLE	1994	2	0	0	0					
		1994 1993	1 3	. 0.4 0.1	0.4 0.1	0.4 0.1					
	· ·	1993	2	0.1	0.1	0.1					
•		1993	1	0.4	0.4	0.4					
		1992	3	0.2	0.2	0.2					
		1992	2	1.6	1.6	1.6					1
		1992	1	0.3	0.2	0.2					
1086	SAMPLE	1994	2	0.5	0.2	0					
1000	0.225	1994	1	o	ő	o					
		1993	4	0.2	0.2	0.2		•			
•		1993	3	0.2	0.2	0.2					- 14
	1	1993	2	0.3	0.3	0.3					, I
		1993	1	0.3	0.3	0.3					ĺ
		1992	3	0.2	0.2	0.2					
		1992	2	0.4	0.4	0.4					
1386	SAMPLE	1994	2	o	0	o					İ
-		1993	4	0.2	0.2	0.2					-
		1994	1	6.7	6.7	6.7					
		1993	3	0.2	0.2	0.2		į			
		1993	2	0.2	0.2	0.2		ŀ			
		1992	3	0.2	0.2	0.4	0.4	0.4	0.4		
		1992	2	0.4	0.4	0.3	0.8	0.8	0.8		
		1992	1	0.3	0.3	0.3					ļ
1486	SAMPLE	1994	2	0	0	0					
		1994	1	2.4	2.4	2.4					
-		1993	4	0.2	0.2	0.2					
		1993	3	0.4	0.4	0.4		1			
		1993	2	0.4	0.4	0.4				·	
		1992	3	0.2	0.2	0.4	0.1	0.1	0.1		į
		1992	2	0.4	0.4	0.3	ļ				
		1992	1	0.3	0.2	0.2	j				
1586	SAMPLE	1994	2	0	0	0		İ			İ
		1994	1	4.6	4.6	4.6					
		1993 1993	4	0.2 0.4	0.2 0.4	0.2					
	[1993	3	0.4	0.4	0.4	•	1			.
		1993	2		0.3	1			l		
	·		1	0.4		0.4			İ		1
	·[1992	2	0.2	0.2	0.2					
1000		1992	2	0.4	0.4	0.2	ļ		İ		
1686	SAMPLE	1994	2	0	0	0	ł				
1	1 1	1994	1	2.6	2.6	2.6	1				[

		T	 	ROCKITE	ATS GRO				READINGS	<u> </u>	<u> </u>
	,]	}			Survey Rest				.
	Well			_		At Opening			After Ventir		
Y	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
			1993	4	0.3	0.3	0.3				
			1993	3	0.2	0.2	0.2				
			1993	2	0.4	0.4	0.4				
			1993	. 1	0.3	0.3	0.3				
			1992	3	0.2	0.2	0.2				
			1992	2	0.4	0.4	0.3				
	1786	SAMPLE	1994	2	0	0	0				
1			1994	1	0	0	0				
			1993	4	0.2	0.2	0.2				
1			1993	3	0.2	0.2	0.2				
			1993	2	0	0	0	-			
ı			1993	1	0.6	0.6	0.6				
			1992	3	0.2	0.2	0.2				
			1992	2	0.4	0.4	0.4		ŀ		İ
	1886	WLM	. 1994	2	0	0	0				
			1994	1	5.8	5.9	5.9				No venting data
1			1993	2	0.1	0.1	0.1				
-			1992	3	0.3	0.3	0.4	0.6	0.6	0.4	
İ			1992	2	0.4	0.4	0.4	ļ			ļ
			1992	1	0.3	0.2	0.2				
-			1991	4	0.3	0.3	0.3				
			1991	3	0.2	0.2	0.2				
ŀ	1986	SAMPLE	1994	2	0	0	0				·
			1994	1	0	Ö	0				
			1993	4	0.4	0.4	0.4				
lacksquare			1993	2	0.1	0.1	0.1		ł		
			1992	3	0.4	0.4	0.4				
			1992	2	0.3	0.3	0.3	Ì			
İ			1992	1	0.4	0.4	0.4				
			1991	4	0.4	0.4	0.9	0.2	0.2	0.2	
	2186	SAMPLE	1994	2	0	. 0	0			`	
			1994	1	4.4	4.4	4.4	.]		
			1993	4	0.4	0.4	0.4				
			1993	3	0.3	0.3	0.3		İ		
İ			1992	2	0.3	0.3	0.3	İ			
			1992	1	0.4	0.4	0.4				
			1991	4	0.4	0.4	0.4				
			1991	. 2	0.2	0.2	0.2		.		
	2286	SAMPLE	1994	2	0	0	0		1		
			1994	I	3.6	3.6	3.6	1	1		
			1993	4	0.4	0.4	0.4				
			1993	3	0.3	0.3	0.3				
			1993	1	0.4	0.4	0.4				
			1992	3	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3				
			1992	1	0.4	0.2	0.2]			
	2386	SAMPLE	1994	2	0	0	0				
			1994	1	3.2	3.2	3.2		}		·
			1993	4	0.5	0.5	0.5				
			1993	3	0.3	0.3	0.3				
	•		1993	2	0.3	0.3	0.3		İ		
			1993	1	0.4	0.4	0.4				
			1992	3	0.3	0.3	0.3		1		
			1992	2	0.3	0.3	0.3	.	[
	2486	SAMPLE	1994	2	0	o	o				

Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note Note						ılts	Survey Resi	_				1	
ID Status Year Qtr BG BZ WH BG BZ WH COMMENTS 1994			_	\$7 42.								1	ļ
1994 1 0.5 0.5 0.5 0.5 1993 3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 1994 1 0 0 0 0 1994 1 0 0 0 0 1993 1 0.2 0.2 0.2 1999 3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 1999 1 0.2 0.2 0.2 1991 4 0.4 0.4 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0.2 0.2 0.2 1995 1 0.2 0.2 0.2 1995 1 0.2 0.2 0.2 1995 1 0.2 0.2 0.2 1995 1 0.2 0.2 0.2 1995 1 1 0.2 0.2 0.2 1995 1 1 0.2 0.2 0.2 1995 1 1 0.2 0.2 0.2 1995 1 1 10.8 10.8 10.8 10.8 10.9 1994 1 10.8 10.8 10.8 10.9 1993 1 0.4 0.4 0.4 0.4 1993 1 0.2 0.4 0.4 0.4 1993 1 1 0.2 0.2 0.2 10.2 1995 1 1 0.2 0.2 0.2 10.2 1995 1 1 0.2 0.2 0.2 10.2 1995 1 1 0.2 0.2 0.2 10.2 1995 1 1 0.2 0.2 0.2 10.2 10.2 10.2 10.2 10.		COMMENTS			T AI	P.C.	MIL			٠.	V	Status	
1993 3 0.3 0.3 0.3 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4			WII	DL	╁							Status	
1993 2 0.4 0.4 0.4 1992 1 1992 2 0.3 0.3 0.3 0.3 1992 1 0.2 0.2 0.2 1991 4 0.4 0.4 0.8 0 0 0 0 1994 1 0 0 0 0 1993 1 0.2 0.2 1993 1 0.2 0.2 1992 3 0.3 0.3 0.3 1993 1 0.2 0.2 0.2 1992 3 0.3 0.3 0.3 1993 1 0.2 0.2 0.2 1992 1 0.2 1992 1 0.2 0.2 1992 1 0.3 0.3 0.3 1993 1 10.2 0.2 0.2 1992 1 10.2 0.2 1992 1 10.2 0.2 1992 1 10.2 0.2 1992 1 10.2 0.2 1992 1 10.2 0.2 1993 1 10.2 0.2 0.2 1993 1 10.2 0.2 0.2 1993 1 10.2 0.3 0.3 10.3 10.3 10.3 10.3 10.3 10.3 1		1									1		
1992 3 0.3 0.3 0.3 0.3 1992 1 0.2 0.2 0.2 1991 4 0.4 0.4 0.8 0 0 0 0 1994 1 0 0 0 0 1993 4 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 1992 3 0.3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1992 3 0.3 0.3 0.3 0.3 1993 1 10.2 0.2 0.2 1992 4 1 10.8 10.8 10.8 10.8 1993 4 0.4 0.4 0.4 1993 3 0.3 0.3 0.3 1993 4 0.4 0.4 0.4 1993 1 10.8 11994 1 10.8 110.8 110.8 110.8 11993 4 0.4 0.4 0.4 11993 1 10.2 0.2 0.2 0.2 11992 1 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 110.8 1							j.				1	1	
1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3											1		
2586 SAMPLE 1994 2 0 0 0 0 0 1993 3 0.3 0.3 1992 2 0.3 0.3 0.3 1994 1 10.8 10.8 10.8 10.8 1993 3 0.3 0.3 1993 3 0.3 0.3 1993 4 0.4 0.4 0.4 1993 1 10.8 10.8 10.8 1993 1 10.2 0.2 0.2 1993 1 10.2 0.2 0.2 1993 1 10.8 10.8 10.8 10.8 1993 1 10.2 0.4 0.4 1993 1 10.8 10.8 10.8 10.8 1993 1 10.2 0.2 0.2 1993 1 10.2 0.2 0.2 1993 1 10.2 0.2 0.2 1993 1 10.2 0.2 0.2 1993 1 10.2 0.2 0.2 1993 1 10.2 0.2 0.2 10.2 10.8 10.8 10.8 10.8 10.8 10.8 10.8 10.8													
2586 SAMPLE 1991 4 0.4 0.4 0.8 0 0 0 0 1 1994 1 0 0 0 0 0 1993 3 0.3 0.3 0.3 1992 2 0.4 0.4 0.4 0.4 1992 3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.4 0.4 0.4 0.4 1994 1 10.8 10.8 10.8 10.8 11993 4 0.4 0.4 0.4 11993 4 0.4 0.4 0.4 11993 4 0.4 0.4 0.4 11993 1 1993 3 0.3 0.3 0.3 0.3 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 0.2 0.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 11993 1 10.2 1 10.2 11993 1 10.2 1 10.2 11993 1						. 7					1		
1994 1 0 0 0 0 1 1993 4 0.4 0.4 0.4 1993 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1994 1 10.8 10.8 10.8 10.8 11993 3 0.3 0.3 0.3 11993 3 0.3 0.3 0.3 11993 3 0.3 0.3 0.3 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2 0.2 0.2 11993 1 0.2			0	0		0	0.8		0.4	4	1991		
1993							o	0	0	2	1994	SAMPLE	2586
1993 3 0.3 0.3 0.3 1993 1 0.2 0.2 0.2 1992 3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1994 1 10.8 10.8 10.8 1993 4 0.4 0.4 0.4 1993 3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 0.2					Ì		o	0	o	1	1994	1	
1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 1992 3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1994 1 10.8 10.8 10.8 1993 4 0.4 0.4 0.4 1993 3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 0.2							0.4	0.4	0.4		1993		
1993 1 0.2 0.2 0.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1							0.3	0.3	0.3		1 :		,
2686 SAMPLE 1994 2 0 0 0 0 1 1994 1 10.8 10.8 10.8 1993 4 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 0.2							1			1			
2686 SAMPLE 1994 2 0.3 0.3 0.3 0.3 1.8 1994 1 10.8 10.8 10.8 10.8 1993 4 0.4 0.4 0.4 1993 3 0.3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2				İ			1						
2686 SAMPLE 1994 2 0 0 0 0 1 1994 1 10.8 10.8 10.8 10.8 1993 4 0.4 0.4 0.4 1993 3 0.3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 0.2											i i	l l	
1994 1 10.8 10.8 10.8 10.8 1993 4 0.4 0.4 0.4 1993 3 0.3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2 0.2													
1993 4 0.4 0.4 0.4 1993 3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2										1	1	SAMPLE	2686
1993 3 0.3 0.3 0.3 1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2				ļ			- 1				1		
1993 2 0.4 0.4 0.4 1993 1 0.2 0.2 0.2									1				
1993 1 0.2 0.2 0.2			•				1						
					ĺ					ſ	i i		
1992 3 0.3 0.3 0.3							ı			L L	1		
1992 2 0.3 0.3 0.3							I		- 1		1		
2786 SAMPLE 1994 2 0 0 0	,										1	SAMPLE	. 2786
1994 1 3.2 3.2 3.2				.	l		,						1 2.00
1993 3 0.3 0.3 0.3				ł			I		- 1		1		
1993 2 0.2 0.2 0.2							1				1		
1993 1 1 1 1							. !		1	l l	1 1		
1992 3 0.3 0.3 0.3				İ			0.3	0.3	0.3		1 1		
1992 2 0.3 0.3 0.2				İ			0.2	0.3	0.3	2	1992		
1992 1 0.2 0.2 0.2				}			0.2	0.2	0.2	1	1992		
2986 WLM 1994 2 0 0 0				[0	0	0	2	1994	WLM	2986
1992 3 0.3 0.3 0.3				ľ					0.3		1992		
1992 2 0.3 0.3 0.3									,	2			
1992 1 0.3 0.3 0.3										1			
1991 4 0.2 0.2 0.2				1					The state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the s	1			
1991 3 0.4 0.4 0.4				İ						i			
1991 2 0.3 0.3 0.3													
3086 SAMPLE 1994 2 0 0 0									i		1	SAMPLE	3086
1994 1 3 3 3							3		1	4			
1993 4 0.5 0.5 0.5				[i			
1993 3 0.3 0.3 0.3 1993 2 0.2 0.2 0.2											1		
										i	1		
1993 1 0.5 0.5 0.5 1992 3 0.3 0.3 0.3			*				1		ŀ				
1992 2 0.3 0.3 0.3											1		
3186 WLM 1994 2 0 0 0 0			1				1					WIM	3186
1994 1 0.6 0.6 0.6					1		i i					VV LIVI	3100
1993 2 0.1 0.1 0.1													
1992 3 0.3 0.3 0.3					-		I		1	1			
1992 3 0.3 0.3 0.3							- 1			1	1		
1991 4 0.4 0.4 0.4							II			-			
				- 1	ı								
				ļ				,			1		
3286 SAMPLE 1994 2 0 0 0							0.2 0.4	0.2	0.2 0.4	3 2	1991 1991		

			, P	OCKY FL	ATS GRO	UNDWATE			READING	<u>s</u>	
	40. 11			-			Survey Resu		AA-17	<u> </u>	-}
	Well	C4-4	Vane	Qtr	BG	At Opening BZ	WH	BG	After Venti	WH	COMMENTS
7	ID	Status	Year 1994	Qur 1	2.3	2.3	2.3	ВС	BL	Wn	COMMENTS
		1	1993	3	0.3	0.3	0.3		ļ		
			1993	2	0.3	0.3	0.3	•			
	•		1993	1	0.2	0.2	0.2				
			1992	3	0.3	0.3	0.3		ļ		
			1992	2	0.3	0.3	0.3				:
			1992	1	0.2	0.2	0.2				·
	3386	SAMPLE	1994	2	o	0	0				•
			1994	1	0.6	0.6	0.6				-
			1993	3	0.3	0.3	0.3				
			1993	2	0.1	0.1	0.1				
			1992	3	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3			1	
			1992	1	0.2	0.2	0.2				,
			1991	4	0.2	0.2	0.2				
	3486	SAMPLE .	1994	2	0	0	0				
1			1994	1 3	0 0.3	0.3	0.3				
			1993 1993	2	0.4	0.3	0.3		ĺ		
			1992	3	0.4	0.4	0.4		1		
			1992	2	0.8	0.8	0.8				
			1992	1	0.2	0.2	0.2				
			1991	4	0.2	0.2	0.2				
	3586	SAMPLE	1994	2	0	0	0				, i
			1994	1	0.3	0.3	0.3		(
]	1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2				
			1992	3	0.3	0.3	0.2				
	•		1992	2	0.8	0.8	0.8				
			1992	1	0.2	0.2	0.2				
			1991	4	0.3	0.3	0.3				
	3686	SAMPLE	1994	2	0	0	0	•			
			1994	1	5.5	5.6	5.7				No venting data
			1993	3	0.1	0.1	0.1				
		1	1993	2	0.4	0.4	0.4				
1			1993 1992	1	0.6 0.2	0.6	0.6				
			1992	3 2	0.2	0.4	0.2 0.4				
			1992	1	0.4	0.4	. 0.4				
	3786	SAMPLE	1994	2	0.2	0.2	0.2				
	5,00		1994	1	1.8	1.8	1.8				
			1993	3	0.3	0.3	0.3				
			1993	2	0.6	0.6	0.6				
			1993	1	0.6	0.6	0.6				
			1992	3	0.3	0.3	0.2				
		į	1992	2	0.4	0.4	0.3				
			1992	1	0.2	0.2	0.2				
	3886	SAMPLE	1994	2	o	О	О				
			1994	1	5.9	6	6.2				No venting data
			1993	4	0.2	0.2	0.2	-			
7			1993	3	0.1	0.1	0.1				
			1993	2	0.4	0.4	0.4				
			1993	1	0.4	0.4	0.4			<u> </u>	
			1992	. 3	0.2	0.2	0.2				
			1992	2	0.4	0.4	0.4				

TABLE E-2

		<u>}</u>	ROCKY FI	ATS GRO				READING	s	
1						Survey Rest	ılts			4
Well	a	.,	a .		At Opening			After Venti		4
ID 3986	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
3986	SAMPLE	1994 1994	2 1	0 0.2	0 0.2	0				
		1993	3	0.2	0.2	0.2 0.3			ļ	
		1993	2	0.2	0.3	0.3				
		1993	1	0.6	0.6	0.6				
		1992	3	1	1	1				
		1992	2	0.4	0.4	0.3			1	
	Ì	1992	1	0.2	0.2	0.2				•
4086	SAMPLE	1994	2	o	o	o				
		1993	4	1.1	1.1	1.1				
	ľ	1993	3	0.3	0.3	0.3				
		1993	2	0.2	0.2	0.2				
	İ	1993	1	0.4	0.4	0.4				
	1	1992	3	0.1	0.1	0.1				
		1992	2	0.5	0.5	0.5				
		1992	1	0.2	0.2	0.2				
4186	WLM	1992	2	0	0	0				
İ		1994	1	0.8	0.8	0.8				
		1993	2	0.4	0.4	0.4				
	[1992 1992	3	0.2	0.2	0.2				
		1992	2	0.5	0.5	0.5				
		1991	1	0.2	0.2	0.2				
		1991	3	0.3	0.3	0.3		j		
4286	SAMPLE	1994	2	0	0.1	0.1				
		1994	1	0.2	0.2	0.2				
	į	1993	3	0.2	0.2	0.2				
		1993	2	0.2	0.2	0.2				
		1993	1	0.6	0.6	0.6				
		1993	4	0.5	0.5	0.5				
		1992	3	0.2	0.2	0.2				
		1992	2	0.2	0.2	0.2				
4386	SAMPLE	1994	2	0	0	0				
		1994	1	9	9	9				
		1993	3	0.3	0.3	0.3				
		1993	2	0.4	0.4	0.4				
		1992	3	0.5	0.5	0.5				
		1992	2	0.9	0.9	0.9				
		1992	1	0.3	0.3	0.3				
4406		1991	4	0.3	0.3	0.3				
4486	WLM	1994	2	0	0	0				
		1994	1	0.9	0.9	0.9				
		1992 1992	3	0.4	0.4	0.4				
		1992	2	0.3	0.3	0.3				
]	1991	1 4	0.1	0.1	0.1				
		1991	3	I	1	0				
		1991	2	0.4	0.4	0.4				
4686	SAMPLE	1994	2	0.3		0.3				
7000	JAMILE	1994	1	0.3	0.3	0.3				
		1993	4	0.6	0.6	0.6			ļ	
		1993	3	0.8	0.8	0.8	1	ĺ	1	!
		1993	2	0.5	0.6	0.6		ĺ		
		1993	1	0.0	0.8	0.8	1			
		1992	3	1.1	1.1	1.1	Ì		ļ	
	L	1774		1.1	1.11	1.1				

ſ							Survey Resu				
السر الا	Well			Ī		At Opening			After Venti	ng_]
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	wH_	COMMENTS
			1992	2	0.7	0.7	0.7				
ı	4786	SAMPLE	1994	2	o	0	0			}	
		ļ	1994	1	2	2	2				·
ŀ			1993	4	2.2	2.2	2.2		-		
		İ	1993	3	0.3	0.3	0.3				
		i .	1993	2	0.2	0.2	0.2				
			1992	3	0.9	0.9	0.9				1 '
			1992	2	0.5	0.5	0.5				
			1992	1	0.2	0.2	0.2				
	4886	SAMPLE	1994	2	0	0	0				
			1994	1	1.9	1.9	1.9				
		-	1993	4	0.4	0.4	0.4				·
			1993	3	0.2	0.2	0.2				
			1993	2	0.4	0.4	0.4			ĺ	
			1993	1	0.5	0.5	0.5				
			1992	3	2.8	2.8	2.8				
ı	4007	GANGE F	1992	2	0.5	0.5	0.5				
ļ	4986	SAMPLE	1994	2	0	0	0				
			1994	1	5	5	5				· :
		<u> </u>	1993 1993	4 3	0.4 0.2	0.4 0.2	0.4 0.2	1			
			1993	2	0.2	0.2	0.2				
			1993	1	0.3	0.3	0.3				
			1992	3	0.5	0.5	0.5				'
		'	1992	2	0.6	0.6	0.5				
ų.	5086	SAMPLE	1994	2	0.0	0.0	0.5				`
			1994	1	3	3	3				
İ			1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2				·
		j	1993	1	0.3	0.3	0.3				
			1992	3	0.7	0.7	0.7				
			1992	2	0.8	0.8	0.8				
			1992	1	0.2	0.2	0.2				
	5186	SAMPLE	1994	2	o	o	0				
			1994	1	5.7	5.7	5.7	·			
			1993	4	2.1	2.1	2.1				
	·		1993	3	0.2	0.2	0.2				
			1992	3	0.4	0.4	0.4		,		
			1992	2	0.6	0.6	0.6				
			1992	1	0.2	0.2	0.2				
			1991	4	0.2	0.2	0.2				
	5286	WLM	1994	2	0	0	0				
İ	4		1994	1	1	1	1				
			1993	1	0.2	0.2	0.2				
			1992	3	0.4	0.4	0.4				
			1992	2	0.6	0.6	0.6			,	
			1992	1	0.2	0.2	0.2				
			1991	4	0.2	0.2	0.2				
			1991	3	0.2	0.2	0.2				
	5386	SAMPLE	1994	2	0	0	0				
Ų	7		1994	1	0.2	0.2	0.2				
	l		1993	2	0.3	0.3	0.3		ĺ		
			1993	2	0.4	0.4	0.4				
			1993	1	0.6	0.6	0.6				
L	ŀ		1992	3	3.2	3.2	3.2	_1			

	T	T 1	ROCKY FL	ATS GRO	UNDWAT			READINGS	<u> </u>	
Well		İ	ŀ		At Opening	Survey Rest		After Ventu		
ID	Status	Year	Qtr	BG	BZ BZ	WH	BG	BZ	WH	COMMENTS
	- June -	1992	2	0.1	0.1	0.1				COMMENTS
		1992	1	0.1	0.1	0.1				
5486	WLM	1994	2	0	0	0				
		1993	2	0.4	0.4	0.4				
		1992	3	1.6	1.6	1.8	0.4	0.4	0.4	
		1992	2	0.8	0.8	0.8		5		
	1	1992	1	0.2	0.2	0.2				
}	}	1991	4	0.2	0.2	0.4	0	o	o	
	İ	1991	3	0.2	0.2	0.2				
		1991	2	0.4	0.4	0.4				
B405586	WLM	1994	2	0	o	o				
=5586	1	1993	2	0.1	0.1	0.1				
		1993	1	0.4	0.4	0.4				
		1992	3	1.8	2.8	3.2	0.4	0.4	0.4	
		1992	2	0.8	0.8	0.8				
		1992	1	0	0	0				
		1991	4	0.2	0.2	0.2				
		1991	2	0.1	0.1	0.1				
5686	SAMPLE	1994	2	0	0	o				
		1994	1	2.8	2.8	2.8				
		1993	2	0.3	0.3	0.3				
		1993	1	0.2	0.2	0.2				
		1992	3	0.5	0.5	0.5				
	•	1992	2	0.8	0.8	0.8		İ		,
•		1991	3	0.2	o	0				
		1991	4	0.1	0.1	0.1	1			
5786	SAMPLE	1994	2	o	o	o				
		1994	1	1	1	1				
1	i	1993	2	0.8	0.8	0.8				
		1993	1	0.2	0.2	0.2				
		1992	3	0.6	0.6	0.5		İ		
		1992	2	0.7	0.7	0.6		.		
		1992	1	0.2	0.2	0.2	1			1
		1991	4	0	0.1	0.1	0.3	0.3	0.3	
5886	WLM	1994		0	o	o				
		1993	2 2	0.4	0.4	0.4	ľ	\		
		1992	3	0.6	0.6	0.5				
		1992	2	0.7	0.7	0.7				
		1992	1	0.2	0.2	0.2				
		1991	4	0.2	0.2	0.2	1			
		1991	3	0.3	0.3	0.3	ŀ			
	1	1991	2	0.3	0.3	0.3				
6186	SAMPLE	1994	2	o	0	o				
		1994	. 1	6.2	6.2	6.2			,	
		1993	4	0.2	0.2	· 0.2				
	.	1992	3	0.4	0.4	0.4				
		1992	2	0.3	0.3	0.2				
		1992	1	0.1	0.1	0.1				
		1991	4	0.2	0.2	0.2				
		1991	3	0.2	0.2	0.2				
6286	SAMPLE	1994	2	0	0	0				
		1994	ī	0.3	0.3	0.3				
		1993	3	0.1	0.1	0.1	ļ			
		1993	2	0.6	0.6	0.6		1		
		1993	1	ı	0.0	0.0		ľ		
	<u> </u>	1993	11	0.2	0.2	0.2			1	

TABLE E-2

		R	OCKY FL	ATS GRO	UNDWATE			READING:	S	T
		İ	-			Survey Rest				-
Well	_				At Opening			After Venti		CONTACTNITO
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
		1992 1992	3 2	0.4 4	0.4	0.4				·
		1992	1	0.1	0.1	0.1				
6206	SAMPLE	1994	2	0.1	0.1	0.1				
6386	SAMPLE	1994	1	0.2	0.2	0.2				
		1993	3	0.2	0.2	0.2				,
		1993	2	0.2	0.2	0.2				
		1992	3	2.4	2.4	2.4		i		
		1992	2	4	4	4				
		1992	1	0.2	0.2	0.2				
		1991	4	0.2	0.2	0.1				
6486	SAMPLE	1994	2	0	o	o		,		
		1994	1	1	1	1				
		1993	3	0.2	0.2	0.2				·
		1993	2	0.3	0.3	0.3				
:		1993	· 1	0.2	0.2	0.2				
•		1992	3	0.4	0.4	0.4				
		1992	2	0.8	0.8	0.8				
		1992	1	0.2	0.2	0.2				
6586	SAMPLE	1994	2	·o	`0	o				
		1994	1	0.2	0.2	0.2			ļ	
		1993	3	0	. 0	o				•
	İ	1993	1	0.7	0.7	0.7				
		1992	3	0.2	0.2	0.2			1	
l		1992	2	0.6	0.6	0.6				
		1992	1	0.2	0.2	0.2				1
•		1991	4	0.1	0.1	0.1				
6686	SAMPLE	1994	2	0	0	0				
		1994	1	0.2	0.2	0.2				
		1993	4	0.2	0.2	0.2		ĺ		
		1993	3	0.3	0.3	0.3				
•		1993	2	0.2	0.2	0.2				
		1993	1	0.6	0.6	0.6				
		1992	3	0.2	0.2	0.2				
		1992	2	0.7	0.7	0.7				
6786	WLM	1994	2	0	0	0				
		1993	2	0.1	0.1	0.1			1	
		1992	3	0.3	、 0.3	0.3				
		1992	2	0.7	0.7	0.4				
		1991	4	0,2	0.2	0.1				
		1991	3	0.2	0.2	0.2				
		1991	2	0.2	0.2	0.2				(
6886	SAMPLE	1994	2	0	0	0				
		1994	1	0.2	0.2	0.2				
		1993	2	0.2	0.2	0.2			1	
		1993	1	0.2	0.2	0.2		-		
		1992	3	0.3	0.3	0.3			1	
		1992	2	0.3	0.3	0.3				
		1992	1	0.1	0.1	0.1				
.		1991	4	0.2	0.2	0.2				
7086	SAMPLE	1994	2	0	0	0			1	
		1994	1	0.2	0.2	0.2				
		1993	3	0.5	0.5	0.5				
		1993	2	0.3	0.3	0.3			1	
	[1007	,	0.0	0.0	0.0		I	1	

		<u></u>	ROCKY FL	ATS GRO	UNDWAT	ER SAMPL	ING HNu	READIN	GS		
			ļ			Survey Rest					
Well	_				At Opening			After Ver			
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	
		1992	3	0.6	0.6	0.6					
		1992	2	0.2		0.2		1			
0187	SAMPLE	1992 1994	1	0.2	0.2	0.2					
0107	JAMI LL	1994	2	0 6	0	0					
		1993	3	0.3	6 0.3	0.3					
		1993	2	0.3	0.3	0.3					
		1993	1	0.5	0.5	0.5		1			
	1	1992	3	0.2	0.2	0.2					
		1992	2	0.2	0.2	0.2		1			
		1992	1	0.2	0.2	0.2	•				
0487	SAMPLE	1994	2	o	0	0					
		1994	1	12	1.2	1.2					
		1993	2	0.2	0.2	0.2					
		1993	1	0.4	0.4	0.4			1		
		1993	4	0	o	o					i
		1992	3	0.2	0.2	0.2		1			
		1992	2	0.2	0.2	0.2					
		1992	1	, 0.2	0.2	0.2		1			
0587BR	SAMPLE	1994	2	0	0	o				1	
		1994	1	2.2	2.2	2.2					
		1993	3	0.2	0.2	0.2					
		1993	2	0.2	0.2	0.2					
		1993	1	0.6	0.6	0.6	•				
		1992	3	0.4	0.4	0.4					1
		1992	2	0.5	0.5	0.5			1		İ
2225		1992	1	0.3	0.3	0.3			ŀ		
0987	SAMPLE	1994	2	0	0	0			1		
		1994	1	1	1	1					
		1993	3	0.3	0.3	0.3					ı
		1993	2	0.4	0.4	0.4					
	.]	1993	1	0.8	0.8	0.8					
		1992	3	2	2	2			İ		- 1
	1 1	1992 1992	2	0.5	0.5	0.5					-
1087	SAMPLE	1994	1 2	0.2	0.2	0.2			1		
1007	JAME L	1994	1		0	0			}		
		1993	2	0.3	0.3	1	l				- 1
		1993	1	0.8	0.8	0.3			1		-
		1992	3	1.9	1.9	1.9	l				-
		1992	2	0.5	0.5	0.5				,	- 1
		1992	1	0.2	0.2	0.3					
	!	1991	4	0.2	0.2	0.2				•	ı
1187	SAMPLE	1994	2	0	0.2	0.2					
		1994	1	0.2	0.2	0.2					
	1	1993	3	0.2	0.2	0.2					-
		1993	2	0.2	0.2	0.2					
		1993	1	0.2	0.2	0.2	1				
		1992	3	0.4	0.4	0.4					
		1992	2	4	4	5	0.4	0.4	0.4		
		1992	1	0.3	0.3	0.3	0.4	0.4	0.4		
1287	SAMPLE	1994	2	0	0	0.5	. 5.5	0.5	0.5		
		1994	1	9	9	9					
		1993	3	ó	0.4	0.8				No venting data	
		1993	2	0.3	0.3	0.3			Ì	remain said	

_		1	R	OCKY FL	ATS GRO			ING HNu R	EADINGS	<u> </u>	
				-			Survey Rest				
	Well	Status	Vana	~-	BG	At Opening BZ	WH	BG	After Ventir	vg WH	COMMENTS
Ų,	ID	Status	Year 1992	Qtr 3	0.2	0.2	0.3	0.4	BZ 0.4		COMMENTS Day 2
			1992	2	0.4	0.4	1.2	0.3	0.3		Day 2
			1992	1	0.1	0.1	0.4	0.3	0.3	0.3	Day 2
			1991	4	0.1	0.1	0.2	0.3	0.3	0.3	
	1487BR	SAMPLE	1994	2	0	0.1	0.2	0.5	0.5	0.5	
	146/DK	JAMILLE	1994	1	5.4	5.4	5.4				
			1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2				
			1993	1	0.6	0.6	0.6				
			1992	3	0.3	0.3	0.3				
	•		1992	2	0.4	0.4	0.4				
ı			1992	- 1	0.1	0.1	0.1		•		
	1587	SAMPLE	1994	2	o	0	o	1			
			1994	1	1.4	1.4	3	2.5	2.5	2.5	·
			1993	4	0.2	0.2	0.2				
			1993	3	0.2	0.2	0.2	ļ			
			1993	2	0.4	0.4	0.4				
			1993	1	0.5	0.5	0.5				
			1992	3	0.4	0.4	0.4	į			
			1992	2	0.2	0.4	0.4	4	4	4	
	1687BR	SAMPLE	1994	2	0	0	0				
			1994	1	1	1	1				
			1993	4	0.3	0.3	0.3				,
\perp			1993	3	0.1	0.1	0.1				
			1993	2	0.2	0.2	0.2				
T			1993	1	0.3	0.3	0.3				
			1992 1992	3 2	0.4 0.2	0.4	0.4	3.8	3.8	3.8	
	1887BR	SAMPLE	1994	2	0.2	0.4	0.4	3.8	3.6	3.6	
	1007 DK	SAWII EL	1994	1	0.2	0.2	0.2				
		!	1993	4	0.2	0.2	0.2		ļ		
ļ			1993	2	0.4	0.4	0.4	· ·			
		ŀ	1992	3	0.2	0.2	0.2				
			1992	2	0.4	0.4	0.4				
		j	1992	1	0.3	0.3	0.3				
			1991	4	0.2	0.2	0.2				
Ì	1987	SAMPLE	1994	2	o	o	o				
			1994	1	8.5	8.5	8.5				
			1993	3	0.2	0.2	0.2				
'			1993	2	0.4	0.4	0.4				-
			1992	3	0.3	0.3	0.3				
			1992	2	0.2	0.2	0.4	0.1	0.1	0.2	Day 2
			1992	1	0.4	0.4	1.4				No venting data
			1991	3	0.2	0.3	0.3	0.3	0.3	0.3	
	2087BR	WLM	1994	2	0	0	0				
			1994	1	7.7	7.7	7.7				
			1992	3	0.3	0.3	0.3				·
			1992	2	0.2	0.2	0.2				
			1992	1	0.4	0.4	0.4	į			
4			1991	4	0	0	0	-			
	•		1991	3	0.2	0.2	0.2				
T		041/07/5	1991	2	0.2	0.2	0.2				
	2187	SAMPLE	1994	2	0	0	0				
			1994	1	0.3	0.3	0.3		-		
L		Ll	1993	3	0.3	0.3	0.3				

			ROCKY FI	ATS GRO				READING	<u>s</u>	
ļ		1				Survey Res	ults			4
Well	.		-		At Opening			After Venti		
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
		1993	2	0.4	0.4	0.4				
		1993	1	0.5	0.5	0.5				İ
	}	1992	3	0.3	0.3	0.3				
1		1992	2	0.3	0.3	0.3			·	
2287BR	SAMPLE	1992	1	0.2	0.2	0.2				
2267BR	SAMPLE	1994 1994	2 2	0	0	0				ļ
	·	1994	4	0.5	0.5	0.5				
		1993	3	0.4 0.3	0.4	0.4				
		1993	2	0.3	0.3	0.3				
		1992	3	0.3	0.3	0.3		ļ		
		1992	2	0.3	0.3	0.3				
		1992	1	0.3	0.3	0.3				
2387BR	WLM	1994	2	0.2	0.2	0.2				
100.210	1	1992	3	0.5	0.5	0.5				
	İ	1992	2	0.5	0.5	0.5			•	
		1992	1	0.2	0.2	0.2				
		1991	4	0.4	0.4	0.2				
		1991	3	0.2	0.1	0.1				
	,	1991	2	0.1	0.1	0.1				
		1991	1	0.2	0.2	0.2				
2487	SAMPLE	1994	2	0	0	0				
		1994	1	o	o	o			į	
		1993	2	0.4	0.4	0.4				,
1		1992	3	o	0	0]		
		1992	2	0.2	0.2	0.2				
		1992	1	0.4	0.4	0.4				
		1991	4	0.4	0.4	0.2				
	1	1991	3	0.1	0.1	0.1				
2587BR	SAMPLE	1994	2	0	0	0				
		1994	1	0.6	0.6	0.6				
	1	1993	4	o	0	o				
		1993	3	0.2	0.2	0.2				
]	1993	2	0.4	0.4	0.4				
		1993	1	0.2	0.2	0.2				
		1992	3	0.1	0.1	0.1				
		1992	2	0.2	0.2	0.2				
2687	WLM	1994	2	0	0	o		1	ŀ	
		1994	1	0.8	0.8	0.8		•		1
		1993	2	0.3	0.3	0.3				
		1992	3	0.3	0.3	0.3	•		l	į
		1992	2	0.2	0.2	0.2				j.
		1992	1	0.2	0.2	0.2			į	
		1991	4	0.1	0.1	0.1				
		1991	3	0.1	0.1	0.1	1			
2787	WLM	1994	2	0	0	0	- 1			
		1994	1	0.8	0.8	0.8				
	1	1993	2	0.3	0.3	0.3	l			
		1992	3	0.3	0.3	0.2	ļ		}	ļ
		1992	2	0.6	0.6	0.9	0.4	0.4	0.4	
		1992	1	0.1	0.1	0.2	0.9	0.5	0.5	
	1	1991	4	0.2	0.2	0.2				
	[1991	3	0.2	0.2	0.2			- 1	!
2887BR	SAMPLE	1994	2	0	0	0		1		
		1994	1	0.2	0.2	0.2				

	1	[· · · · · · · · · · · · · · · · · · ·	KUCKI PL	AISUKU		ER SAMPL		KEADING:	3	Ţ
<u> </u>]				Survey Rest		After V		-{
Well	S4	V	۸		At Opening			After Venti		COMMENTS
ID	Status	Year	Qtr	BG 4	BZ	WH	BG	BZ	WH	COMMENTS
		1993	4	4	4	4				
		1993	3	0.3 0.3	0.3 0.3	0.3				
		1993	2			0.3				
	•	1993	1	0.3	0.3	0.3				
		1992	3 2	0.2 0.6	0.2	0.2				
2987	SAMPLE	1992 1994	2 2	0.6	0.6 0	0.6 0				
2987	SAMPLE	l i	1	5	5	6				No venting data
		1994	3	0.3	0.3	0.3				140 Vehichig Gala
		1993 1993	2	0.3	0.3	0.3				
		1993	1	0.1	0.1	0.1				
		1992	3	0.4 0.3	0.4	0.4				·
		1992	2	0.5	0.5	0.5				
		1992	1	0.1	0.1	0.1		`		
3087BR	SAMPLE	1994	2	0.1	0.1	0.1				·
3007BR	SAUL EL	1994	1	2.5	2.5	2.5				
		1993	4	0.2	0.2	0.2				
		1993	3	0.3	0.3	0.3				
		1993	2	0.1	0.1	0.1				· .
		1993	1	0.4	0.4	0.4				
		1992	3	0.3	0.3	0.3				
:		1992	2	0.5	0.5	0.5				
3187BR	SAMPLE	1994	2	0	0	0				
		1994	. 1	0.2	0.2	0.2			:	
		1993	4	0.4	0.4	0.4				
	1	1993	3	0.3	0.3	0.3				
T		1993	2	0.2	0.2	0.2				
		1993	. 1	0.2	0.2	0.2				
		1992	3	0.3	0.3	0.2				
		1992	2	0.4	0.4	0.4				
3287	WLM	1994	2	o	o	o				
		1992	3	0.3	0.3	0.3				
		1992	2	0.4	0.4	0.4	*			
		1992	1	0.3	0.3	0.3				
		1991	4	0.3	0.3	0.3				
		1991	3	0.1	0.1	0.1				
		1991	2	0.8	0.6	0.4				
		1991	1	0.3	0.3	0.3				
3387	SAMPLE	1994	2	0	0	o		٠.		
		1994	1	0.8	0.8	0.8				
	1	1992	3	0.2	0.2	0.2				
		1992	2	0.4	0.4	0.4		١		
		1992	1	0.2	0.2	0.2				
		1991	4	0.1	0.1	0.1				
		1991	3	o	0	o				
		1991	2	0.2	0.2	0.2				
3487BR	SAMPLE	1994	2	o	0	o				.
		1994	1	0.2	0.2	0.2				
		1993	4	0.4	0.4	0.4				
		1993	3	0.3	0.3	0.3				· .
		1993	2	0.6	0.6	0.6				
		1993	1	0.2	0.2	0.2				
		1992	3	0.2	0.2	0.2				
		1992	2	0.4	0.4	0.4				
3587	WLM	1994	2	0	0	0				
										·

			ROCKY FI	ATS GRO	UNDWAT	ER SAMPL	ING HNu	READIN	GS		
						Survey Res	ults				
Well	İ		ļ		At Opening			After Ver	nting		
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	
1		1994	1	11.2	11.2	11.2				·	
		1992	3	0.2	0.2	0.1			,		1
		1992	2	0.2	0.2	19.5				No venting data	ļ
		1992	1	0.2	0.2	0.2					i
		1991	3	0.3	0.3	0.3					
		1991 1991	3 2	0.1	0.1	0.1					
3687BR	SAMPLE	1994	2	0.3	0.3	5.3				No venting data	
300721	SAMILE	1994	1	0 2.5	0 2.5	0 2.5		Ì			ļ
'		1993	4	0.2	0.2	0.2					
		1993	3	0.4	0.4	0.4					- 1
		1993	2	0.1	0.1	0.1					ŀ
	1	1993	1	0.5	0.5	0.5					
		1992	3	0.3	0.3	0.3					
		1992	2	0.2	0.2	2.4			1	No venting data	
3887	SAMPLE	1994	2	o	0	0					- 1
		1994	1	0.6	0.6	0.6			1		
		1992	3	0.3	0.3	0.3		}			
		1992	2	0.3	0.3	0.3					
		1992	, 1	0.9	0.9	0.6					i
		1991	3	0.2	0.2	0.2				5	Ī
		1991	2	0.4	0.4	0.4				,	ľ
3987	SAMPLE	1994	2	0	o	0					
1.		1994	1	0	0	0					
1		1993	4	0.2	0.2	0.2				•	١.
		1993	3	0.3	0.3	0.3					- 11
1		1993	2	0.2	0.2	0.2					
		1993	1	0.6	0.6	0.6					
		1992	3	0.3	0.3	0.3					
4007	1177.4	1992	2	0.3	0.3	0.3					
4087	WLM	1994	2	0	0	0					
		1993	4	0.3	0.3	0.3				•	
		1993	3	0.2	0.2	0.2			1		
		1993 1992	2	0.2	0.2	0.2					
		1992	3	0.2	0.2	0.2					
		1992	2	0.4	0.4	0.4					
		1991	1 4	0.3	0.2	0.1	'				
4187BR	SAMPLE	1994	2	0.2	0.2	0.2			.		
	J. Lin EE	1994	1	4.4	0 4.4	0	-				
		1993	3	0.1	0.1	4.4 0.1					
	1	1993	2	0.2	0.2	0.1	1				
	1	1992	3	0.2	0.2	0.2	ļ		i		
		1992	2	0.4	0.4	0.3					
		1992	1	0.3	0.2	0.1					
		1991	4	0.2	0.2	0.2					
4287	SAMPLE	1994	2	0	0	0	1				
		1994	1	0.3	0.3	0.3					
		1993	3	0.2	0.2	0.2				•	
		1993	2	0.6	0.6	0.6	1				İ
	'	1993	1	0.6	0.6	0.6	-				
		1992	3	0.2	0.2	0.2	ļ				1
]	1992	2	0.4	0.4	0.4			ļ		İ
	j	1992	1	0.3	0.2	0.2			.		
4387	WLM	1994	2	o	0	o					

				ROCKY F	LATS GRO	UNDWAT	ER SAMPL	ING HNu	READING	s	
		-					Survey Rest	ults			
	Well	_				At Opening			After Venti	ng	
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
—			1993	2	0.2	0.2	0.2				
			1992	1	0.1	0.1	0.1				
-			1992	3	0.4	0.4	0.4				
Ì			1992	2	0.5	0.5	250				No venting data
ı			1991	4	0.2	0.2	0.2				
			1991	3	0.3	0.3	0.3				
			1991	2	0.4	0.4	0.8	0.2	0.2	0.2	
	4487	WLM	1994	2	o	0	o				
			1994	1	5.5	5.5	5.5				
			1992	3	0.2	0.2	0.2				
			1992	2	4	4	17	0.6	0.6	0.6	
1.			1992	1	0.2	0.2	0.2				
			1991	4	0.2	0.2	0.2	i	l		•
			1991	3	0.1	0.1	0.1	.	i		
			1991	2	0.4	0.4	0.4	- 1		- 1	
	4587BR	·SAMPLE	1994	2	0	o	o				
			1994	1	2.8	2.8	2.8				·
		1	1993	3	0.3	0.3	0.3			Ī	
			1993	2	0.2	0.2	0.2	i	1		
			1993	1	0.6	0.6	0.6	- 1	1	1	
			1992	3	0.3	0.3	0.3	.			
			1992	2	4	4	4.5	0.2	0.2	0.2	
			1992	1	0.2	0.2	0.2	1			
	4787	WLM	1994	2	0	0	o				1
			1994	1	0.5	0.5	0.5			i	·
			1992	3	0.3	0.3	0.3				
			1992	2	0.4	0.4	0.4				
			1992	1	0.2	0.2	0.2	.			
		1	1991	4	0	0	o		1		
			1991	3	0.1	0.1	0.1				
1		1	1991	2	2.2	2.2	2.2				1
	4887	WLM	1994	2	0	o	0				
			1994	1	5.8	5.8	5.8				
			1993	1	0.9	0.9	0.9			Ì	
			1992	3	0.3	0.3	0.3	İ]	
			1992	2	0.4	0.4	0.4	1	İ	İ	
		1	1992	1	0.3	0.3	0.3				į
			1991	4	0.2	0.2	0.2				
İ		ļ	1991	3	0.1	0.1	0.1				
	4987	WLM	1994	2	0	o	· 0		ĺ	1	
			1994	1	5.2	5.2	5.2	-			·
			1992	3	0.3	0.3	0.3			İ	
ĺ			1992	2	0.2	0.2	0.2	1			
			1992	1	0.2	0.2	0.2	1			
ĺ			1991	4	0.2	0.2	0.2	İ			
			1991	3	0.1	0.1	0.1				
			1991	2	2.5	2.5	2.5				. 1
	5087	WLM	1994	2	o	o	0]			
			1994	1	5.2	5.2	5.2				
			1992	3	0.3	0.3	0.3				
			1992	2	4	4	4.5			N.	o venting data
		İ	1992	1	0.1	0.1	0.1		1	1"	· · · · · · · · · · · · · · · · · · ·
			1991	4	0.2	0.2	0.2				
			1991	3	0.1	0.2	0.2		1	N	venting data
			1991	2	2.4	2.4	2.4			1,40	ventug data
					-:-	2.7	<u> </u>				

i i		T I						READING	<u> </u>	
337-11			}			Survey Res			·	-
Well ID	Status	Year	Qtr	BG	At Opening BZ	WH	BG	After Vention BZ	ng WH	COMMENTS
5187	SAMPLE	1994	2	0	0	0	טם	BZ	WH	COMMENTS
3187	JAMI LL	1994	1	3.6	3.6	3.6				
		1993	1	0.7	0.7	1	0	o	۰ ا	
		1992	3	0.4	0.4	0.4	U	0	ľ	
		1992	2	0.3	0.4	0.4				
		1992	1	0.1	0.1	0.3				
		1991	4	0.1	0.1	0.1		!		
		1991	3	0.2	0.2	0.2				
5287	SAMPLE	1994	2	0.2	0.2	0.2				
	J. 2.1. 22	1994	1	6.3	6.3	6.3				
	1 .	1993	3	0.3	0.3	0.3				
İ		1993	2	0.2	0.2	0.2	İ			-
	İ	1992	3	0.1	0.1	0.1				
		1992	2	0.2	0.2	0.2				
		1992	1	0.2	0.2	0.2				
		1991	4	0.2	0.2	0.2				
5387	WLM	1994	2	0	0	0				
		1994	1	0.5	0.5	0.5				·
		1992	3	0.4	0.3	0.3				·
		1992	2	0.4	0.4	0.4				
		1992	1	0.2	0.2	0.2				
		1991	4	0.1	0.1	0.1				
		1991	3	0.1	0.1	0.1				
	1	1991	2	2	1.8	1.8				
5487	SAMPLE	1994	2	o	o	0				
		1994	1	1.2	1.2	1.2				·
İ		1993	3	0.1	0.1	0.1				İ
	1	1993	2	0.6	0.6	17	0.4	0.4	10	2nd Day
		1991	2	0.2	0.2	0.2				į
		1992	3	0.3	0.3	0.2				
		1992	2	0.4	0.4	0.3	İ			
		1992	1	0.1	0.1	0.1	1			
5587	SAMPLE	1994	2	0	o	0		l		
}		1994	1	5.6	5.6	5.6				
		1993	3	0.02	0.02	1	0	0	0	
		1993	2	0.3	0.3	0.3				
		1992	3	0.3	0.3	0.2				
		1992	2	0.3	0.3	0.3		.]		
		1992	1	0.1	0.1	0.1				
		1991	4	0.1	0.1	0.1			•	
5687	SAMPLE	1994	2	0	0	0				
		1994	1	3.6	3.6	3.6	ľ			
		1993	4	0.4	0.4	0.4				
	i i	1993	3	0.2	0.2	0.2	-	_		
		1993	1	0.4	0.4	0.4	j			
		1992	3	0.3	0.3	0.3	1	- 1	İ	
		1992	2	0.3	0.3	0.3			-	
]	1992	1	0.4	0.2	0.2				
5887	SAMPLE	1994	2	0	0	0		ŀ		
ı		1994	1	0.3	0.3	0.3				
		1993	4	0.3	0.3	0.4	0.5	0.5	0.5	1%LEL
		1993	3	0.2	0.2	0.2			ľ	
]	1993	2	0.3	0.3	0.3		l		
		1993	1	0.2	0.2	0.2	į	}	ļ	
		1992	3	0.2	0.2	0.2				

Survey Results	
ID Status Year Qtr BG BZ WH BG BZ WH COMMENTS 1992 2 0.4 0.4 0.4	
6087 SAMPLE 1994 2 0 0 0 0	
1994 1 1 1 1	
1993 4 0.5 0.5 0.5	
1993 3 0.2 0.2 0.2	
1993 1 0.5 0.5 0.5	
1992 3 0.1 0.1 0.1	
1992 2 1.4 1.4 3.8 0.2 0.2 0.2	
1992 1 0.3 0.2 0.1	
6187 SAMPLE 1994 2 0 0 0	
1994 1 1 1 1	
1993 4 0 0.2 0.2 1% EXP	
1993 4 0.2 0.2 0.2	
1993 3 0.2 0.2 0.2	İ
1993 1 0.2 0.6 0.6	
1992 3 0.1 0.1 0.1	
1992 2 1.2 1.2 1.2	
6287 WLM 1994 2 0 0 0	
1993 1 0.2 0.2 0.2	
1992 3 0.1 0.1 0.3 0.3 0.3 0	
1992 2 1.2 1.2 3.8 0.2 0.2 0.2	
1992 1 0.2 0.2 0.1	
1991 4 0.3 0.3 0.3	
1991 3 0.4 0.4 0.4	' '
1991 2 1.5 1.5 1.4	
6487 SAMPLE 1994 2 0 0 0	
1994 1 2.6 2.6 2.6	
1993 4 0.3 0.3 0.3	
1993 3 0.3 0.3 0.3	
1993 1 0.8 0.8 0.8	
1992 3 0.1 0.1 0.1	
1992 2 0.4 0.4 0	
1992 1 0.2 0.2 0.2 6587 SAMPLE 1994 2 0 0 0	
	İ
1994 1 2.9 2.9 2.9 1993 4 0.1 0.1 0.1	
1992 1 0.3 0.2 0.2 6687 SAMPLE 1994 2 0 0 0 0	
1994 1 2.6 2.6 2.6	
1993 4 0.2 0.2 0.2	
1993 3 0.3 0.3 0.3	
1993 2 0.3 0.3 0.3	
1992 3 0.2 0.2 0.2	
1992 2 0.4 0.4 0.4	
1992 1 0.3 0.2 0.2	
6887 SAMPLE 1994 2 0 0 0	
1994 1 7.2 7.2 7.2	
1993 4 0.2 0.2 0.2	
1993 3 0.1 0.1 0.1	
1992 3 0.1 0.1 0.1	
1992 2 1.6 1.6 1.6	

			ROCKY F	LATS GRO				READIN	GS		
						Survey Res		_			
Well			_		At Opening		<u> </u>	After Ven		4	-
<u>ID</u>	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	_
	-	1992	1	0.2	ı		1				
7087	CANONE	1991	4	0.3	!	0.3					- 1
/09/	SAMPLE	1994 1994	2 1	0 4.5	0 4.5						j
		1993	4	0.3	0.3	4.5 0.3		İ			ĺ
		1993	3	0.3	0.3	0.3					ĺ
		1993	1	0.8	0.8	0.2					
· ·		1992	3	0.2	0.2	0.2					
ĺ		1992	2	0.4	0.4	0.4					
		1992	1	0.3	0.2	0.2		f	i	-	
7187	SAMPLE	1994	2	0	0	o		1			
		1994	1	6	6	6					İ
		1993	3	0.3	0.3	0.3					
		1993	2	0.2	0.2	0.2				:	
		1993	1	0.6	0.6	0.6				1	.
	İ	1992	3	0.4	0.4	0.4					
	1	1992	2	1.6	1.6	1.6					
		1992	1	0.3	0.2	0.2					
7287	SAMPLE	1994	2	0	0	0		1			- 1
		1994	1	0.2	0.2	0.2				İ	
		1993	4	0.3	0.3	0.3			1		İ
		1993	3	0.3	0.3	0.3		İ			
		1993	2	0.4	0.4	0.4					
·		1993 1992	1	0.2	0.2	0.2					
		1992	3 2	0.2	0.2	0.2					(
B400089	WLM	1994	2	0.4	0.4	0.4			1		
B400189	WLM	1994	2	ol	0	0					
		1992	3	2.8	2.8	2.8					
	İ	1992	3	1.3	1.3	1.3		1			
		1992	1	0	0	0					
		1991	4	0.2	0.2	0.2					
		1991	3	0.3	0.3	0.3					-
		1991	2	0.4	0.3	0.3					
		1991	1	0	0	0					
B400289	WLM	1993	2	0.2	0.2	0.2					
	1	1993	3	0.4	0.4	0.4					
		1992	3	2.2	2.2	2.2					ı
1		1992	2	0.4	0.4	0.4					
		1992	1	0	o	o					
		1991	4	0.2	0.2	0.2					
		1991	3	0.2	0.2	0.2					
		1991	2	0.3	0.3	0.3					
B400389	WLM	1994	2	0	0	0					
		1993	2	0.4	0.4	0.4					
	i i	1993	1	0.4	0.4	0.4					1
		1992	3	3	3	3					
]	1992	2	0.3	0.3	0.3					
		1992	1	0	0	0					
ı	[]	1991	4	0.2	0.2	0.2					
D400400		1991	3	0.2	0.2	0.2					
B400489	WLM	1994	2	0	0	0	.		1		
		1993	2	0	0	0	. [ĺ	İ		
		1993	1	0.4	0.4	0.4	{				
	L	1992	3	3	3	3.6	0.2	0.2	0.2		

				ROCKY F	LATS GRO	UNDWAT	ER SAMPL	ING HN	READIN	GS		
	Well						Survey Resi					-
	ID	S4.4	.			At Opening			After Ven	ting		
	10	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	
			1992	2	0.5	0.5	0.5		1			Ī
			1992 1991	1	0	0	0					
			1991	4	0.2	0.2	0.2				-	
	B200589	WLM	1991	3	0.2	0.2	0.2			1		
	2200505	WENT	1994	2	0	0	0					
			1993	. 2	0.6	0.6	0.6		1	1		-
			1992	1	0.4	. 0.4	0.4					
			1992	2	0.6	0.6	0.6					
			1992	1	0.3	0.5	0.5					
-			1991	4	0.2	0.2	0.2					
1			1991	3	0.2	0.2	0.2			1		
	B200689	WLM	1994	2	0	0.2	0		1			
		'	1993	2	0.4	0.4	0.4			,		١
-			1992	3	1.5	1.5	1.5					Ì
-			1992	2	0.5	0.5	0.5					
	•		1992	1	0.2	0.2	0.2					
			1991	4	0.2	0.2	0.2					ĺ
			1991	3	0.2	0.2	0.2					
-			1991	2	3	2	2					
	B200789	WLM	1994	2	0	0	0					ĺ
			1993	2	0.3	0.3	0.3					
			1993	1	0.2	0.2	0.2					
1			1992	3	1.7	1.7	1.7				,	
			1992	2	0.4	0.4	0.4					
7			1992 1991	1	0.4	0.4	0.4					
			1991	3	0.3	0.3	0.3					
	B200889	WLM	1994	2	0.2	0.2	0.2			ľ	·	
			1993	2	0.6	0.6	0.6					
			1992	3	1.7	1.7	1.7					
			1992	2	0.3	0.3	0.3		İ	i		
			1992	1	0.2	0.2	0.2					
			1991	4	0.3	0.3	0.3	j				
			1991	3 2	0.2	0.2	0.2	1	i			
	D001000		1991		2	2	2	ŀ				
	B201089	WLM	1994	2	0,	0	0		i		İ	
			1993	1	0.4	0.4	0.4		1	-		
			1992	3	0.9	0.9	0.9		.	İ	[
			1992		0.5	0.5	0.5	ļ	1	1		
	1		1992 1991	1	4.2	4.2	4.2	İ	1			
	1		1991	4	0.2	0.2	0.2	ł				
1			1991	3 2	0.2	0.2	0.2					
	B201189	WLM	1994	2	0	2	2		ĺ			
		11-11-1	1993	1	0.8	0.8	0					
			1992	3	2	2	2.5	0.5	0.5	0.5		
			1992	2	0.8	0.8	100	0.0	ام		1	
			1992	1	0.0	0.8	0	0.8	0.8	0.8	·	
			1991	4	0.2	0.2	0.2					
	-		1991	3	0.2	0.2	0.2		1			
	7		1991	2	2	2	2					
	B201289	WLM	1994	2	0	0	0				1	
	·		1993	1	0.4	0.4	0.4					
			1992	3	2.8	2.8	2.8					

			ROCKY F	LATS GRO	UNDWAT	ER SAMPL	ING HNu	READING	S	
	1	- 1				Survey Res	ults			
Well		1			At Opening			After Venti	ing	1
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
1		1992	2	4.6	4.6	3.8		32	*****	COMMENTS
		1992	1	0	0	o				
1	İ	1991	4	0.3	0.3	0.3				
	1	1991	3	0.2	0.2	0.2				
	1	1991	2	2	2	2				
B201589	WLM	1994	2	0	o	o	i			
		1993	1	0.2	0.2	0.2				
		1992	3	2.4	2.4	2.4				
		1992	2	2	2	150	0.2			
	1	1992	1	o	0	0	0.2	0.2	0.2	
		1991	4	ol	o	o	1	-		
	1	1991	3	0.2	0.2					1
	}	1991	2	2	1	0.2		ľ		
B401989	WLM	1994	2	o	2	2			- 1	
İ		1993	2	0.3	0	0		1		
	1	1993	1		0.3	0.3			i	
	- 1	1992	3	0.2	0.2	0.2	1			
		1992	2	3.2	3.2	3.2				
1		1992	ı	0.7	0.7	0.7				1
		1991	1	1.2	1.2	1.2		1	1	
		1991	4	0.1	0.1	0.1		1		1
B302089	WLM	1994	3	0.2	0.2	0.2				
		1 1	2	0	0	0	İ			
		1993	2	0.3	0.3	0.3				
		1993	1	0.4	0.4	0.4		ĺ		• .
·		1992	3	1.4	1.4	1.4		ĺ	1	
		1992	2	0.7	0.7	0.5		1		
	ł	1992	1	0	0	0				1
		1991	4	0.1	0.1	0.1	- 1			
B402189	377.4	1991	3	0.2	0.2	0.2		1		.
5402189	WLM	1994	2	0	0	0			ļ	
		1993	2	0.3	0.3	0.3			Ī	
		1993	1	0.2	0.2	0.2			ľ	
		1992	3	1.8	1.8	1.8			- 1	
	1	1992	2	0.7	0.7	0.5			1	
	1	1992	1	0.4	0.4	0.4				
1		1991	4	0.2	0.2	0.2				1
Digge		1991	3	0.2	0.2	0.2	ŀ			İ
B102289	WLM	1994	2	0	0	o				
	1	1992	1	0.3	0.3	0.3		.		[
	1	1992	3	0.9	0.9	0.9			ĺ	1
		1992	2	0.5	0.5	0.5	- 1		1	
		1991	4	0.4	0.4	0.3	1			
	1	1991	3	0.2	0.2	0.2				
	1	1991	2	2	2	2			1	
B102389	WLM	1994	2	0	0	0	1		- 1	
		1993	1	0.4	0.4	0.4			-	
		1992	3	1	1	1			-]
		1992	2	0.5	0.5	0.5	.			1
		1992	1	0.3	0.3	0.3			1	İ
		1991	4	0.2	0.2	- 1				
ŀ		1991	3	0.2	- 1	0.2			ĺ	سر ا
		1991	2	- 1	0.2	0.2				
B202489	WLM	1994	2	2	2	2			1	
		1993	,	0	0	0	1			
	1	l l	1	0.3	0.3	0.3				
		1992	3	2.6	2.6	2.6				

TABLE E-2
ROCKY FLATS GROUNDWATER SAMPLING HALL BE ADDICES

				ROCKY F	LATS GRO	UNDWAT	ER SAMPL	ING HNu	READING	s	
							Survey Rest	ults			
	Well			_		At Opening			After Venti	ng	
ı	ID	Status	Year	Qtr_	BG	BZ	WH	BG	BZ	WH	COMMENTS
_	1	1	1992	2		6.2	5.8				
			1992	1	1	0	0				
	1	1	1991	4	0.4	0.4	0.4				
		İ	1991	3	0.2	0.2	0.2				<u> </u>
	B202589		1991	2	2	2	2				
	B202389	WLM	1994	2	0	0	0				ļ
			1993	. 1	0.3	0.3	0.5	0.4	0.4	0.4	
			1992	3	2.4	2.4	2.4				
			1992	2	1.2	1.2	4	0.5	0.5	0.5	
			1992	1	0	0	0				
		1	1991	4	0.2	0.2	0.2	I	Ī		
	•	1	1991	3	0.2	0.2	0.3	1			No venting data
	B402680		1991	2	0.2	0.2	0.2	ŀ	ĺ		
	B402689	WLM	1994	2	0	0	0			i	
		1	1993	2	0.2	0.2	0.2	- 1	İ	.	1
			1992	3	3.6	3.6	3.6	.	1	1	}
			1992	2	0.2	0.2	0.2	- 1		ĺ	
			1992	1	0.4	0.4	0.4	1			ļ
			1991	4	0.2	0.2	0.2	1	- 1		
		1	1991	3	0.2	0.2	0.2].	.	,	
1	B302789	1	1991	2	0.2	0.2	0.2	į		Ì	
-	B302789	WLM	1994	2	0	10	0			-	
ı			1993	1	0.2	0.2	0.2		.	-	
		-	1992	3	0.2	0.2	2.8	0.2	0.3	0.3	Day 2
			1992	2	0.4	0.4	0.4	.		ĺ	
	•	ļ	1992	1	0	0	0		İ		
			1991	4	0.15	0.15	0.15				
			1991	3	0.2	0.2	0.2	ŀ			
	D202000	1	1991	2	0.2	0.2	0	-		İ	
	B302889	WLM	1994	2	0	0	0		İ		
		i	1993	1	0.4	0.4	0.4		!	1	
-			1992	3	2.8	2.8	2.8			-	
İ			1992	2	0.3	0.3	0.3	.]			!
			1992	1	0	0	0		ľ		
			1991	4	0.1	0.1	0.1				
			1991	3	0.3	0.3	0.3	1	- 1		
	, D202000		1991	2	0.3	0.3	0.3		İ		
l	B302989	WLM	1994	2	0	0	0			İ	
		1	1992	3	2.8	2.8	2.8				
	•		1992	2	0.7	0.7	0.6			[-
		1	1992	1	0	0	0				
			1991	4	0.2	0.2	0.2			İ	
			1991	3	0.3	0.3	0.3	İ			İ
			1991	2	0.3	0.3	0.3				
			1991	1	0.2	0.3	0.3	Ì	1		o venting data
	B303089	WLM	1994	2	0	0	0	ļ			
			1994	1	0.7	0.7	0.7	1			
			1993	4	0.4	0.4	0.3				
			1993	1	0.3	0.3	0.3		Ì		
-			1992	3	0.1	0.1	0.1				
			1992	2	4.8	4.8	4.8				•
	•		1992	1	o	o	0			1	
			1991	4	0.1	0.1	0.1	ĺ	1		
	B203189	WLM	1994	2	o	0	0				
			1993	2	0.4	0.4	0.4				
					$\overline{}$					- 1	•

f			KOCK I F.	LAIS GRO				READING	<u>s</u>	
Well				<u> </u>		Survey Res				-
ID	State		•		At Opening			After Venti		
<u> </u>	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
		1993	1	0.3	0.3	l i				İ
		1992	3	0.4	0.4	0.4				
		1992	2	0.7	0.7	0.7				
		1992	1	0.6	0.6	0.7	0.2	0.2	0.2	
		1991	4	0.3	0.3	0.3				
		1991	3	0.2	0.2	0.2				
B203289	WLM	1994	.2	0	o	0				
		1993	2	0.4	0.4	0.4				
		1993	1	0.2	0.2	0.2		,		
	1	1992	3	1.6	1.6	1.6				
	1	1992	2	0.5	0.5	0.5				
	1	1992	1	0.2	0.2	0.2				
		1991	4	0.2	0.2	0.2				
1		1991	3	0.2	0.2	0.2		•		
B203489	WLM	1994	2	o	o	o				
	1	1993	2	0.3	0.3	0.3				
		1993	1	0.2	0.2	0.7	0.2	0.2	0.2	
İ		1992	3	2	2	2	J.2	0.2	0.2	
		1992	2	0.4	0.4	0.4				
		1992	ı	0.4	0.4	0.4				
	1	1991	4	0.3	0.3	0.3				
		1991	3	0.3	0.3					į.
B203589	WLM	1994	2	0.2	0.2	0.2		ŀ	İ	
2203303	*** 2.**	1993	2	i	- 1	- 1	į			į
		1993	1	0.6	0.6	0.6	1	.	İ	
		1 1	1	0.2	0.2	0.2				ļ.
1		1992	3	1.8	1.8	1.8				i
		1992	2	1.7	1.7	150.2	0.2	0.2	0.2	
	j	1992	1	0.4	0.4	0.4	l	ĺ		
		1991	4	0.3	0.3	0.3	ŀ		1	; :
7000700		1991	3	0.4	0.4	0.4	İ			i
B203789	WLM	1994	2	이	0	0	1	.		į
		1993	2	0.2	0.2	0.2				
		1993	1	0.4	0.4	0.4			Ī	:
		1992	3	1.6	1.6	1.6				
		1992	2	1.3	1.3	1.3		1	İ	•
		1992	1	0	0	0	ĺ			
		1991	4	0.3	0.3	0.3	1		1	
	1	1991	3	0.3	0.3	0.3				!
B203889	WLM	1994	2	0	0	0	1			
		1993	2	0.6	0.6	0.6				!
1		1993	1	0.2	0.2	0.2			İ	
ļ		1992	3	1.8	1.8	1.8				
		1992	2	1.7	1.7	2.1	0.3	0.3	0.3	
		1992	1	0.2	0.2	0.2				
		1991	4	0.3	0.3	0.3				i
		1991	3	0.2	0.2	0.2	1			
B203989	WLM	1994	2	0	0	0		1		
		1994	1	o	o	o		İ		
		1993	1	0.4	0.4	0.4		ľ		į
		1992	3	1.9	1.9	1		ļ	1	
'		1992	I .			1.9			_	
			2	0.15	1.5	2	0.3	0.3	0.3	·
		1992	1	0	0	0				
		1991	4	0.2	0.4	0.4		İ	N	lo venting data
Dea		1991	3	0.2	0.2	0.2	İ	ļ		; !
B204089	WLM	1994	2	0	0	0				

				T	arro orco				READINGS	······································	
	337-11			. }			Survey Resu				
	Well ID	Status	Year	Qtr	BG	At Opening BZ	WH	BG	After Ventin		COMMENTS
Y	עו	Status	1994	1	. 6.8	6.8	6.8	BG	BZ	WH	COMMENTS
			1993	ı	0.3	0.3	0.3				
			1992	3	0.5	0.5	0.5				
	•		1992	2	1	1	1.2	0.4	0.4	0.4	
			1992	1	4	4	4.8	0.3	0.3	0.3	
			1991	4	0.3	0.3	0.3				
			1991	3	0.2	0.2	0.4				
	B204189	WLM	1994	2	0	o	o				
			1994	1	8	8	8	:			_
			1993	1	0.5	0.5	0.5				
			1992	3	0.5	0.5	0.5	1			
			1992	2	1	1.2	0.8	0.4	0.4	0.4	
			1992	1	4	4	5	0.3	0.3	0.3	
			1991	4	0.3	0.3	0.3	İ			
-			1991	3	0.2	0.2	0.2				
	B304789	WLM	1994	2	0	0	0	į	Í		
			1993	4	0.2	0.2	0.2	1			
			1993	2	0.3	0.3	0.3				
İ			1993 1992	3	0.6	0.6	0.6	į	1		
-			1992	2	0.3	0.7	0.3				
		1	1992	1	0.7	0.7	0.5				
			1991	4	0.1	0.1	0.1		.		,
ļ	B304889	WLM	1994	2	0.1	0.1	0				•
	200 1007		1993	2	0.3	0.3	0.3		İ		
			1993	1	0.4	0.4	0.4				
			1992	3	2.8	2.8	2.8	ŀ			<u> </u>
1			1993	2	3.4	3.4	3.4				
		İ	1993	1	0	0	0	į			
			1991	4	0.1	0.1	0.1				
		:	1991	3	0.3	0.3	0.3		,		
	B304989	WLM	1994	2	0	0	0		-		
			1993	2	0.3	0.3	0.3				`
			1993	1	0.3	0.3	0.3	ĺ			
			1992	3	2.8	2.8	2.8	İ			
			1992	2	3.3	3.3	3.3				
-			1992	1	0	0	0				
ı			1991	4	0.1	0.1	0.1				
	B405189	WLM	1991	3	0.2	0.2	0.2				
	B403189	WLM	1994 1993	2	0	0	0		Ī		
			1993	2	0.2	0.2	0.2 0.2		-		
			1992	3	3.4	3.4	3.4	1			
			1992	2	0.8	0.8	0.5	1			
			1992	1	0.0	0.8	0.5	İ			
			1991	4	0.1	0.1	0.1	1			
			1991	3	0.2	0.2	0.2		Ì		
	B405289	WLM	1994	2	0	0	0.2				
	*-		1993	2	0.2	0.2	0.2	1			
			1993	1	0.2	0.2	0.2	Ì			
			1992	3	3.4	3.4	3.6	0.2	0.2	0.2	
-			1992	2	0.7	0.7	0.6	-			
	•		1992	1	0.4	0.4	0.4		.		
			1991	4	0.1	0.1	0.1				
			1991	3	0.2	0.2	0.2				

		F	ROCKY FI	ATS GRO	UNDWAT			READING	GS	·
Well	1			Survey Results At Opening A						4
ID	Status	Vana	~-					After Vent		
B305389	WLM	Year 1994	Qtr 2	BG 0	BZ 0	WH 0	BG	BZ	WH	COMMENTS
2505505	W 2.W	1993	2		0.3	1				1
		1993	1	0.3	0.3	0.3	i			
		1992	3	2.4	2.4	2.4				
		1992	2	0.5	0.5	0.5			İ	
		1992	1	0.5	0.5	0.5				
		1991	4	0.1	0.1	0.1				
		1991	3	0.2	0.2	0.2				
B405489	WLM	1994	2	o	o	0	j			
		1993	2	0.3	0.3	0.3				
		1993	1	0.2	0.2	0.2	-			
	1	1992	3	2.6	3	4.2	0.2	0.2	0.2	
		1992	2	0.3	0.3	0.3	j			• •
1		1992	1	0	0	0			1	
		1991	4	0.2	0.2	0.2			1	
		1991	3	0.1	0.1	0.1				
B205589	WLM	1994	2	0	0	0				
		1994	1	0.6	0.6	0.6				
		1992	3	2.1	2.1	2.1	. 1			
		1992	2	0.3	0.3	0.3				
	1	1992	1	0	0	0				
	1	1991	4	0	0	0	1			·
		1991 1991	1 2	0.2	0.2	0.2				
B405689	WLM	1994	2	2 0	0	0				
		1993	2	0.3	0.3	0.3				
1		1993	1	0.8	0.8	0.8		i		•
		1992	3	2.2	2.2	2.8	0.2	0.1	0.1	
		1992	2	1.2	1.2	0.8	V.2	0.1	0.1	
		1992	1	o	o	0	1		.]	
		1991	4	0.2	0.1	0.1				
		1991	3	0.2	0.2	0.2	j			
B405789	WLM	1994	. 2	0	0	0	-			
		1993	2	0.3	0.3	0.3			- 1	
		1992	3	3	3	3		i	1	
	ŀ	1992	2	0.5	0.5	0.5			1	
	Ì	1992	1)	0	0	0		1	}	
		1991	4	0.2	0.2	0.2	}	.	j	
		1991	3	0.2	0.2	0.2	İ			
Dansago		1991	2	0.3	0.2	0.2				-
B405889	WLM	1994	2	0	0	0		- 1		
	^	1993 1993	2	0.2	0.2	0.2	-	i		
İ		1993	1	0.2	0.2	0.2				
		1992	3	1.8	1.8	1.8	Ì	.]		
1		1992	1	0.7	0.7	0.4				
		1991	4	0.4	0.4	0.4			[
		1991	3	0.13	0.13	0.13				
B405989	WLM	1994	2	0.2	0.2	0.2	j			
		1993	1	0.2	0.2	0.2				
'		1992	3	1.8	1.8	1.8				
		1992	2	0.7	0.7	0.5		1		•
		1992	1	0.4	0.4	0.4				
		1991	4	0.1	0.2	0.1	0.3	0.2	0.2	
		1991	3	0.2	0.2	0.2				

				ROCKY FLATS GROUNDWATER SAMPLING HNu READINGS							
	337-11						Survey Res	ults			_
	Well	Status	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	~ .		At Opening			After Vent		_
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
	B106089	SAMPLE	1991	2	0.3	0.3	0.3				
	D100083	SAMPLE	1994 1994	2	0	0	0				
			F J	1	2.1	2.1	2.1			-	
			1993	4	0.3	0.3	0.3				
			1993	3	0	0	0				
			1993	2	0.3	0.3	0.3		l		
			1993	1	0.2	0.2	0.3				No venting data
-		1	1992	3	0.1	0.1	0.1				
	B206289	SAMPLE	1992	2	0.4	0.4	0.3				
	D200289	SAMPLE	1994	2	0	0	0			ľ	
			1994	1	4.5	4.5	5				no venting info
			1993	4	0.2	0.2	0.2		ĺ		1
			1993 1993	3	0.3	0.3	0.3				
			1993	2	0.3	0.3	0.3				
1			1993	1	0.2	0.4	0				
			1992	3	0.1	0.1	0.1				
1	B206489	SAMPLE	1992	2	0.4	0.4	0.4				
	D200489	SAMPLE	1994	2	0	0	0				
				1	2.3	2.3	2.3				
		Î	1993	4	0.2	0.2	0.2				
		ر ا	1993	3	0.3	0.3	0.3				
			1993	2	0.4	0.4	0.4				·
			1993	1	0.3	0.2	0.2				
			1992	3	0.2	0.2	0.2				'
	B206589	SAMPLE	1992	2	0.4	0.4	0.4				
	D200389	SAMPLE	1994	2	0	0	0				
T			1994	1	5.5	5.5	5.3				
1			1993	3	0	0	0				
			1993	2	0.2	0.2	0.2				
			1993	1	0.3	0.3	0.4	ļ			
			1992 1992	3	0.1	0.1	0.1				
		1	1 1	2	0.4	0.4	0.4	l	1		
	B206689	SAMPLE	1992	1	0.3	0.2	0.2	.]		
	D20000	SAMILE	1994 1994	2	0	0	0	1			
		i	1 1	1	1.1	1.1	, 1.1				
]	1993	4	0.2	0.2	0.2	ĺ			
1			1993	3	0.2	0.2	0.2	-	1		
			1993	2	0.2	0.2	0.2	ľ	ļ		
			1992	3	0.2	0.2	0.2	1	.		
			1992	2	0.5	0.5	0.5				•
İ	B206789	SAMPLE	1992	1	0.3	0.2	0.1	i			
	D200789	SAMPLE	1994	2	0	0	0	.			
			1994	1	0.02	0.02	0.02	ļ	ļ		
		,	1993	4	0.2	0.2	0.2	İ	1		
			1993	3	0.1	0.1	0.1	ļ	-		
			1993	2	0.2	0.2	0.2	1	ļ		
			1993	1	0.8	0.8	12	İ	1	į.	no venting info
	^		1992	3	0.2	0.2	0.2				
	Dancago	0.43 (75) -	1992	2	1.6	1.6	1.6	- 1	İ	1	
	B206889	SAMPLE	1994	2	0	0	0		}		
			1994	1	0.2	0.2	0.2	1]		
		ĺ	1993	4	0.3	0.3	0.3	ľ			
1			1993	3	0.2	0.2	0.2				
			1993	1	0.5	0.5	0.5				
L	<u>-</u>		1992	3	0.2	0.2	0.2				

			ROCKY FI	LATS GRO	UNDWAT	ER SAMPL	ING HNu	READING	S		
						Survey Resu					
l Well					At Opening			After Venti	ng		
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	
		1992	2	1.6	1.6	100.4	0.3	0.3	0.3		
Dancono		1992	1	0.3	0.3	0.2		ĺ			
B206989	SAMPLE		2	0	이	0					
		1994	1	0.5	0.5	0.5					1
	- 1	1993	4	0.2	0.2	0.2					
		1993	3	0.1	0.1	0.1					
}		1993 1992	1	0.7	0.7	0.7					Ì
		1992	3	0.2	0.2	0.2					
}		1992	2	0.4	0.4	0.4					
B207089	SAMPLE	1994	2	0.3	0.1	0.1	l				
		1994	1	7	7	7				,	
		1993	4	0.2	0.2	0.2					
		1993	3	0.3	0.3	0.3	ŀ				
		1993	2	0.3	0.3	0.3	i				ĺ
		1992	3	0.2	0.2	0.2					
		1992	2	0.4	0.4	0.3	l				
		1992	1	0.3	0.3	0.2	- 1	-			
B207289	WLM	1994	2	0	o	o	1	-			ľ
		1994	1	0.09	0.09	0.09					
		1993	1	0.4	0.4	0.4		İ			
İ		1992	3	0.4	0.4	0.4					
		1992	2	1.6	1.6	6.3		İ		No venting data	
		1992	1	0.2	0.2	0.2	1			-	.
•		1991	4	0.2	0.2	0.2			1		4
. P207200		1991	3	0.2	0.2	0.2					■ ■
P207389	SAMPLE	1994	2	0	0	0	-		1		
		1994	1	0.3	0.3	0.3					
1		1993 1993	4	0.2	0.2	0.2		- 1	1		
		1993	3 2	0.3	0.3	0.3		1			
		1992	3	0.3	0.3	0.3 0.3					
		1992	2	0.3	0.3						
1	İ	1991	4	0.2	0.3	0.3	0.2	0.0	0.0		ĺ
P207589	SAMPLE	1994	2	0.2	0.2	0.5	0.2	0.2	0.2		
		1994	1	o	o	o			1		
		1993	4	0.4	0.4	0.4					
		1993	3	0.2	0.2	0.2			i		
	1	1993	2	0.1	0.1	0.1		· .			1
	İ	1993	1	0.2	0.2	0.2			- 1		-
		1992	3	0.3	0.3	0.3	İ				İ
		1992	2	0.3	0.3	0.3			!		
P207689	SAMPLE	1994	2	0	o	0			İ		İ
		1994	1	0.2	0.2	0.2					
		1993	4	0.5	0.5	0.5					
		1993	3	0.3	0.3	0.3					
		1993	2	0.5	0.5	0.5	- !	İ			
!]	1993	3	0.3	0.3	0.3					
		1992	2	0.3	0.3	0.3					
Doormoo		1992	1	0.2	_ 0.2	0.2					
P207789	SAMPLE	1994	2	0	0	0		[1		
		1994	1	6.5	6.5	6.5			-		
		1993	4	0.4	0.4	0.4			İ		
		1993	3	0.3	0.3	0.3	[
	L	1993	2	0.3	0.3	0.3					

٢			<u> </u>	ROCKY FI	ATS GRO		ER SAMPL		READING	<u>s</u>	
	Well						Survey Rest	ults			4
	ID	Status	Year	Qtr	BG	At Opening BZ	WH		After Venti		00100000
		Juitus	1993	1	0.2	0.2	0.2	BG	BZ	WH	COMMENTS
			1992	3	0.3	0.2	0.2				
			1992	2	0.3	0.3	0.3			}	
- 1	P207889	SAMPLE	1994	2	0	0.5	0.5				
			1994	1	7.5	7.5	7.5				
-			1993	4	0.2	0.2	0.2				
- 1			1993	3	0.3	0.3	0.3	•			
			1993	2	0.3	0.3	0.3				
			1992	· 3	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3				
,			1992	1	0.7	0.7	0.7				
	P207989	SAMPLE	1994	2	0	0	0				
			1994	1	7.2	7.2	7.2				
			1993	4	0.6	0.6	0.6				
-			1993	3	0.3	0.3	0.3				
-		1	1993 1993	2	0.1	0.1	0.1				
			1993	1	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3				
ľ	B208089	SAMPLE	1994	2	0.5	0.3	0.3				
1			1994	1	0.7	0.7	0.7				
			1993	4	0.2	0.2	0.2				
			1993	3	0.2	0.2	0.2				
	_		1993	2	0.6	0.6	0.6				
-	L	1	1992	3	0.4	0.4	0.4]	ľ		
	•		1992	2	0.4	0.4	0.4	İ	1		
T			1992	1	0.2	0.2	0.2		ł		
	B208189	SAMPLE	1994	2	0	0	0	ŀ	ļ		
			1994	1	6.4	6.4	6.4		•		·
			1993	4	0.2	0.2	0.2				
İ			1993	3	0.2	0.2	0.2				
		1	1993	2	0.6	0.6	0.6				1
		1	1992	3	0.4	0.4	0.4				·
İ]]	1992	2	0.4	0.4	0.3				
	B208289	SAMPLE	1992	1	0.2	0.1	0.1			İ	
	D200209	SAMPLE	1994 1994	2	0	0	0			,	
		· [1993	1 4	0.2	4	4	1	ŀ		
		İ	1993	3	0.2	0.2	0.2	İ	.		
			1993	1	0.4	0.4	0.2 0.4		İ		
-			1992	3	0.3	0.3	0.4			1	
İ			1992	2	0.4	0.4	0.4	1		ļ	
			1992	1	0.3	0.2	0.2		-		ŀ
	B208389	WLM	1994	2	0	0	0		ļ		
			1993	2	0.1	0.1	0.1		ŀ		ţ
			1992	3	0.4	0.4	0.4				
			1992	2	0.4	0.4	0.4				
			1992	1	0.3	0.2	0.2				
	!		1991	4	0.2	0.2	0.2				
_			1991	3	0.2	0.2	0.2				
	B208489	WLM	1994	2	0	0	0	ĺ			
	'		1993	2	0.2	0.2	0.2			İ	
		ļ	1992	3	0.4	0.4	0.4	.			
		1	1992	2	0.4	0.4	0.4			İ	
			1992	1	0.3	0.2	0.2				

·	T	Т	ROCKYF	LATS GRO		ER SAMPL		READING	GS	
Well	}			Survey Results At Opening After Venting						-
ID	Status	Year								
	Status	1991	Qtr 4	BG 0.2	BZ	WH	BG	BZ	WH_	COMMENTS
1		1991	3	ı	0.2 0.2	0.2 0.2				
B208589	WLM	1994	2		0.2	0.2]		
	W 2.00	1992	3	0.2	0.2	0.2		1		
1	}	1992	2		0.4	0.4		1	1	
	1	1992	1	0.2	0.2	0.1		1		
] .	}	1991	4	0.2	0.2	0.2				
		1991	3	0.4	0.4	0.3		ĺ		
		1991	2	0.2	0.2	0.2			1	
	ļ	1991	1	0.2	0.2	0.2		1	1	
B208689	SAMPLE	1994	2	o	o	o	• ,	1	1	
	ļ	1994	1	o	o	o		1	1	
ļ		1993	4	0.3	0.3	0.3				
	-	1993	3	0.2	0.2	0.2		}		1
		1993	2	0.3	0.3	0.3		1		
1		1993	1	0.5	0.5	0.5		1		1
		1992	3	0.2	0.2	0.2		Ì		1
		1992	2	0.4	0.4	0.4				1
B208789	WLM	1994	2	이	0	0				1
	1	1993	2	0.2	0.2	0.2		,]]
1		1993	1	0.4	0.4	0.4				
	į	1992	3	0.4	0.4	0.4				
ļ.		1992 1992	2	0.4	0.4	0.2			(. [
	1	1992	1 4	0.3	0.1	0.1			ļ	
	{	1991	3	0.3	0.3	0.3			(ļ
P208889	SAMPLE	1994	2	0.2	0.2	0.2				[
120003	OF EVEN ELE	1994	1	0.2	0 2	0	ļ			[
	,	1993	4	0.2	0.2	0.2			[
	1	1993	3	0.2	0.2	0.2				
		1993	2	0.2	0.2	0.2	1			
	1	1992	3	0.3	0.3	0.3				
	1	1992	2	0.3	0.3	0.3				
	1	1992	1	0.2	0.2	0.2	}			}
P208989	SAMPLE	1994	2	o	0	0	1			ł
	1	1994	1	2.3	2.3	2.3	1			1
		1993	4	0.5	0.5	0.5	}			
	ì	1993	3	0.3	0.3	0.3				
		1993	2	0.2	0.2	0.2	- [.	l	{
		1992	3	0.3	0.3	0.3				
		1992	2	0.3	0.3	0.3	1	1		į.
	1	1992	1	0.2	0.2	0.2				
P209089	SAMPLE	1994	2	0	0	0	- [1	
		1994	1	0	0	0	- 1		.	
	ļ	1993	4	0.2	0.2	0.2		1	1	
		1993	3	0.3	0.3	0.3			ŀ	
		1993	2	0.1	0.1	0.1	1	}	}	j
		1993	1	0.4	0.4	0.4	ļ	ļ		
	}	1992	3	0.3	0.3	0.3		1		
D200100	1000 1 0	1992	2	0.3	0.3	0.3		İ		
P209189	WLM	1994	2	0	0	0		ł		
		1993	2	0.3	0.3	0.3	1	ľ		
_		1993	1	0.6	0.6	0.6	}	Ì	1	
		1992	3	0.3	0.3	0.3		ĺ		-
		1992	2	0.3	0.3	0.3	1	1	ı	}

				ROCKY F	LATS GRO	UNDWAT	ER SAMPI	LING HNu	READING	GS	
							Survey Res	ults			
	Vell		.			At Opening			After Ven		_
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
			1992	1	0.4	0.3	0.2	1			
		1	1991	4	0.4	0.4					
Pan	9289	CANDIE	1991	3	0.2	0.2	1				
F20	77487	SAMPLE	1994	2	0	0	0			İ	
			1994	1	0		0				
		1	1993 1993	4	0.3	0.3	0.3				
			1993	3	0.1	0.1	0.1		_		
		1	1993	1	0.6	1	200	0.4	0.4	0.4	1
Ì			1992	3	0.3 0.3	0.3 0.3	0.3		ŀ		
			1992	2	0.3	0.3	0.3 0.3		l		
P20	9389	SAMPLE	1994	2	0.3	0.3	0.3				
		0.2	1994	1	o	0	0				
			1993	4	0.5	0.5	0.5		٦		
			1993	3	0.3	0.3	0.3				
			1993	2	0.4	0.4	0.4				·
		}	1992	3	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3			İ	
			1992	1	0.2	0.2	0.2			ļ .	
P209	9489	SAMPLE	1994	2	0	0.2	0.2	İ	,	,	
			1994	1	o	o	o		•		
		1	1993	4	0.6	0.6	0.6	· .			
i			1993	3	0.3	0.3	0.3				
			1993	2	0.3	0.3	0.3				,
<u> </u>			1993	1	0.5	0.5	0.5	İ	•	İ	
			1992	3	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3	i			
P209	589	SAMPLE	1994	2	o	0	0				
		ĺ	1994	1	0.2	0.2	0.2				·
			1993	3	0.3	0.3	0.3	1			ĺ
			1993	2	0.2	0.2	0.2	1			
		1	1992	3	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3				
			1992	1	0.3	0.3	0.3				
]	1991	4	0.4	0.4	0.8	0.2	0.2	0.2	
P209	689	SAMPLE	1994	2	0	0	o	l			
			1994	1	6.5	6.5	6.5				
			1993	3	0.3	0.3	0.3	i		1	
			1993	2	0.4	0.4	0.4				
		!	1993	1	1	1	1				
			1992	3	0.3	0.3	0.3		}		
			1992	2	0.3	0.3	0.3				
			1992	1	0.6	0.6	0.6	-	ľ	Ī	
P2097	789	SAMPLE	1994	2	0	0	0	ĺ			
			1994	1	0	0	0	İ	ŀ		
1			1993	4	0.6	0.6	0.6		ł	1	
			1993	3	0.2	0.2	0.2			ł	·
			1993	2	0.4	0.4	2		ļ	ļ	No venting data
-			1992	3	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3	-	1		
		g	1992	1	0.1	0.1	0.1	[
P2098	889	SAMPLE	1994	2	0	0	0				
1			1994	1	0	0	0		1		
			1993	4	0.5	0.5	0.5			1	
			1993	3	0.3	0.3	0.3				

	 	I	OCKY FL	ATS GRO	UNDWAT			READING	s	·
	1		ļ			Survey Rest				-
Well		1	}		At Opening			After Vent		٠
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
	-	1993	2	0.2	0.2	0.2		ļ		
	1	1992	3	0.3	0.3	0.3		1		1
		1992	2	0.2	0.2	0.2		l		
	1	1992	1	0	0	0		ļ		
P209989	WLM	1994	2	0	0	0				
1	Į.	1993	2	0.6	0.6	0.6		}]	
		1992	3	0.3	0.3	0.3		}		
		1992	2	0.4	0.4	0.3			l	
		1992 1991	1	0.2 0.3	0.2	0.2		[1
			3	- 1		1		[·
P210089	SAMPLE	1991 1994	2	0.2	0.2	0.2				İ
P210089	SAMPLE	1994	1	6.4	6.4	1		}		
	1	1993	4	0.2	0.4	6.4				
		1993	3	0.2	0.2	0.2				
		1993	2	0.2	0.2	0.2	ļ			
	}	1992	3	0.3	0.3	0.3				
		1992	2	0.4	0.4	0.3			İ	
	1	1992	1	0.4	0.4	0.1]	
P210189	SAMPLE	1994	2	0	0.2	0.1				
121010	SAMI EE	1994	1	0.04	0.04	0.04			}	
	1.	1993	4	0.5	0.5	0.04				
		1993	3	0.3	0.3	0.04			(,
1	1	1993	2	0.6	0.6	4	0.5	0.5	1	·
		1993	1	0.4	0.4	1	0.5	0.5	1	
		1992	3	0.3	0.3	0.3	ì			
1		1992	2	0.3	0.3	0.5				No venting data
B210389	WLM	1994	2	0	0	0}	})
		1993	2	0.6	0.6	0.6				·
		1992	3	0.1	0.1	0.1				
1		1992	2	0.4	0.4	0.4				
		1992	ı	0.3	0.2	0	1	i		
	, ,	1991	4	0.2	0.2	0.2	ļ			
		1991	3	0.2	0.2	0.2				
		1991	2	0.4	0.4	0.4	ł			
B210489	SAMPLE	1994	2	o	o	o	į			
		1994	1	4.5	4.5	4.5	l			·
)	1993	4	0.1	0.1	0.1	ĺ			
]	1993	3	0.2	0.2	0.2		•		
		1993	2	1	1	1	Ì		٠.	
\	1	1993	1	0.5	0.5	0.5	1			
		1992	3	0.2	0.2	0.2	}		}	
·		1992	2	0.4	0.4	0.3	[ł	
1]]	1992	1	0.2	0.2	0.2	- [
B410589	SAMPLE	1994	2	0	o	o	ļ			
į	.	1992	3	0.4	0.4	0.4	1			
	4	1992	2	0.7	0.7	1	0.3	0.3	0.3	
	1	1992	1	0.3	0.3	0.3				
	1	1991	4	0.2	0.2	0.2	Ì	Ì	}	
]]	1991	3	0.2	0.2	0.2			j	
!	[[1991	2	0.4	0.4	0.4	.	[Į.	
	}	1991	1	0.2	0.2	0.2	}	j	İ	
B410689	SAMPLE	1994	2	0	0	0	1		1	
		1992	3	0.4	0.4	0.4	1	}	}	
		1992	2	0.8	0.8	0.7			1	

1				ROCKY F	LATS GRO	UNDWAT	ER SAMPL	ING HNu	READIN	GS	
ı							Survey Rest				
	Well					At Opening	\rightarrow		After Ven	ting]
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
	-		1992	1	1	0.3	0.3				
		٦	1991	4		0.3	0.3			[
j			1991	3	0.2	0.2	0.3	0.2	0.5	0.2	. [
			1991	2	0.3	0.4	0.4	0.4	1	L .	
1		ŀ	1991	1	0	0	0		1		
.	B410789	SAMPLE	1994	2	0	o	o		1		
			1992	3	0.3	0.3	0.3		i		
		1	1992	2	0.8	0.8	0.5				
			1992	1	0.2	0.2	0.2				
			1991	4	0.3	0.3	0.3				
			1991	3	0.2	0.2	0.2				
ı		1	1991	2	0.4	0.3	0.3				
			1991	1	0.4	0.4	0.4				
	B110889	SAMPLE	1994	2	o	0	o				· •
			1994	1	5	5	5				
1		j	1993	3	0.2	0.2	0.2		'	1 1	
		Ì	1993	2	0.2	0.2	0.2				ĺ
			1993	1	0.5	0.5	0.5				
		1	1992	3	0.4	0.4	0.4				
			1992	2	0.8	0.8	0.5				
			1992	1	0.3	0.3	0.3				
	B110989	SAMPLE	1994	2	0	0	0.5				
ļ			1994	1	3.8	3.8	3.8				
			1993	4	0.4	0.4	0.4				
Τ			1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2	1			
T	•		1993	1	0.5	0.5	0.5	İ		İ	
		ĺ	1992	3	0.8	0.8	0.8	1			
			1992	2	0.7	0.7					
	B111189	SAMPLE	1994	2	0.7	0.7	0.4	İ			
İ			1994	1	4.8	4.8	0 4.8				}
			1993	3	0.1	0.1	,	İ		1	
			1993	2	0.2	1	0.1			İ	
		1	1993	1	0.4	0.2	0.2				
			1992	- 1		0.4	0.4	1	Ì	1	
		İ	1992	3	0.4	0.4	0.4	-			
			1992	2	0.6	0.6	0.4		l		
	B411289	SAMPLE	1992	1	0.2	0.2	0.2				
	2111207	SAMILE	1994	2	0	0	0	1			
				3	0.5	0.5	0.5	- 1		- 1	
		1	1992 1992	2	0.8	0.8	0.8	ł			
			i 1	1	0.3	0.3	0.3	1	-		
			1991	4	0.2	0.2	0.2		İ		
			1991	3	0.1	0.1	0.1				
			1991	2	0.3	0.3	0.3		}	}	
	B411389	SALADI D	1992	1	0.3	0.3	0.2				
	LT11307	SAMPLE	1994	2	0	0	0			Ì	
			1994	1	1.9	1.9	1.9				
			1993	4	0	0	0				
			1993	3	0.2	0.2	0.2				ĺ
			1993	4	0.4	0.4	0.4		ĺ		ł
	•		1992	3	0.3	0.3	0.3		1		
			1992	2	0.8	0.8	0.4	j		1	İ
			1992	1	0.2	0.2	0.2				
	P313489	SAMPLE	1994	2	. 0	o	o		İ		1
			1994	1	1.6	1.6	1.6				

				ROCKY m	LATEGE	IABL	L E-2						
				NOCK I F	LAIS GRO	DUNDWA'	ER SAMPL	ING HNu	READING:	<u>s</u>	_		
	Well	1				At Openin	Survey Rest	ılts			·		l
	<u>ID</u>	Statu		Qtr	BG	BZ	WH	BG	After Ventin				4
•	P31358	9 SAMPL	E 1994 1994 1993	2 1 4	0 1.6 14			ВО	BZ	WH	COMMENTS		
	P213689	SAMPLE	1994 1994 1993	2 1 4	0 2.5 0	0 2.5 0	0 2.5						
	B213789	SAMPLE	1992 1992 1994 1994 1993	3 2 2 1 4	0.4 0.3 0 5.5	0.4 0.3 0 5.6 0.4	0 0.4 0.3 0 5.8			no	venting info		
	P213889	WLM	1992 1992 1994 1994 1992	3 2 2 1 3	0 0.4 0 0.8 0.4	0 0.4 0 0.8	0.4 0 0.4 0						
	P213989	WLM	1992 1994 1994	2 2 1	5	0.4 5 0	0.4 5 0						
	P314089	SAMPLE	1994	2	0.8	0.8	0.8					'	
	P414189	SAMPLE	1994 1993 1992 1994 1994	1 4 3 2 1 4	1.6 0.9 0.4 0 3.2 0.4	0.9 0.4 0 3.2 0.4	0 1.6 0.9 0.4 0 3.2						
	P314289	SAMPLE	1992 1992 1994 1994 1993		0.3 0.3 0 3.2	0.3 0.3 0 3.2	0.4 0.3 0.3 0 3.2						
	P114389	SAMPLE	1992 1992 1994 1993	3 2 2 4	0.2		0.6 0.2 0.3 0 0.2						
	P114489	SAMPLE	1992 1992 1994 1994 1993	3 2 2 1	0.4 0.4 0	0.4 0.4 0 1	1.5 0.4 0.4 0 1						
I	P114589	SAMPLE	1992 1992 1994	3 0.	.5).5	0.5						-

				ROCKY FI	ATS GRO		ER SAMPL Survey Resi		READING	<u>s</u>	
_	Well					At Opening		416	After Venti	ng	-
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
			1994	1	0.8	0.8	0.8				
		1	1993	4	0.2	0.2	0.2				
			1992	3	0.2	0.2	0.2				· ·
			1992	2	0.3	0.3	0.3		1	·	
	P114689	SAMPLE	1994	2	0	0	0				
ĺ			1994	1	2	2	2				
			1993	4	0.9	0.9	0.9				
-			1993	2	0.6	0.6	0.6				
			1992	3	0.4	0.4	0.4				
	P114789	SAMPLE	1992	2	0.5	0.5	0.5				
	1114/05	SAMPLE	1994	2	0	0	0				
			1994 1993	1	0.35	0.35	0.35				
ı			1993	4	0.6	0.6	0.6				
-		-	1992	3 2	0.4	0.4	0.4				
	P114889	SAMPLE	1994	2	0.4	0.4	0.4				}
ı		J. 2011 22	1994	1	1.6	0	0			,	
			1993	4	0.6	1.6 0.6	1.6 0.6				·
			1992	3	0.3	0.3	0.8				
ı			1992	2	0.4	0.4	0.3				
	P114989	SAMPLE	1994	2	0	0.4	0.4				
			1994	1	1.8	1.8	1.8		İ		
			1993	4	0.2	0.2	0.2	ĺ			
			1992	3	0.3	0.3	0.3				
			1992	2	0.3	0.3	0.3				
	P115089	SAMPLE	1994	2	o	0	0	ĺ		- 1	
T			1994	1	1.9	1.9	1.9			1	
			1993	4	0.2	0.2	0.2	l			
		İ	1992	-3	0.4	0.4	0.4			ĺ	1
-			1992	2	0.3	0.3	0.3		- 1		
	B315289	WLM	1994	2	0	o	0.1				No venting data
	P115489	SAMPLE	1994	2	0	o	Ó	1			
			1994	1	2.5	2.5	2.5				
			1993	4	2.3	2.3	2.3	1			
			1992	3	0.3	0.3	0.3		İ		i
	D115500		1992	2	0.4	0.4	0.4				
	P115589	SAMPLE	1994	2	0	0	2.1	0	0	0	
			1994	1	3	3	3				
]]	1993	4	0.8	0.8	0.8		.		
		1	1992	3	0.3	0.3	0.3	Ì			
	P115689	SAMPLE	1992 1994	2	0.4	0.4	0.5	[İ	1	No venting data
		JAMI EE	1994	2	0	0	0	_			
1			1993	1	2	2	4.9	0.7	0.7	0.7	
		1	1992	3	0.6	0.6	0.6	1			
			1992	2	0.4	0.4	0.4				
	P215789	SAMPLE	1994	2	- 1	0.5	0.5				
			1994	1	0 1.4	0	0				
			1993	4	0.9	0.9	1.4				
			1992	3	0.4	0.9	0.9	1			
			1992	2	0.4	0.4	0.4			-	
	P415889	SAMPLE	1994	2	0.5	0.5	0.5	1			
			1994	1	1	1	,	İ			,
			1993	4	0.2	0.2	0.2				!
L			1992	3	0.2	0.2		ļ			
_			2776		0.3	0.3	0.3				

Well Bules Year Qer Bo				ROCKY F	LATS GRO	UNDWAT	ER SAMPL	ING HI	Nu READ	INGS			
D	Well				ļ		Survey Resu	ilts					
P415989 SAMPLE 1994 2 0 0 0 0 0 1 1994 1 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3	'	Status	Vest	Ota	P.C.								
P415989 SAMPLE 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	1							BG	B2	. w	H	COMMENTS	
P416089 SAMPLE 1994 1 1.7 1.7 1.7 1.7 1.7 1.7 1.7 1.7 1.7 1	P415989	SAMPLE				, ,	1						1
1993	İ		1994			, ,	F						ł
P416089 SAMPLE 1994 2 0 0 0 0 0 1 1 1 2 2 2 0 4 0 4 0 4 0 4 1 1 2 2 5 2 5 1 1 1 1 1 1 1 1 1 1 1 1 1			1993	4			1						
P416089 SAMPLE 1994 2 0 0 0 0 0 0 1 1994 1 1 0.2 0.2 0.2 0.2 1992 3 0.3 0.3 0.3 0.3 1992 1 1 0.2 0.2 0.2 0.2 1992 1 0 0 0 0 0 0 1 1994 1 1 0.3 0.3 0.3 0.3 10.3 10.3 10.3 10.3			1992	3	0.2								
P416189 SAMPLE 1994 2 0 0 0 1994 1 0.32 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2	Parcoss		1 1	2	0.4	0.4			1				1
1993	P416089	SAMPLE	1 1	2			0		-				
P416189 SAMPLE 1994 2 0 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0									1				ļ
P416189 SAMPLE 1994 2 0 0 0 0 0 0 1994 1 1 0.8 0.8 0.8 0.8 1992 2 0.4 0.4 0.4 0.4 0.4 0.4 1992 2 0 0 0 0 0 0 1994 1 0.8 0.8 0.8 1992 2 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4				1						- 1			
P416189 SAMPLE 1994 2 0 0 0 0 0 1994 1 0 3.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0	1												
1994	P416189	SAMPLE		1									-
P416289 SAMPLE 1994 2 0 0 0 0 0 1994 1 0 0 0 0 0 1993 4 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 0 1993 4 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1993 4 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0			1994	1		- 1							
P416289 SAMPLE 1994 2 0 0 0 0 0 0 0 1994 1 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 0 0 1994 1 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0			1993	4									·
P416289 SAMPLE 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0			1992	3	,	,	. 1			-			
P416389 SAMPLE 1994 2 0 0 0 0 0 0 1994 1 0.8 0.8 0.8 0.8 0.8 0.8 1992 3 0.2 0.2 0.2 0.2 1992 1 0 0 0 0 0 1993 4 0.2 0.2 0.2 0.2 1993 3 0.2 0.2 0.2 0.2 1993 1 0.2 0.2 0.2 1993 1 0.2 0.2 0.2 1993 1 0.2 0.2 0.2 1993 1 0.2 0.2 0.2 1993 1 0.2 0.2 0.2 1993 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.2 0.2 0.2 1993 1 0.2 0.2 0.2 1993 1 0.2 0.2 0.2 1993 1 0.3 0.3 0.3 0.3 1994 1 0.2 0.2 0.2 0.2 1993 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3	Parcen				0.4					1			
P416389 SAMPLE 1994 2 0 0 0 0 1993 3 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2	P416289	SAMPLE		1	0	o	o						1
P416389 SAMPLE 1994 2 0 0 0 0 0 0 1994 1 0.8 0.8 1993 3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1994 1 0.8 0.8 0.8 1993 4 0.2 0.2 0.2 1992 2 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 1 0.2 0.2 1994 1 0.26 0.26 0.26 1993 4 0.2 0.2 0.2 1993 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1993 1 1 0.3 0.3 0.3 1993 1 1 0.3 0.3 0.3 0.3 1993 1 1 0.3 0.3 0.3 0.3 1993 1 1 1 0.3 0.3 0.3 0.3 0.3 1993 1 1 1 0.3 0.3 0.3 0.3 0.3 1993 1 1 1 0.3 0.3 0.3 0.3 0.3 1993 1 1 1 0.3 0.3 0.3 0.3 0.3 0.3 1993 1 1 1 0.3 0.3 0.3 0.3 0.3 0.3 1993 1 1 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1993 1 1 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3				- 1	ı		0.8						1
P416389 SAMPLE 1994 2 0.4 0.4 0.4 0.4 0.4 0.4 1994 1 0.0 0 0 0 0 1993 4 0.2 0.2 0.2 0.2 1993 3 0.2 0.2 0.2 0.2 1992 2 0.3 0.3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 1 1 0.32 0.32 0.32 1993 1 1 0.32 0.32 0.32 1993 1 1 0.32 0.32 0.32 1993 1 1 0.32 0.33 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 0.3 0.		1	1 1	- 1	1				1				İ
P416389 SAMPLE 1994 2 0 0 0 0 0 1994 1 0 0 0 0 0 1993 4 0.2 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 1 0.8 0.8 0.8 0.8 1993 3 0.3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 1 0.5 0.5 0.5 0.5 0.5 0.5 0.5 0.5 0.5 0.5		İ		1	- 1				}				
P416489 SAMPLE 1994 1 0 0 0 0 0 0 1993 4 0.2 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 1994 1 0.8 0.8 0.8 0.8 1993 3 0.2 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 1994 1 0.26 0.26 0.26 1993 4 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 1993 3 0.3 0.3 0.3 0.3 0.3 1992 1993 3 0.3 0.3 0.3 0.3 1992 1993 4 0.2 0.2 0.2 0.2 1993 1993 1 0.2 0.2 0.2 0.2 1993 1993 1 0.2 0.2 0.2 0.2 1993 1993 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 1 0.32 0.32 0.32 1993 1 1 0.32 0.32 0.32 1993 1 1 0.32 0.32 0.32 1993 1 1 0.32 0.3 0.3 0.3 1992 1 1 0.32 0.3 0.3 0.3 1992 1 1 0.3 0.3 0.3 0.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 1992 1 1 0.3 0.3 0.3 0.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 1992 1 1 0.3 0.3 0.3 0.3 10.3 10.3 11992 1 1 0.3 0.3 0.3 0.3 10.3 11992 1 1 0.3 0.3 0.3 0.3 10.3 11992 1 1 0.3 0.3 0.3 10.3 10.3 10.3 11992 1 1 0.3 0.3 10.3 10.3 10.3 10.3 10.3 10	P416389	SAMPLE		- 1	- 1		,						
P416489 SAMPLE 1994 2 0 0 0 0 1994 1 0.26 0.26 0.26 0.26 0.26 0.26 0.26 0.26				1		- 1							
P416489 SAMPLE 1994 2 0 0 0 0 0 1993 3 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2			1993	4									
P416489 SAMPLE 1994 2 0 0 0 0 0 0 1994 1 0.8 0.8 0.8 0.8 1993 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 0.2 1992 4 0.6 0.26 0.26 1994 1 0.26 0.26 0.26 1993 3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 1 0.32 0.32 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 1 0.33 0.3 0.3 0.3 1992 1 0.32 0.32 0.32 1993 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 10.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 10.3 1992 1 0.3 0.3 0.3 10.3 1992 1 0.3 0.3 0.3 10.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 10.3 10.3 10.3 10.3 1	1		1993	3									
P416489 SAMPLE 1994 2 0 0 0 0 0 0 1994 1 0.8 0.8 0.8 0.8 1993 4 0.2 0.2 0.2 0.2 1992 3 0.3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1994 1 0.32 0.32 0.32 1993 4 0.2 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 0.2 1993 1993 4 0.2 0.2 0.2 0.2 0.2 1993 1993 4 0.3 0.3 0.3 0.3 1992 1993 4 0.3 0.3 0.3 0.3 0.3 1992 1994 1 0.32 0.32 0.32 1993 1993 4 0.6 0.6 0.6 1993 1993 1993 1993 1993 1993 1993 199		1	1 1	3	0.2	0.2							
P41689 SAMPLE 1994 1 0.32 0.2 0.2 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 0.2 0.2 1994 1 0.32 0.3 0.3 0.3 0.3 1992 1993 4 0.2 0.2 0.2 0.2 0.2 1994 1 0.32 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 0.3 1992 1994 1 0.32 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 0.3 1992 1993 4 0.2 0.2 0.2 0.2 1993 1 0.3 0.3 0.3 0.3 0.3 1992 1993 1 0.3 0.3 0.3 0.3 0.3 1992 1993 1 0.3 0.3 0.3 0.3 1992 1993 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3	P416480	SALORE	1 1	ı	1	0.3	0.3						
P416589 SAMPLE 1994 2 0 0 0 0 0 1993 4 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2	1410489	SAMPLE	1					1					1
P416389 SAMPLE 1994 2 0 0 0 0 0 1994 1 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 0.3 0.3 1992 1993 4 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1994 1 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 1993 3 0.3 0.3 0.3 0.3 1992 1993 4 0.2 0.2 0.2 1993 1993 1992 2 0.3 0.3 0.3 0.3 1992 1993 1993 1993 1993 1993 1993 199			1 1	1				- 1					
P416589 SAMPLE 1992 3 0.2 0.2 0.2 0.2 1992 2 0.3 0.3 0.3 0.3 0.3 1994 1 0.26 0.26 0.26 1993 3 0.3 0.3 0.3 1992 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 1 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 1994 1 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 1 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 1 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 1 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 1992 1 0.32 0.32 1993 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 10.3 10.3 10.3 10.3 10.3		1	1	3			1	ĺ					i
P41689 SAMPLE 1994 2 0 0 0 0 0 1994 1 0.26 0.26 0.26 0.26 1993 4 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 4 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 4 0.2 0.2 0.2 1993 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 10.3 10.3 10.3 10.3 10.3			i I	-	1		I						İ
P416889 SAMPLE 1994 2 0 0 0 0 0 0 1994 1 0.26 0.26 0.26 0.26 1993 4 0.2 0.2 0.2 1993 3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1992 1 0.32 0.32 1993 3 0.3 0.3 0.3 1999 1 0.32 0.32 0.32 1993 1 0.3 0.3 0.3 1999 1 0.32 0.32 0.32 1993 1 0.3 0.3 0.3 1999 1 0.32 0.32 0.32 1993 1 0.3 0.3 0.3 1999 1 0.32 0.32 0.32 1993 1 0.3 0.3 0.3 1999 1 0.32 0.32 0.32 1993 1 0.3 0.3 0.3 0.3 1999 1 0.32 0.32 0.32 1993 1 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 0.3 0.3 0.3 1999 1 0.33 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.		1	1 1	2	ı	1	I						
P41689 SAMPLE 1994 1 0.26 0.26 0.26 0.26 1993 4 0.2 0.2 0.2 1992 2 0.3 0.3 0.3 1992 1 0.3 0.3 1992 1 0.3 0.3 1992 1 0.3 0.3 1992 1 0.3 0.3 1992 1 0.3 0.3 1992 1 0.3 0.3 1992 1 0.3 0.3 1992 1 0.3 0.3 1992 1 0.3 1994 1 0.3 1994 1 0.3 1994 1 0.3 1994 1 0.3 1994 1 0.3 1994 1 0.3 1994 1 0.3 1994 1 0.3 1994 1 0.3 1994 1 1 0.3 1 0.3 10.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 1999 1 1 0.3 10. 1 0. 1 0. 1 0. 1 0. 1 0. 1	P416589	SAMPLE	1994	2	1	- 1	- 1	- 1		1			
P41689 SAMPLE 1994 1 0.32 0.32 0.32 0.3 0.3 1992 1 0.32 0.3 0.3 1994 1 0.32 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 1994 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 1999 1 1 0.3 0.3 0.3 0.3 0.3 10.3 10.3 10.3				1	0.26	0.26	ŀ	.					
P41689 SAMPLE 1992 3 0.2 0.2 0.2 1992 1 0.3 0.3 0.3 0.3 1992 1 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 1 0.32 0.32 0.32 1994 1 0.32 0.32 0.32 1994 1 0.32 0.32 0.32 1994 1 0.32 0.32 0.32 1995 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 1992 1 0.3 0.3 0.3 0.3 10.3 10.3 10.3 10.3 1				1		0.2							
P41689 SAMPLE 1994 2 0 0 0 0 0 0 1 1 1 0.32 0.32 0.32 1 1 1 0.32 0.32 0.32 1 1 1 0.32 0.33 0.3 0.3 1 1 1 0.32 0.32 0.32 1 1 1 1 0.32 0.33 0.3 0.3 0.3 1 1 1 1 0.32 0.32 0.32 1 1 1 0.32 0.32 0.32 1 1 1 0.32 0.32 0.32 1 1 1 0.33 0.3 0.3 0.3 0.3 0.3 1 1 1 0.32 0.32 0.32 1 1 1 0.33 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.							0.3						
P41689 SAMPLE 1994 2 0 0 0 0 0 1994 1 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1994 1 0.32 0.32 0.32 1993 4 0.6 0.6 0.6 1993 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1993 3 0.3 0.3 0.3 1993 4 0.6 0.6 0.6 0.6 1993 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 1992 1992 2 0.3 0.3 0.3 1992 1992 1 0.3 0.3 0.3 0.3 1992 1992 1 0.3 0.3 0.3 0.3 1992 1994 1 0.33 0.3 0.3 0.3 1994 1 0.33 0.33 0.35 0.35 0.35 0.35 0.35 0.38 0.35 0.35 0.35 0.35 0.35 0.35 0.35 0.35		1 1			,			- 1					
P416889 SAMPLE 1994 1 0.32 0.32 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 0.3 1994 1 0.32 0.32 0.32 0.32 1992 2 0.3 0.3 0.3 0.3 1994 1 0.32 0.32 0.32 1994 1 0.32 0.32 0.32 1994 1 0.32 0.32 0.32 1994 1 0.33 0.3 0.3 1992 3 0.3 0.3 0.3 1992 3 0.3 0.3 1992 3 0.3 0.3 1992 3 0.3 0.3 1992 1993 3 0.3 0.3 1992 1994 1 0.33 0.3 0.3 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994 1 0.33 1994	P416689	SAMPLE		,	- 1		- 1	1					İ
P416789 SAMPLE 1994 1 0.32 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3 0.3				l l	ľ			1				-	į
P416789 SAMPLE 1994 1 0.32 0.3 0.3 0.3 1992 1993 3 0.3 0.3 0.3 0.3 1992 1993 3 0.3 0.3 0.3 0.3 1993 1992 1993 3 0.3 0.3 0.3 0.3 1992 1992 1992 1992 1992 1992 1992 199			l l	- 1		1							
P416789 SAMPLE 1994 2 0 0 0 0 1993 3 0.3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 1992 2 0.3 0.3 1992 2 0.3 0.3 1992 2 0.3 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0.3 1992 2 0		1 1	I .										
P416789 SAMPLE 1994 2 0 0 0 0 0 0 1994 1 0.32 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1994 1 0.33 0.33 0.35 0.35 2.8 2.8 2.8			1992			- 1							
P416789 SAMPLE 1994 2 0 0 0 0 0 1994 1 0.32 0.32 0.32 1993 3 0.3 0.3 0.3 0.3 1992 3 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1992 2 0.3 0.3 0.3 0.3 1994 1 0.33 0.33 0.35 2.8 2.8 2.8			1	2	0.3	- 1							
P416889 SAMPLE 1994 1 0.33 0.33 0.35 0.35 2.8 2.8 2.8	P416789	SAMPLE		2	0	1							
P416889 SAMPLE 1994 2 0 0 0 0 1994 1 0.33 0.33 0.35 2.8 2.8 2.8				- 1	1 '	0.32	0.32						
P416889 SAMPLE 1992 2 0.3 0.3 0.3 0.3 P416889 SAMPLE 1994 2 0 0 0 0 1994 1 0.33 0.33 0.35 2.8 2.8 2.8			ľ			1							
P416889 SAMPLE 1992 2 0.3 0.3 0.3 0.3 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1					I								
P416889 SAMPLE 1994 2 0 0 0 0 1 1994 1 0.33 0.33 0.35 2.8 2.8 2.8		İ	i			1		ĺ					
1994 1 0.33 0.33 0.35 2.8 2.8 2.8	P416889	SAMPLE	1	4	- 1	- 1	- 1						
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			- 1										
1993 4 0.6 0.6 0.6			1	- 1			- 1	2.8	2.8	2:8			
1992 3 0.3 0.3 0.3			i	- 1	- 1	- 1	- 1			ļ			

TABLE E-2

ROCKY FLATS GROUNDWATER SAMPLING HOW BE ADDICE

			ROCKY FI	LATS GRO	UNDWAT	ER SAMPL	ING HNu	READING	s	
						Survey Resu	ılts			
Well					At Opening			After Venti	ng	
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
		1992	2	0.4	0.4	0.4				
P416989	SAMPLE	1994	2	0	0	0			1	
		1994	1	0.2	0.2	0.2				
		1993	4	0.2	0.2	0.2				İ
B317189	WLM	1994	2	0	o	o				
		1994	1	6.1	6.1	6.1				
İ		1992	3	0.1	0.1	0.1				
		1992	2	0.4	0.4	0.4				
		1992	1	0	o	o				
B217289	SAMPLE	1994	2	0	0	0				
		1994	1	0.2	0.2	0.2				
Ì		1993	4	3	3	3				
		1993	3	0.4	0.4	0.4				
		1992	3	0.2	0.2	0.2				
		1992	2	0.8	0.8	0.8				·
		1992	1	0.4	0.4	0.4			. [
B217489	WLM	1994	2	0	0	0				·
Í		1994	1	8.2	8.2	8.2				
	1	1993	2	0.1	0.1	0.1				
		1993	1	0.5	0.5					
B217589	WLM	1994	2	0.5	I	0.5			1	1
	"-	1993	3	1	0	0				
B217689	WLM	1994	2	0.1	0.1	0.1				
		1993	2	0	0	0				
		1993		0.1	0.1	0.1	Ì	i		
B217789	WLM	1994	1	0.4	0.4	0.4		1		
2217705	W 2.01	1994	2	0	0	0	1			
	1	1 1	1	2	2	2	İ			
P317989	WLM	1993	1	0.4	0.4	0.4				
1317763	WLM	1994	2	0	0	0				
		1992	3	0.4	0.4	0.4			1	
	1	1992	2	0.2	0.2	0.2		1		İ
		1992	1	0.2	0.2	0.2			1	
	1	1991	4	0.2	0.2	0.2	.			
		1991	3	0.2	0.2	0.2			1	
		1991	2	0.6	0.6	0.6	l	.		
P218089		1991	1	0.4	0.3	0.3	1	1		
P218089	WLM	1994	2	0	0	0	1			
		1994	1	0	0	0	1			
		1993	3	0.6	0.6	0.6		·		
		1993	1	0.3	0.3	0.3		1	. 1	İ
	i	1992	3	0.3	0.3	0.3	1			
		1992	2	0.3	0.3	0.3	1		1	
		1992	1	0.3	0.2	0.2	1			İ
		1991	4	0.2	0.2	0.2	-			
P218289	SAMPLE	1994	2	0	0	o		İ		
ĺ	[1994	1	3.5	3.5	3.5	i			
		1993	4	0.2	0.2	0.2				
P218389	SAMPLE	1994	2	o	o	0	1.			
		1994	1	0	o	0			1	
		1993	4	0.4	0.4	0.4	1		[
		1992	3	0.3	0.3	0.3			ĺ	
		1992	2	0.3	0.3	0.3				
B218789	WLM	1994	2	0	0	0.5				
		1992	3	0.1	0.1	0.1		1		
		1992	2	0.1			1	ļ		
	<u>_</u>	1772	4	0.3	0.3	0.3				

		- 1	ROCKY FI	LATS GRO	UNDWAT	ER SAMPL Survey Resi		READING	<u>s</u>	
		1								
Well		1			At Opening			After Venti		
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
		1992	1	0.3	0.3	0.3				
	1	1991	4	0.2	0.2	0.2				
		1991	3	0.1	0.1	0.1				
Da. 10.100		1991	2	0.4	0.4	2.2	0.4	0.4	0.6	
P219189	SAMPLE	1994	2	0	0	0				
		1994	1	4.3	4.3	4.3				
		1993	4	0.2	0.2	0.2				
		1993	2	0.6	0.6	0.6				
		1992	3	0.4	0.4	0.4				-
D110200	G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1. G. 1.	1992	2	0.3	0.3	0.3	1			
P119389	SAMPLE	1994	2	0	0	0				
		1992	3	0.4	0.4	0.4				
PA10100		1992	2	0.3	0.3	0.3				
P219489	SAMPLE	1994	2	0	0	0	1			
	i	1994	1	0	0	0				
	}	1993	4	0.2	0.2	0.2	1	1		
		1992	3	0.3	0.3	0.3		l	- 1	
		1992	2	0.3	0.3	0.3	İ			
P219589	SAMPLE	1994	2	0	0	0	[į	1	
		1994	1	0	0	0		-		
		1993	4	0.4	0.4	0.4			ľ	
	ļ	1992	3	0.3	0.3	0.3	.	1	ļ	
		1992	2	0.3	0.3	0.3				,
P419689	SAMPLE	1994	2	0	0	0	i			
	1	1994	1	4.4	4.4	4.4				
		1993	4	0.1	0.1	0.1			1	
	}	1992	3	0.3	0.3	0.3	į		1	
		1992	2	0.3	0.3	0.3	l		į	
P320089	SAMPLE	1994	2	0	0	0	1	-	1	
		1994	1	1	1	1	1			
		1993	4	0.4	0.4	0.4	ŀ	l		
		1993	3	0.1	0.1	0.1	ł	ľ		
		1993	2	0.2	0.2	0.2				
B220189	WLM	1994	2	0	0	0	1			
B220489	WLM	1994	2	0	0	0			İ	
0190	SAMPLE	1994	2	0	. 0	0				
		1994	1	6	6	6	1			
]	1993	4	0.2	0.2	0.2				
l	1 1	1993	3	0.1	0.1	0.1				
		1993	1	0.3	0.3	0.3				
0290	SAMPLE	1994	2	0	0	0]	1	Ì	
		1994	1	6	6	6				_
		1993	4	1	1	1			1	`
	'	1993	1	0.3	0.3	0.3	1		, [
ļ		1993	2	- 0.4	0.4	0.4	[
		1992	3	0.4	0.4	0.4		-		
		1992	2	5	3.8	3.8		j		
0390	SAMPLE	1994	. 2	o	o	o				
		1994	1	2	2	2				
		1993	4	0.2	0.2	0.2				
į		1993	3	0.2	0.2	0.2				
		1			1			1		
		1993	21	0.41	0.41	0.41		ı		
Ī		1993 1993	2	0.4	0.4	0.4			1	
		1993 1993 1992	1 3	0.4	0.4	0.4				

_				ROCKY FL	ATS GRO	UNDWATE	R SAMPL	ING HNu	READIN	GS	
				1			Survey Resi				
	Well			1		At Opening			After Ve	nting	·
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
	0590	WLM	1994	2	0	0	0				
			1993	2	0.3	0.3	0.3				
			1992 1992	3	0.3	0.3	0.3				
	0690	WLM	1994	2	5.2	5.2	5.8				
	-		1993	2	0.3	0.3	0.3		-		
	-		1992	2	0.4	0.4	0.4]		
	0790	WLM	1994	2	0	0.4	0.4				
			1993	2	0.3	0.3	0.3				
	0990	WLM	1994	2	0	. 0	0				
- 1			1993	2	0.3	0.3	0.3				
			1992	2	0.4	0.4	0.4				
	1490	SAMPLE	1994	2	0	0	o				
			1994	1	0.02	0.02	0.02				į
		1	1993	4	1	1	1			1	
			1993	3	0.2	0.2	0.2				·
		1	1993	2	0.1	0.1	0.1			1	
	00191	CALCOLE	1993	1	0.3	0.3	0.3				
	00191	SAMPLE	1994	2	0	0	0				·
			1994	1	1.2	1.2	1.2				
			1993	4	0.2	0.2	0.2				
			1993 1993	3 2	0	0.02	0.02	-			No venting data
			1993	1	0.4	0.4	0.4				,
		İ	1992	3	0.5	0.5	1			l	
	}		1992	2	0.4	0.3	0.3	l			
7	00291	SAMPLE	1994	2	0	0	0.4				1
			1994	1	0.2	0.2	0.2				
			1993	4	0.2	0.2	0.2				
			1993	3	0.3	0.3	0.3				
			1993	2	0.3	0.3	0.3			1	!
			1993	1	0.2	0.2	0.2				İ
			1992	3	0.4	0.4	0.4				
1.			1992	2	0.4	0.4	0.4				
	00391	SAMPLE	1994	2	0	0	0			İ	1
		1	1994	1	0.2	0.2	0.2				
			1993	3	0.1	0.1	0.1				
		ĺ	1993	2	0.2	0.2	0.2				
			1993 1993	1	0.4	0.4	1			1	No venting data
			1993	3	0.2	0.2	0.2				
			1992	2	0.3	0.3	0.3	1			İ
	00491	SAMPLE	1994	2	0.2	0.2	0.4			1	No venting data
			1994	1	0.2	0.2	0	1			į.
			1993	4	4	4	0.2		i		
		,	1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2				
			1993	1	0.8	0.8	0.8				
			1992	3	0.6	0.6	0.6		ı		
			1992	2	0.4	0.4	0.4			Ì	
	00691	SAMPLE	1994	2	o	0	0	ĺ	1		
			1994	. 1	6	6	6			1	
			1993	4	0.2	0.2	0.2		İ		
			1992	3	0.6	0.6	0.6				
<u> </u>			1992	2	4.8	4.8	5.4			N	o venting data

	T	T	COCKT II	-A13 OKO		ER SAMPL		READING	<u> </u>	
Well				Survey Results At Opening After Venting					-	
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
00791	WLM	1994	2	0	0		ВО	BL	Wh	COMMENTS
		1992	3	0.4	0.4	0.4				
		1992	2	5.2	5.2	6	0.2	0.2	0.2	
00891	WLM	1994	2	0	0		0.2	0.2	0.2	
		1992	3	0.4	0.4	0.4				
		1992	2	0.4	0.4	0.4				
00991	WLM	1994	2	0	0	0				
		1992	3	0.4	0.4	0.4				
		1992	2	4	4	9				No venting data
		1992	1	8	8	20				No venting data
01291	SAMPLE	1994	2	o	0	0				
		1994	1	5.8	5.8	5.8				
		1993	2	0.2	0.2	0.2	Ì			
		1993	4	0.4	0.4	0.4				
		1992	3	0.4	0.4	0.4				
		1992	2	0.4	0.4	0.6				No venting data
		1992	1	7.2	7.2	9				No venting data
01391	SAMPLE	1994	2	0	o	o		1		
		1994	1	2.8	2.8	2.8	İ		İ	
		1993	4	0.2	0.2	0.2				
	· [1993	3	0.2	0.2	0.2		l		
		1993	2	0.6	0.6	0.6		ļ		
		1993	1	0.4	0.4	0.4		1		
		1992	3	0.4	0.4	0.4				
		1992	2	0.2	0.2	0.3				No venting data
01491	SAMPLE	1994	2	0	o	0				-
		1994	1	3.5	3.5	3.5				
		1993	4	3	3	3	1		[
		1993	3	0.2	0.2	0.2	Ī		ľ	
•		1993	2	0.2	0.2	0.2	į		ł	
		1993	1	0.5	0.5	0.5				
		1992	3	0.4	0.4	0.4				
		1992	2	0.9	0.9	0.3		l		
01791	SAMPLE	1994	2	0	0	0				
	1	1994	1	2.5	2.5	2.5		į.		
]	1993	4	0	0	0				i
		1993	3	0.1	0.1	0.1			- 1	
	`	1993	2	0.2	0.2	0.2	- 1			
		1992	3	0.4	0.4	0.4		.		
] [1992	2	0.9	0.9	0.8			ľ	
		1992	1	1.8	1.8	1.8				
01891	SAMPLE	1994	2	0	0	0			Ì	
	[1994	1	3	3	3	1		1	İ
		1993	4	0	0	0				
	[.	1993	3	0.2	0.2	0.2				
		1993	2	0.2	0.2	0.2				
		1993	1	0.6	0.6	0.6				ļ
	[1992	3	0.4	0.4	0.4				
		1992	2	0.9	0.9	0.9				ļ
01991	SAMPLE	1994	2	0	0	0				
		1994	1	1	1	1				Į
		1993	4	0.2	0.2	0.2				
		1993	3	0.3	0.3	0.3				
		1993	2	0.3	0.3	0.3				
		1993	1	0.6	0.6	0.6				

Γ			T	ROCKYF	LAIS GRO		ER SAMPL		READING	<u>s</u>	
	Well					At Opening	Survey Res		40 W4		-
	ID	Status	Year	Qtr	BG	BZ	· wh	BG	After Venti BZ	WH	COMMENTE
			1992	2	4.8	4.8	5	- 50	BL	WIL	COMMENTS No venting data
			1992	3	0.1	0.1	0.1				No venting data
İ	02091	SAMPLE	1994	2	0	0	0	}			
			1994	1	4.2	4.2	8.4				No venting data
			1993	4	2.6	2.6	9.2				No venting data
			1993	3	0.2	0.2	25				Rapid dissipation
			1993	1	0.4	0.4	0.4	ĺ			
			1992	3	0.2	0.2	0.2				
			1992	3	0.2	0.2	0.2				
			1992	1	1.6	1.6	2.4				No venting data
	02191	· WLM	1994	2	0	0	0				
			1992	3	0.4	0.4	0.4				
			1992	2	0.2	0.2	6.5				No venting data
			1992	1	1.5	1.8	5				No venting data
	02291	0.11/2	1991	4	4.1	4.1	4.1	- 1]
	02291	SAMPLE	1994	2	0	0	0	-	İ		
		-	1994	1	0.2	0.2	0.4	1	.		No venting data
			1993 1993	4	0.2	0.2	/ 0.2	0.2	0.2	20	
			1993	3	0.2	0.2	0.2				
			1992	3	0.5	0.5	2	0.5	0.5	0.5	1 min. venting
			1992	2	0.3	0.3	0.3	.]			
		1	1992	1	2	0.5	2	1	1	1	
	02391	WLM	1994	2	0	0	0				
\perp			1992	3	0.4	0.4	0.4	İ	İ		
	;		1992	2	0.2	0.2	0.2				
		1	1992	1	0.3	0.3	0.3				
	02491	SAMPLE	1994	2	o	0	0			ļ	
		1	1994	1	0.2	0.2	0.2				
			1993	4	. 2.2	2.2	2.2		- 1		
			1993	3	0.2	0.2	0.2			ĺ	·
			1992	3	0.4	0.4	0.4				
•			1992	2	0.5	0.5	0.5	·	ĺ		!
			1992	1	1.5	1.5	14	8.2	8.2	8.2	
	00501		1991	4	4.2	4.4	5.2	İ	1		
	02591	SAMPLE	1994	2	0	0	0				
			1994	1	3.5	3.5	3.5			1	
			1993	4	2	2	2				
			1993	3	0.1	0.1	0.1				
			1993	2	0.4	0.4	0.4				-
			1993 1992	1	0.7	0.7	0.7				
			1992	3 2	0.1	0.1	0.1				
	02691	SAMPLE	1994	2	4.8	4.8	6.6	0.4	0.4	0.4	
			1994	1	0	0	0		1	1	
			1993	4	0.2	0.2 0.9	0.2				
		ļ	1993	3	0.3	0.9	0.9				
			1993	2	0.3	0.3	0.3				
]	1993	1	0.8	0.8	0.2 0.8				
	}	ĺ	1992	3	0.3	0.3	0.8				1.
			1992	2	0.4	0.5	1.5	0.5	0.5	ا ،	
,	02791	WLM	1994	2	0.4	0.5	0	0.5	0.5	0.5	
			1992	3	0.1	0.1	0.1				
			1992	2	0.2	0.2	0.2	İ	ĺ	-	
			1992	1	2.8	2.8	6	ļ		,,	o venting data
										IN	o venting data

		1 1	ROCKY FL	Y FLATS GROUNDWATER SAMPLING HNu READINGS						
			,	Survey Results						
Well	Ì		ļ		At Opening			After Vent	ting	
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
02891	WLM	1994	2	0	0	0				
		1994	1	11	11	11.5		}		No venting data
		1993	4	0.2	0.2	0.2				
	Ì	1993	3	0.3	0.3	0.3				
	}	1993	2	0.2	0.2	0.2				.
	İ	1992	3	0.2	0.2	0.2				
		1992	2	0.2	0.2	0.2				
		1992	1	8.8	8.8	11.8			1	No venting data
02991	SAMPLE	1994	2	0	0	0		ļ		
		1994	1	0.2	0.2	0.2				
		1993	4	0.2	0.2	0.2		1		
		1993	3	0.3	0.3	0.3				
İ		1993	2	0.6	0.6	0.6				
		1992	3	0.2	0.2	0.2				
		1992	2	0.2	0.2	0.2				
03091	SAMPLE	1992	1	3.8	4.8	4.8	1.6	1.6	1.6	
03091	SAMPLE	1994 1994	2	0	0	0			ľ	
	i	1994	1 4	1	1	1				
		1993	3	0.3	0.3	3				No venting data
	1	1993	2	0.3	0.3	0.3				
		1993	1	0.6	0.2	0.2				
		1992	3	0.3	0.3	0.3				
		1992	2	0.3	0.3	0.3				,
03191	WLM	1994	2	0.2	0.2	0.2				
1 00.55		1994	1	11.5	11.5	11.5				
		1993	4	0.3	0.3	0.3				•
		1992	3	1.5	1.5	1.5				
1		1992	2	0.2	0.2	0.2				
		1992	1	8.6	8.6	10.2	o	0	0.2	
ļ		1991	4	1.2	1.2	1.2	ď	·	0.2	
03391	SAMPLE	1994	2	0	0	0				
		1994	1	0	o	o				!
		1993	. 4	0.3	0.3	0.3	ŀ			
	,	1993	3	0	0	0	İ		1	
		1993	2	0.4	0.4	0.4	l			
		1993	1	0.7	0.7	0.7	İ			
	1 . 1	1992	3	0.4	0.4	0.4				į
		1992	2	0.2	0.2	0.2				
03591	SAMPLE	1994	2	o	0	0				
		1994	1	0.2	0.2	0.2			ľ	
		1993	4	0.6	0.6	0.6				
		1993	3	0.3	0.3	0.3				
1		1993	1	0.6	0.6	0.6	-			
		1992	3	0.1	0.1	0.1	1			İ
	1	1992	2	0.2	0.2	0.2	-		1	į
		1992	1	7.2	7.2	8.4	0.2	0.2	0.2	Day 4
03691	SAMPLE	1994	2	0	0	0				
		1994	1	0.8	0.8	3.5	-	İ	l ₁	No venting data
		1993	4	0.4	0.4	0.4		l	[
1		1993	3	0.2	0.2	0.2		ŀ	ļ	
		1993	2	0.4	0.4	0.4	İ			•
1		1993	1	0.7	0.7	6				
		1992	3	0.4	0.4	0.4		}		
		1992	2	0.2	0.2	0.2				

				ROCKY FI	ATS GRO	UNDWAT	ER SAMPL	ING HNu	READI	NGS			
		ĺ					Survey Res	ults					_
-	Well					At Opening			After V	enting	1		
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ		COMMENTS		
-	03791	SAMPLE		2	0	0	0				- COMMINICATION		_
		1	1994	1	3.3	3.3	3.3						
		1	1993	3	0.3	0.3	0.3		1				
			1993	2	0.4	0.4	0.4						
		1	1993	1	0.7	0.7	0.7		İ				
			1992	3	0.2	0.2	0.2		1				ļ
			1992	2	0.2	0.2	0.2						ı
- [1992	1	6	6	6						ļ
	03891	WLM	1994	2	o	o	o						Ì
ı			1992	3	0.1	0.1	0.1						
- 1			1992	2	0.2	0.2	0.2						1
		1	1992	1	2	2	2	ļ					
			1991	4	1.2	1.2	1.2						
- 1	03991	SAMPLE	1994	2	0	o	0					*	
			1994	1	2.9	2.9	2.9						
			1993	3	0.2	0.2	0.2						
			1993	4	0.6	0.6	0.6	!					
		1	1993	2	0.2	0.2	0.2						
			1993	1	0.6	0.6	0.6	- 1			•		
			1992	3	0.1	0.1	0.1	1					
1	04001		1992	2	3.3	3.3	3.3	- 1				-	
-	04091	SAMPLE	1994	2	0	0	0	1					
			1994	1	2.8	2.8	2.8	j					
			1993	4	0.2	0.2	0.2					,	
	L		1993	3	0.2	0.2	0.2						!
	•		1993	2	0.4	0.4	0.4						
Ī			1993	1	0.6	0.6	0.6	.					
			1992	3	0.6	0.6	0.6						
ĺ	04191	041077	1992	2	4	4	5	4.8		5.4	Day 2		
	04191	SAMPLE	1994	2	0	0	0	. [-,-		
			1994	1	0.8	0.8	0.8	1				*	
			1993	4	1.1	1.1	1.1	- 1					
			1993	2	0.3	0.3	0.3						
1			1993	1	0.2	0.2	0.2						
			1992	3	0.2	0.2	0.2						
-			1992	2	0.4	0.4	0.4	- 1					
	04291	CANCELE	1992	1	2	2	2						
	04251	SAMPLE	1994	2	0	0	0	- 1					
			1994	1	0.8	0.8	0.8						
			1993	4	0.3	-0.3	0.3						
			1993	2	0.2	0.2	0.2	1					
			1992	3	0.3	0.3	0.4	0.4	0.4	0.4		ŀ	
			1992	2	0.4	0.4	0.4					i	
Ì	04491	SAMPLE	1992	1	4.8	4.8	6.2	ĺ		N.	venting data		
ĺ	0.131	SAMPLE	1994	2	0	0	0				-		
		[[1994	1	0.8	0.8	0.8						
		1	1993	4	0.2	0.2	0.2	1					
			1993	2	0.03	0.03	0.03						
		[1992	3	0.9	0.9	0.4]	ĺ	.			
			1992	2	0.4	0.4	0.6	0.2	0.2	0.2		1	
	04591	CANCELE	1992	1	7.8	7.8	8	ĺ		,	venting data	1	
	U4J71	SAMPLE	1994	2	0	0	0	-				ļ	
			1994	1	0.2	0.2	0.2	1	-	1			
			1993	4	0.2	0.2	0.2						
_			1993	3	0.2	0.2	0.2			.			

· · · · · · · · · · · · · · · · · · ·			ROCKYF	LAIS GRO	UNDWAT	Survey Res		READIN	GS	
	į						_			
Weil			At Opening After Venting							
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
1		1993	2	1	0.4	0.4				
		1993	1	0.3	0.3	0.3				
		1992	3	0.3	0.3	0.3				
		1992	2	0.4	0.4	0.4				
04691	SAMPLE	1994	2	0	0	0				
		1994	1	0.2	0.2	0.2			1	1
		1993	4	1.1	1.1	1.1		Ì		
	1	1993	3	0.3	0.3	0.3		1		
1		1993	2	0.2	0.2	0.2		1		
		1993	1	0.2	0.2	0.2		1		
		1992	3	0.2	0.2	0.2		1		
		1992	2	0.4	0.4	0.4				
04891	WLM	1994	2	0	0	0				
		1993	2	0.2	0.2	0.2				
		1992	3	0.4	0.4	0.4				
		1992	2	0.3	0.3	0.3				
		1992	1	2	2	2.2	1		1	1
•		1991	4	0	0	0			1	
04991	SAMPLE	1994	2	0	0	0				
		1994	1	0.1	0.1	0.1				
	İ	1993	4	0.2	0.2	0.2				1
		1993	3	0.2	0.2	0.2				
		1993	1	0.6	0.6	0.6				j
1.		1992	3	0.4	0.4	0.4		٢		. 1
1		1992	2	0.4	0.4	0.4				
		1992	1	4.6	4.6	5	2	2	2 2	:
05091	SAMPLE	1994	2	0	0	0			1	
		1994	1	0.2	0.2	0.2				
		1993	4	0.2	0.2	0.2				
		1993	3	0.2	0.2	0.2				
		1993	1	0.6	0.6	0.6			1	
		1992	3	0.4	0.4	0.4				
		1992	2	0.5	0.5	0.5				
		1992	1	0.3	0.9	0.5	0.5	0.5	0.5	
05191	SAMPLE	1994	2	0	0	0	i			
1	1	1994	1	0.2	0.2	0.2				
		1993	4	0.2	0.2	0.2				
1		1993	3	0.2	0.2	0.2	1]
		1993	2	0.2	0.2	0.2		•		
		1993	1	0.4	0.4	0.4			l	
		1992	3	0.4	0.4	0.4				
		1992	2	0.5	0.5	0.5				
05291	ND	1994	2	0	0	0.1	0	0	0	1
	1	1992	3	0.3	0.3	0.3				
		1992	2	0.4	0.4	2.8	1			No venting data
05391	SAMPLE	1994	2	0	0	0]			
	1	1994	1	0.8	0.8	0.8	- 1			
		1993	3	0.3	0.3	0.3	1			
		1993	2	0.2	0.2	0.2				
	1.	1993	1	0.5	0.5	0.5				
•		1992	3	0.1	0.1	0.1				1
		1992	2	0.2	0.2	0.2				
		1992	1	6.4	6.4	6.8	0.4	0.4	0.4	Day 2
05691	SAMPLE	1994	2	o	o	o				1
	<u></u>	1994	1	2.8	2.8	2.8				

	· · · · · · · · · · · · · · · · · · ·		1	ROCKY FI	LATS GRO		ER SAMPL		READING	<u>s</u>	
	Well						Survey Resi	ults	10 ==		4
Ö	ID	Status	Year	Qtr	BG	At Opening BZ	WH	BG	After Vent		
	,		1993	4	0.3	0.3	0.3	BG	BZ	WH	COMMENTS
			1993	3	0.3	0.3	0.4				No venting data
			1993	2	0.2	0.2	0.2				No ventuig data
			1993	1	0.6	0.6	0.8				No venting data
			1992	3	0.2	0.2	0.2		1		To venting data
		1	1992	2	0.3	0.3	0.3				
	05991	WLM	1994	2	o	o	o		ĺ		
	06091	SAMPLE	1994	2	o	0	o				
			1994	1	2.8	2.8	2.8		ĺ		
			1993	4	0.2	0.2	0.2				
			1993	3	0.1	0.1	0.1			1.	
			1993	2	0.4	0.4	0.4				
	,		1993	1	0.6	0.6	0.6				
	·		1992	3	0.2	0.2	0.2				
			1992	2	0.4	0.4	0.4			1	
	06101		1992	1	1.8	1.8	1.8				
	06191	SAMPLE	1994	2	0	0	0.6				No venting data
			1994	. 1	0.3	0.3	0.3				·
	•		1993	4	2	2	. 2				
İ			1993 1993	3	0.1	0.1	0.1				
-			1993	2	0.8	0.8	0.8			ļ	
			1992	3	0.7	0.7	0.7				
			1992	2	0.1	0.1	0.1				,
	06291	SAMPLE	1994	2	0.5	0.3	. 0				
			1994	1	0.2	0.2	0.2			!	
4			1993	4	0.6	0.6	0.6	ĺ		ľ	
			1993	3	0.1	0.1	0.1				
			1993	2	0.4	0.4	0.4	, I			
		i l	1992	3	1.1	1.1	1.1				
1	•		1992	2	0.5	0.5	0.5				
			1992	1	1.6	1.6	1.6				
1	06391	WLM	1994	2	o	0	o	:			
			1994	1	0.5	0.5	0.5				
			1993	4	0.4	0.4	0.4				
1		}	1993	1	0.6	0.6	0.6				
			1992	3	1	1	1				
ĺ			1992	2	0.4	0.4	0.4				
		ļ i	1992	1	1.6	1.6	1.6		. [
			1991	4	0.6	0.6	0.6				
	06491	SAMPLE	1994	2	0	0	0			j	
		[1994	1	0	0	0	ĺ			
	•	1	1993	4	0.2	0.2	0.2	1	İ		
1			1993	3	0.3	0.3	0.3		ļ		
			1993	2	0.2	0.2	0.2		Į.	ĺ	
ľ			1993	1	0.4	0.4	0.6	0.3	0.3	0.3	İ
			1992	3	0.2	0.2	0.2				
	06591	SAMPLE	1992	2	11.4	11.4	17.2	0.4	0.4	0.4	
	00371	DAMPLE	1994	2	0	0	0		ļ	i	
d			1994 1993	1	1	1	1				1
		Ì	1993	4	0.4	0.4	0.4				
Ī			1993	3	0.4	0.4	0.4				
			1993	2	0.2	0.2	0.2	}			
			1993	3	0.3	0.3	0.3			İ	
_					U.7	U.4	U.5		ſ	I	

TABLE E-2
ROCKY FLATS GROUNDWATER SAMPLED CO.

			ROCKY F	LATS GRO	UNDWAT	ER SAMPL	ING HN	READING	SS		
Well	1										
ID	Status	V	0.		At Opening			After Vent	ing]	
	Status	Year 1992	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	
06691	SAMPLE	1 1	2	0.2	0.4	0.4	5	5	5		
		1994	2	0	0	0					
		1993	1	1	1	1		1] .		
		1993	. 4	0.2	0.2	0.2					
		1993	3	0.3	0.3	0.3					
	1	1993	2	0.1	0.1	0.1					
		1992	1	0.3	0.3	0.3					
		1992	3 2	0.4	0.4	0.9	0.3	0.3	0.3		
06791	SAMPLE	1994	2	4.8	4.8	15	0.6	0.6	0.6	2 weeks later	
		1994	1	1.8	0	0	.				
		1993	4	0.3	1.8	1.8					
		1993	3	0.3	0.3	0.3					
		1993	2	0.4	0.3	0.3			1		
	1	1993	1	0.5	0.5	0.4			- 1		
		1992	3	0.3	0.3	0.8	0.3	0.3	0.3		
		1992	2	5	5	0.5	0.3	0.3	0.3		
06891	SAMPLE	1994	2	o	0	10	3.6	3.6	4.4	•	
		1994	1	2.8	2.8	2.8	1	1	1		
		1993	4	0.2	0.2	0.2					
		1993	3	0.2	0.2	0.2			1		
	1	1993	2	0.2	0.2	0.2		1			
		1993	1	0.3	0.3	0.3	- 1	1			i
		1992	3	0.4	0.4	0.2					
		1992	2	0.4	0.4	0.4	`				
06991	SAMPLE	1994	2	0	o	o			-		
		1994	1	4.5	4.5	4.5		i			
		1993	4	0.2	0.2	0.2	İ	1			- 1
		1993	3	0.2	0.2	0.2		ł			
		1993	2	0.2	0.2	0.2		1			
		1993	1	0.5	0.5	0.5			1		-
		1992	3	0.3	0.3	0.3					- 1
07191	SAMPLE	1992	2	0.2	0.2	1	1	1	1 Ne	ext month	-
	SAMILE	1994 1994	2	0	0	0					
	1 1	1994	1	1.5	1.5	1.8	2.2	2.2	2.8		
	[1993	4	0.6	0.6	0.6		- 1			
		1993	3	0.3	0.3	0.3		İ			
		1993	2	0.1	0.1	0.1			1		
		1992	1	0.6	0.6	0.6		•			.
	1	1992	3	0.4	0.4	1.2				venting data	
07291	SAMPLE	1994	2 2	0.8	0.4	1			No	venting data	
1		1993	4	1.5	1.5	5.3			No	venting data	
	1	1993	3	0.4	0.4	0.4		1			
		1993	2	0.2	0.2	4	0.1	0.1	0.1		
		1993	1	0.1	0.1	0.1	1				
	1	1992	3	0.3	0.3	0.5 0.4					
		1992	2	0.2	0.4	0.4					
07391	SAMPLE	1994	2	0.2	0.4	0.4					
		1994	1	2.5	2.5	11					
		1993	4	0.6	0.6		1	1	5 Day		
	1	1993	3	0.0	0.6	1.6	0.4	0.4	1 Day		
		1993	2	4	4	0.9	0.2	0.2	. 50 Day		
		1993	1	0.6	0.6	4.9	0.4	0.4	3.5 Day		
	_	1992	3	0.8	- 1	10	0.6	0.6	10 Day	2	
				0.5	0.3	0.8	0.5	0.5	0.5		i

	T	Ţ		Survey Results				lts		
Well			Ì		At Opening			After Venti	ng	
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
		1992	2	4	4	35	0.3	0.3	0.4	Next month
07891	SAMPLE	1994	2	o	0	o				
		1994	1	0.2	0.2	0.2	,			
		1993	4	0.2	0.2	0.2				
		1993	3	0.3	0.3	0.3				
		1993	1	0.5	0.5	0.5				
		1992	3	0.1	0.1	0.1				
		1992	2	0.2	0.2	1.6	0.5	0.5	0.5	
07991	SAMPLE	1994	2	0	0	0				
		1994	1	0.2	0.2	0.2				
	İ	1993	4	0.4	0.4	0.4				
		1993	3	0.3	0.3	0.3				
		1993	2	0.2	0.2	0.2				
		1993	1	0.2	0.2	0.2				
		1992	3	0.4	0.4	0.4		,		
		1992	2	0.4	0.4	1.8				No venting data
08091	SAMPLE	1994	2	0	0	0				
		1994	1	0.8	0.8	0.8				
	1	1993	4	0.3	0.3	0.3	}			
		1993	3	1.4	1.4	1.4	ļ			
		1993	, 1	1.4	1.4	1.4				,
	1	1992	3	0.3	0.3	0.3				
		1992	2	0.4	0.4	0.6	0.6	0.6	0.6	Next month
		1992	1	5.5	5.5	6.4				No venting data
08291	WLM	1994	2	0	0	0				
		1992	3	0.4	0.5	0.4	0.3	0.3	0.3	
		1992	2	0.4	0.4	0.6	0.2	0.2	0.2	Next month
		1992	1	2.2	2.2	2.2				
08391	WLM	1994	2	0	0	0				·
		1993	2	0.03	0.03	0.003	i			
		1993	1	0.8	0.8	0.8				
		1993	3	0.3	0.3	0.3	,			
		1992	3	0.7	0.7	0.6				
	İ	1992	2	0.4	0.4	0.4				
00.40		1992	1	2	2	2				
08491	WLM .	1994	2	0	0	0				
		1992	3	0.3	0.3	0.3				.
		1992	2	0.4	0.4	1	0.2	0.2	0.2	Next month
00201		1992	1	3.8	4.2	5.2	ļ			
08591	WLM	1994	2	0	0	0				
		1993	2	0.2	0.2	0.2				
		1993	1	1.4	1.4	1.4		}		
		1992	3	0.2	0.2	0.2		ا ۾		
		1992	2	0.2	0.4	0.6	0.4	0.4	0.4	
00001	CALCETE	1992	1	2	2	3				
08891	SAMPLE	1994	2	0	0	0				77 A - A 1-1-1-
		1994	1	1	3	4		ı		Vented quickly
		1993	4	0.4	0.4	30				No venting data
		1993	3	0.3	0.3	50	0.2	0.2	50	Day 2
		1993	2	0.2	0.2	0.2		_		
		1993	1	0.5	0.5	12	0.4	0.4		Day 2
		1992	3	0.4	0.4	43	ŀ		1	No venting data
		1992	2	0.6	0.6	0.8	}			No venting data
09091	SAMPLE	1994	2	0	0	0	İ			
		1994	1	1	1	1	į.			

		<u> </u>	ROCKY FI	LATS GRO		ER SAMPL		READING	S	
Wall						Survey Res	ults			-
Well ID	Status	V	0 4-		At Opening			After Vent		
	Status	Year 1993	Qtr 4	BG 0.2	BZ 0.2	WH 0.2	BG	BZ	WH	COMMENTS
		1993	3	0.2		0.2				
		1993	2	0.1	0.1	0.1				
		1993	1	0.5	0.5	0.5				
		1992	3	0.4	0.4	0.4]	Ì	
		1992	2	0.2	0.2	0.2				
09691	SAMPLE	1994	2	0	0	0				
		1994	1	1.2	1.2	1.2				
		1993	4	0.4	0.4	0.4				
		1993	3	0.4	0.4	0.4				
		1993	2	0.3	0.3	0.3				
i	1	1993	1	0.6	0.6	1.4				No venting data
İ		1992	3	0.2	0.2	0.2				
		1992	2	3.8	3.8	5.2	0.7	0.7	0.7	
10991	SAMPLE	1994	2	0	0	0				
		1994 1993	1 4	2	0.2	2				
	i	1993	3	0.2 0.2	0.2	0.2				
		1993	2	0.2	0.2	0.2				
	1	1993	1	0.2	0.2	0.2				
		1992	3	0.4	0.4	0.4				
		1992	2	0.5	0.5	0.5				-
11291	WLM	1994	2	o	o	0				
		1992	3	0.2	0.2	0.2				,
1		1992	2	0.4	0.4	0.4				1
11491	WLM	1994	2	o	0	o				i i
1	İ	1994	1	11.6	11.6	11.6				
	İ	1993	1	0.3	0.3	0.3				
		1992	3	0.4	0.4	0.4	ĺ			
		1992	2	0.6	0.6	0.6	1			
11691	SAMPLE	1994	2	0	0	0	ŀ		į	į
		1994	1	2.8	2.8	2.8		İ	İ	
		1993	4	0.2	0.2	0.2			l	
		1993 1993	3	0.1	0.1	1.0	ľ	1	ŀ	·
		1993	2	0.2	0.2	0.2				
		1992	3	0.4	0.4	0.4			i	
		1992	2	0.2	0.2	0.2	İ			
11791	SAMPLE	1994	2	0.2	0.2	0.2				
		1994	1	او	9	9				
		1993	4	0.6	0.6	0.6				
		1993	3	0.1	0.1	0.1	1			
] [1993	2	0.2	0.2	0.2				
		1993	1	0.4	0.4	1			1	No venting data
		1992	3	0.3	0.3	0.3	i			
		1992	2	0.2	0.2	0.4	0.2	0.2	0.2	Next month
11891	SAMPLE	1994	2	0	0	0.9			1	No venting data
		1994	1	2.8	2.8	2.8				
		1993	4	3.2	3.2	3.2				
		1993	3	0.2	0.2	0.2	- 1	-	į	
		1993	2	0.4	0.4	0.4			l	14
,		1993	1	0.7	0.7	0.7				•
		1992	3	0.4	0.4	0.4				
		1992	2	0.2	0.2	0.2				
12091	SAMPLE	1994	2	0	0	0				

_			I	ROCKY FI	ATS GRO	UNDWAT	ER SAMPL	ING HNu	READING	S	
							Survey Rest	ults			
	Well					At Opening	$\overline{}$		After Venti		
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
			1994 1993	1	0.2 0.6		0.2				
			1993	3	0.0	0.6 0.2	0.6				
- 1			1993	1	0.2	0.2	0.2 0.6				
			1992	3	0.4	0.4	0.4				
			1992	2	0.5	0.5	1.5	0.3	0.3	0.3	Next month
	12191	SAMPLE	1994	2	o	0	0		0.5	0.5	Total Illohul
-			1994	1	1.2	1.2	1.2				
			1993	4	2.1	5.2	2.1				No venting data
			1993	3	0.2	0.2	0.2				
			1993	2	0.3	7	0.3	0.8	0.8	2	
		1	1993	1	0.2	0.2	0.2				
		1	1992	3	0.1	0.1	0.1				
	12291	SAMPLE	1992	2	0.2	0.2	0.2				
- {	14471	SAMPLE	1994 1994	2	0	0	0	ĺ			·
			1993	4	0.7 0.2	0.7 0.2	0.7 0.2	-			
			1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2	1			
			1993	1	0.4	0.4	0.4		.		
			1992	3	0.5	0.5	0.5	1	1	- 1	
			1992	2	0.8	0.8	0.6		1	ļ	
	12391	SAMPLE	1994	2	0	. 0	o			.	
١.			1994	1	0	0	o		i		•
4			1993	4	0.2	0.2	0.2			ĺ	
•		1	1993	3	0.1	0.1	0.1		-		1
		1	1993	2	0.2	0.2	0.2			ļ	
			1993 1992	1	0.6	0.6	0.6	.			
			1992	3 2	0.9	0.9	0.9	İ	İ		
	12491	SAMPLE	1994	2	0.3	0.3	0.3				
			1994	1	0.8	0.8	0.8	l		.	
			1993	4	3	3	3		.		·
			1993	3	0	0	0				
			1993	2	0.2	0.2	0.2				·
			1993	1	0.5	0.5	0.5			1	
			1992	3	0.3	0.3	0.3		- 1		
			1992	2	0.3	0.3	0.3				
	12691	SAMPLE	1994	2	0	0	o				
			1994	1	2.5	2.5	2.5	İ			
			1993	4	0.4	0.4	0.4	ļ			
			1993 1993	3	0.3	0.3	0.3	1			
			1993	2	0.3	0.3	0.3				·
			1992	3	0.6	0.6	0.6				
			1992	2	0.4	0.1	0.1		1		
	12891	WLM	1994	2	0.4	0.4	0.4			1	,
			1992	3	0.3	0.3	0.4	0.2	0.2	0.2	
			1992	2	0.4	0.4	1	0.4	0.4	0.4	
	12991	SAMPLE	1994	2	0	0	o				
			1994	1 .	0.2	0.2	0.2			1	
,			1993	4	0.2	0.2	0.2		1		İ
			1993	3	0.3	0.3	^ 0.3				1
			1993	2	0.3	0.3	0.3	İ			1
Ц.		L	1993	1	0.6	0.6	0.6				

TABLE E-2
ROCKY FLATS GROUNDWATER SAMPLING HNu READINGS

				LAIS GRO		Survey Res		TEADING.		
Well					At Opening			After Venti	ng	1
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
1		1992	3	0.3	0.3	0.3				
		1992	2	0.4	0.4	1.2	0.3	0.3	0.4	Next month
13091	SAMPLE	1994	2	o	0	o				
		1994	1	1.4	1.4	1.4				1
		1993	4	0.2	0.2	0.2				
		1993	3	0.3	0.3	0.3				
		1993	2	0.3	0.3	0.3				
		1993	1	0.3	0.3	0.3	ļ			
	1	1992	3	0.5	0.4	0.3				
		1992	2	4.2	4.2	9	4.2	4.2	5	
13191	SAMPLE	1994	2	o	0	0				
		1994	1	2.5	2.5	3	1.2	1.2	2	
		1993	4	0.4	0.4	0.4				
		1993	3	0.3	0.3	0.3				
i		1993	2	0.4	0.4	0.4		ĺ		
		1994	4	0.3	0.3	0.3				
	1	1992	3	0.3	0.3	0.7	0.6	0.6	0.6	
		1992	2	0.2	0.4	0.4	0.4	0.4	0.4	Next month
13291	SAMPLE	1994	2	o	o	o				
		1994	1	0.8	0.8	0.8	[
]		1993	4	0.4	0.4	0.4	ŀ			
[1993	3	0.4	0.4	0.4				
	Ì	1992	3	0.3	0.3	1	0.4	0.4	0.4	
		1992	2	0.4	0.6	2		1		No venting data
13391	SAMPLE	1994	2	o	o	0		-		
		1994	1	2.9	2.9	2.9		į		
1		1993	3	0.1	0.1	0.1		. [
	•	1993	4	3	3	3		•		
		1993	2	0.4	0.4	0.4				
		1993	1	0.6	0.6	0.6		ľ		
		1992	3	0.1	0.1	0.1				
		1992	2	4.8	4.8	4.8				
13491	SAMPLE	1994	2	0	0	0			ĺ	
		1994	1	0.2	0.2	0.2			i	
		1993	4	3.1	3.1	3.1				
		1993	3	0.3	0.3	0.3				
		1993	2	0.4	0.4	0.4				
		1993	1	0.4	0.4	0.4				
		1992	3	0.1	0.1	0.1	1			
		1992	2	0.6	0.6	1.2	4.4	4.4	44	Next month
13591	WLM	1994	2	0.0	0.0	0	7.7	7.7	7.7	IVEAL INORIDI
13371	""	1992	3	0.2	0.2	0.5				No venting data
	[]	1992	2	3.4	2.4	3.8	0.4	0.4		Next month
20591	WLM	1994	2	0	2.4		0.4	0.4	0.4	Next mondi
20691	WLM	1994	2		1	0	l		- 1	İ
20791	WLM			0	0	0	ĺ	-	-	
		1994	2	0	, 0	0		1		
30991	SAMPLE	1994	2	0	0	0	j			1
,		1994	1	1	1	1		ŀ	- 1	
	j	1993	4	0.3	0.3	0.3			İ	
		1993	3	0.2	0.2	0.2			İ	
		1993	2	0.3	0.3	0.3		- 1		
		1993	1	0.8	0.8	0.8		1	1	
		1992	3	0.4	0.4	0.4				
		1992	2	4.5	4.5	5	0.4	0.4	0.4	Next month
31491	WLM	1994	2	0	0	0				

			 i	ROCKY F	LATS GRO				READING	<u>s</u>	
	Well				<u> </u>		Survey Res	ults			-
O	ID_	Status	Year	Qtr	BG	At Opening BZ	WH	P.C	After Venti		
)	Juitus	1994	1	0.2	0.2	0.2	BG	BZ	WH	COMMENTS
			1993	4	0.2	0.2	0.2				
			1993	3	0.3	0.3	0.2				
			1993	1	0,2	0.2	0.2		1		
			1992	3	0.3	0.3	0.3				·
			1992	2	0.3	0.3	0.3				.
	31791	SAMPLE	1994	2	0	o	0				,
			1994	1	1.8	1.8	1.8				
			1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2				
ļ	•		1993	1	0.2	0.2	0.2				
			1992	3	0.3	0.3	0.3		.		
	21001	CANDER	1992	2	0.4	0.4	0.4		1		
	31891	SAMPLE	1994	2	0	0	0				
			1994 1993	1	1.7	1.7	1.7				·
			1993	3	0.2	0.2	0.2	j			
-		1	1993	1	0.3	0.3	0.3		Ī		
		ļ	1992	3	0.7	0.7	0.7 0.4	İ			
			1992	2	0.4	0.4	0.4		1		
1	32591	SAMPLE	1994	2	. 0	0	0.4				
			1994	1	0.2	0.2	0.2				
			1993	4	0.3	0.3	0.3	1		i	
İ			1993	3	0.2	0.2	0.2	İ	ľ	ļ	, ,
			1993	1	0.6	0.6	0.6			ĺ	
	•	ĺ	1992	3	0.3	0.3	0.3		1	J	
			1992	2	0.2	0.2	0.2				
	33491	SAMPLE	1994	2	0	0	0		i	.	
	7	7	1994	1	1	1	1			i	
		İ	1993	4	0	0	0		i		-
			1993	3	0.3	0.3	0.3				
			1993	1	0.6	0.6	0.6				·
			1992 1992	3	0.4	0.4	0.4				
	33691	WLM	1994	2	4.5	4.5	6	0.4	0.4	0.4	
	5552		1993	2 2	0.2	0.2	0.2	-		1	1
			1992	3	0.4	0.4	0.4	ĺ	1		
1			1992	2	0.4	0.4	0.4			1	
	33891	SAMPLE	1994	2	0	. 0	0	-	.		
1			1994	1	0	0	o		į		
			1993	4	0.2	0.2	0.2		ļ		
			1993	3	0.4	0.4	0.4				
			1993	2	0.6	0.6	0.6				
			1993	1	0.6	0.6	0.6				
			1992	3	0.3	0.3	0.3	.		1	
			1992	2	0.9	0.9	0.9				
	34591	WLM	1994	2	0	0	0				
			1992	3	0.5	0.5	0.5		-		·
	24701	CALCE	1992	2	4	4	4	-			
_	34791	SAMPLE	1994	2	0	0	0		1.		
			1994	1	3.2	3.2	3.2				
T	•		1993	4	0	0	0				
			1993 1993	3	0.4	0.4	0.4			.	
			i i	2	0.3	0.3	0.3	,	1	.	
			1993		0.3	0.3	0.3				

	T	T	ROCKIF	LAIS GRO		ER SAMPI		READING	is	T
Well				Survey Results At Opening After Venting						+
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
		1992	3	0.3	0.3	0.3			 ''	COMMENTS
		1992	2	4.6	4.6	4.6				
35391	SAMPLE	1994	2	0	0	0				
		1994	1	0.5	0.5	0.5				}
[· ·	1993	4	0.4	0.4	0.4			[
	[1993	2	0.6	0.6	0.6				1
	·	1992	3	0.4	0.4	0.2			1	
		1992	2	0.3	0.3	0.3	,		İ	
35691	SAMPLE	1994	2	0	0	0		1		
		1994	1	0.3	0.3	0.3		ļ	1	ļ
		1993	4	0.2	0.2	0.2				
		1993	3	0.3	0.3	0.3		1		
1		1993	2	0.3	0.3	0.3]		
		1993	1	0.6	0.6	0.6		1		
1		1992 1992	3	0.4	0.4	0.3		ļ	ļ	
35991	WLM	1994	2 2	0.4	0.4	0.4				
33331	WENT	1992	3	0.2	0.2	0.2				
ì		1992	2	0.9	0.9	0.9]	
36191	SAMPLE	1994	2	0.5	0.5	0.5			1	
		1994	1	4.6	4.6	6	1.2	1.2	1.2	
		1993	4	0.1	0.1	0.1		1	1	
		1993	3	0.3	0.3	0.3				
	1	1993	1	0.4	0.4	0.4				,
}		1992	3	0.3	0.3	0.3				
	1	1992	2	5.5	5.5	6	0.2	0.2	0.2	ļ
36391	SAMPLE	1994	2	o	o	o				
		1994	1	4	4	4	-			
		1993	4	0	0	o	1			
		1993	3	0.1	0.1	0.1				
		1993	1	0.8	0.8	0.8	1			
1		1992	3	0.3	0.3	0.3				
		1992	2	5.5	5.5	6	1	1	1	Next month
36691	SAMPLE	1994	2	0	0	0				ĺ
		1994	1	0.8	0.8	0.8			ĺ	
		1993	4	0.2	0.2	0.2	1			
		1993	3	0.1	0.1	0.1			-	
		1993	2	0.4	0.4	0.4				1
		1992 1992	3	0.3	0.3	0.3				
36991	WLM	1994	2	0.4	0.4	0.4	- 1	1	ļ	
30771	W LIVI	1993	2	0.2	0.2	0	}]		
37191	SAMPLE	1994	2	0.2	0.2	0.2			i	
	J. E. II	1994	1	2.6	2.6	2.6	[1	1	
		1993	4	0	0	0	1	1	-	
	1	1993	3	0.3	0.3	0.3	İ]	
	1	1993	2	0.4	0.4	0.4	1]]	
	1	1992	3	0.4	0.4	0.4		l		
}		1992	2	4.5	4.5	7.5	0.4	0.4	0.4	
37591	SAMPLE	1994	2	0	0	0	5.1	3.4		
I		1994	1	5.6	5.6	5.6			ĺ	
		1993	, 3	0.1	0.1	0.1				
I		1993	2	0.2	0.2	0.2	1			
1	\ \ \	1992	3	0.4	0.4	0.4	-			
		1992	2	0.4	0.4	0.4		İ		

				COCKY FL	ATS GRO	UNDWATI			READING	<u>S</u>	1
	***			}			Survey Rest				-{
	Well	64.4		<u>.</u>		At Opening	 _		After Venti		
	ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
	37691	SAMPLE	1994	2	0	0	0				<u> </u>
Ì			1994	1	1	1	1		1		•
			1993	4	0.2	0.2	0.2				
	•		1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2				
			1992	3	0.4	0.4	0.4				
	0.000		1992	2	5.4	5.4	5.4		İ		
	37791	SAMPLE	1994	2	0	0	0				
			1994	1	3.5	3.5	3.5				
			1993	4	0.2	0.2	0.2				
			1993	3	0.3	0.3	0.3				
			1993	1	0.3	0.3	0.3				
			1992	3	0.4	0.4	0.4				
	25001	an mr	1992	2	0.3	0.3	0.3				!
· ·	37891	SAMPLE	1994	2	0	0	0				
			1994	1	1	1	1				
			1993	3	1	1	1				
			1993	2	0.2	0.2	0.2				
			1993	1	0.8	0.8	0.8				
			1992	3	0.4	0.4	0.4				
		[]	1992	2	4.5	4.5	1.9			,	
	37991	SAMPLE	1994	2	0	0	0				
			1994	1	1	1	1	,			
			1993	4	0.9	0.9	0.9				
			1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2				
			1993	1	0.4	0.4	0.4				
		1	1992	3	0.4	0.4	0.4				
			1992	2	0.4	0.4	0.4				
	38191	SAMPLE	1994	2	0	0	0				
			1992	3	0.3	0.3	0.3				
			1992	2	4.5	4.5	1.9			:	
1	38291	SAMPLE	1994	2	0	0	0	•			
			1992	3	0.4	0.4	0.9	0.3	0.3	0.3	1
			1992	2	4.5	4.5	9	0.4	0.4	3	
	38591	SAMPLE	1994	2	0	0	0				
			1994	1	1.9	1.9	1.9				
			1993	4	0	0	0				
		1	1993	3	0.4	0.4	0.4		* .		
1			1993	1	0.9	0.8	0.8				
			1992	3	0.3	0.3	0.3		ļ		
		1	1992	2	0.4	0.4	0.4				
	38891	SAMPLE	1994	2	0	0	0				
			1994	1	2.8	2.8	2.8				•
			1992	3	0.6	0.6	0.6				
			1992	2	0.2	0.2	0.2				
1	38991	SAMPLE	1994	2	0	0	0				
			1994	1	2.8	2.8	2.8	İ			
			1993	2	0.1	0.1	0.1				
			1992	3	0.6	0.6	0.6				
		1	1992	2	4.5	4.5	5.5	0.2	0.2	0.2	
	39191	SAMPLE	1994	2	0	0	o				
			1994	1	0.2	0.2	0.2				
1]	1993	4	0.3	0.3	0.3			4	
			1993	3	0.2	0.2	0.2				

		, ,	ROCKY FI	LATS GRO	UNDWATI	ER SAMPL	ING HNu	READINGS	3		
						Survey Resu					
Well				At Opening A							
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	
		1993	1	0.4	0.4	0.4					
		1992	3	0.3	0.3	0.3					
20001		1992	2	0.2	0.2	0.2					,
39291	SAMPLE	1994	2	0	0	0					
		1993	2	0.1	0.1	0.1					ļ
1	ł	1992	3	0.6	0.6	0.6					1
30601	CANGER	1992	2	0.2	0.2	0.2					Ì
39691	SAMPLE	1994	2	0	0	0					
		1994 1993	1 4	9	9	9					
		1993	1	0.2	0.2	0.2		i			
		1993	3 2	0.2	0.2	0.2					
		1992	3	0.2	0.2	0.2	i				
		1992	2	0.4 0.4	0.4	0.4					
40491	WLM	1994	2	0.7	0.4	0.4					
		1992	2	0.4	0.4	0.6	. 0.4	0.4	0.4		
		1992	3	0.4	0.2	0.4	7.9	7.9	7.9		
40791	WLM	1994	2	0.2	0.2	0.4	1.5	7.9	7.9		1
	1	1992	3	0.1	0.1	0.1	- 1				
	1	1992	2	0.3	0.1	0.3	- 1	- 1			
40991	WLM	1994	2	0.5	0.5	0.3			[•	
		1992	3	0.5	0.5	0.5	İ		1		
		1992	2	0.4	0.4	0.4		1			
41091	SAMPLE	1994	2	0	0.4	0				4	
		1994	1	2	2	2		İ			
		1993	4	0.3	0.3	0.3			1		4
1		1993	3	0.2	0.2	0.2			[
		1993	2	0.2	0.2	0.2					
		1993	1	0	0	0	- 1		1		
		1992	3	0.4	0.4	0.4	- 1				
		1992	2	0.4	0.4	1	0.5	0.5	0.5		
41491	SAMPLE	1994	2	0	0	o					
		1994	1	o	o	o					
		1993	4	0.4	0.4	0.4					
]]	1993	3	0.2	0.2	0.2					
		1993	2	0.2	0.2	0.2		l			
		1993	1	0.6	0.6	0.6					
·		1992	3	0.2	0.2	0.2	i		1		
		1992	2	0.2	0.2	0.2		.			
41591	SAMPLE	1994	2	0	o	o					
		1994	1	o	o	o			1		
		1993	4	0.2	0.2	0.2					
		1993	3	0.2	0.2	0.2	-				
		1993	2	0.2	0.2	0.2	l				
] [1993	1	0.2	0.2	0.2		1.	. [
		1992	3	0.3	0.3	0.3	[
		1992	2	0.2	0.2	0.2					.
41691	SAMPLE	1994	2	Ö	o	0					
		1994	1	o	o	0	-				
		1993	4	0.2	0.2	0.2					
		1993	3	0.2	0.2	0.2					
		1993	2	0.2	0.2	0.2		1	[
		1993	1	0.6	0.6	0.6					
		1992	3	0.2	0.2	0.2			ļ		
		1992	2	0.4	0.4	0.4					

			<u>1</u>	COCKY FL	A15 GRO				READINGS	<u> </u>	
	117 - 11			}			Survey Resi		AA W		
	Well		\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	ا ا	ı	At Opening	12,77		After Venti		COMMENTS
_	ID_	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
	45391	SAMPLE	1994	2	0	0	0				
			1994	1	0	0	0				
		j	1993	4	0.2	0.2	0.2				
			1993	3	0.3	0.3	0.3				
		j	1993	2	0.2	0.2	0.2				
	02002	>10	1993	1	0.2	0.2	0.2			,	
	03092	ND	1994	2	0	0	0				
	03192	ND SAMBLE	1994	2	0	0	. 0				
	10092	SAMPLE	1994 1994	2	0.2	0 0.2	0.2				
			1994	4	0.2	0.2	0.2				
			1993	3	0.2	0.2	0.2				
	10192	SAMPLE	1992	2	0.8	0.6	0.6				
	10172	JAMIE LE	1994	1	0.2	0.2	0.2				
			1993	4	0.2	0.2	0.2				
İ			1992	3	0.6	0.6	0.2				
	10292	SAMPLE	1994	2	0.0	0.0	0.0				
		J. Miller	1994	1	0.2	0.2	0.2				
			1993	4	0.2	0.2	0.2				,
			1992	3	0.6	0.6	0.6				
	10392	SAMPLE	1994	2	0.0	0.0	0.0				
			1994	1	0.2	0.2	0.2				
			1993	4	0.2	0.2	0.2	-			1
			1992	3	0.6	0.6	0.8	0.4	0.4	0.4	
	10492	SAMPLE	1994	2	0.0	0.0	0.0	U. 7	J. 4	5.1	-
			1994	1	0	ő	o				
			1993	4	0.3	0.3	0.3				
			1993	3	0.2	0.2	0.2				
			1993	2	0.2	0.2	0.2				!
			1993	1	0.3	0.3	0.3				
			1992	3	0.6	0.6	0.6				
	10592	SAMPLE	1994	2	0	.0	0				İ
			1994	1	ol	o	0	.			
		.	1993	4	0.6	0.6	0.6			ļ	
			1993	3	0.2	0.2	0.2				· ·
			1993	2	0.2	0.2	0.2				
			1993	1	0.3	0.3	0.3			,	
		-	1992	3	0.6	0.6	0.8	0.4	0.4	0.4	
1	10692	SAMPLE	1994	2	0	0	0.0	• • • • • • • • • • • • • • • • • • • •			
			1994	1	o	o	0				
			1993	4	0.6	0.6	0.6				
			1993	3	0.2	0.2	0.2				į
		1	1993	2	0.1	0.1	0.1	-			·
1			1993	1	0.3	0.3	0.3				
			1992	3	0.4	0.6	0.6	0.4	0.4	0.4	
	10792	SAMPLE	1994	2	0	0	0				
			1994	1	1	1	1				
		1	1993	4	0.2	0.2	0.2				
		1	1993	3	0.3	0.3	0.3		ļ		
			1993	2	0.1	0.1	0.1		1		
			1993	1	0.3	0.3	0.3		ł		
		1	1992	3	0.2	0.2	0.4	0.4	0.4	0.4	
T	10892	SAMPLE	1994	2	0.2	0.2	0.4	۷.۲	۷.۰۲	٠.٠٠	
	/-	J. 1111 DD	1994	1	0.2	0.2	0.2				
			1993	4	0.2	0.2	0.2		1		
Щ.			1333	4	0.2	0.2	0.2		l	l	

			ROCKY F	LATS GRO	UNDWAT	ER SAMPLI	NG HNu l	READING	S	
	İ					Survey Resu	lts		,,	
Well					At Opening			After Venti		
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH_	COMMENTS
1		1992	3	0.6	0.6	0.8	0.4	0.4	0.4	
10992	SAMPLE	1994	2	0	0	0				
i		1994	1	0	0	0	i			
1		1993	4	0.5	0.5	0.5				
		1993	3	0.2	0.2	0.2				
		1993	2	0.1	0.1	0.1	- 1			
		1993	1	0.3	0.3	0.3				
11000	CAL (D) F	1992	3	0.3	0.3	0.3				
11092	SAMPLE	1994	2	0	0	0	Ī			•
	1	1994	1	0	0	0	i			•
	İ	1993	4	0.6	0.6	0.6			ĺ	
	1	1993	3	0.4	0.4	0.4		-	- 1	
	-	1993	2	0.2	0.2	0.2			- 1	
}		1993	1	0.2	0.2	0.2	ĺ	ĺ		•
43392	SAMPLE	1992 1994	3	0.6	0.6	0.4		1	1	
43392	SAMPLE	1994	2	0	0	0				
		1993	1 4	1	1	1				
		1993	3	0	0	0				
		1993	1	0.3	0.3	0.3			1	
43492	SAMPLE	1994	2	0.4	0.4	0.4				
13.52	JANA EE	1994	1	1	1	0	1	- 1		
		1993	4	0.2	0.2	1			İ	
	ľ	1993	3	0.2	0.2	0.2		1		.
		1993	1	1.2	1.2				İ	
46192	SAMPLE	1994	2	0	0	1.2		1		
	312.12.22	1994	1	0.1	0.1	0.1			1	
		1993	3	0.2	0.1	0.1			ĺ	
ŀ		1993	2	0.2	0.2	0.2	- 1			
]		1992	1	0.2	0.2	0.3	1		,	No venting data
		1992	3	2.9	2.9	2.9			1	40 venting data
46292	SAMPLE	1994	2	0	0	0		1		
		1994	1	0.2	0.2	0.2				
		1993	4	0.6	0.6	0.6				
		1993	3	0.2	0.2	0.2				
	1	1993	2	4.8	4.8	4.8	- 1			
		1993	1	0.2	0.2	0.2		1	1	
	1	1992	3	3.4	3.4	3.4	[
46392	SAMPLE	1994	2	0	0	0	1	.	1	
		1994	1	0.1	0.1	0.1		1	ĺ	
		1993	4	0.3	0.3	0.3				
		1993	3	0.2	0.2	0.2	ŀ		1	1
		1993	2	0.4	0.4	0.4				
		1992	3	2.5	2.5	2.5				
46492	SAMPLE	1994	2	0	o	0			·	
		1994	1	7.2	7.2	7.2				
		1993	4	0.2	0.2	0.2				-
		1993	3	0.4	0.4	0.4				Î
		1993	2	4.8	4.8	4.8				
		1992	3	2.9	2.9	2.9		}		
46692	SAMPLE	1994	2	0	0	0	1			
		1994	1	0.2	0.2	0.2	1			
		1993	3	0.4	0.4	0.4			.	i
]	1993	2	0.4	0.4	0.4				
		1993	1	0.5	0.5	0.5	ĺ			
	<u> </u>			0.5	<u> </u>	<u> </u>				

_				ROCKY FI	ATS GRO		ER SAMPL		READI	NGS			
	Well						Survey Resu	its					
	ID	Status	Year	Qtr		At Opening			After Ve		_		
		Julius	1992	Qur 3	BG 1.2	BZ	WH	BG	BZ	WH	COMMENTS		
	46792	SAMPLE	1994	2	0	1.2	1.2		1				į
İ			1994	1	0.2	0.2	0.2						ļ
			1993	4	1	1	1						
			1993	2	0.4	0.4	0.4						
			1992	3	1.2	1.2	1.2		Ì				ļ
	46892	SAMPLE	1994	2	0	o	0						İ
			1994	1	0.2	0.2	0.2		İ				
			1993	4	3.5	3.5	3.5						- [
			1993	2	0.4	0.4	0.4						
		1	1992	3	2.8	2.8	2.8						1
	49192	SAMPLE	1992	2	2	2	2		'				-
	47172	SAMPLE	1994 1994	2	0.5							•	
			1994	1 4	0.7 2.5	0.7	0.7						
			1993	3	0.2	2.5 0.2	2.5						
			1993	2	0.3	0.2	0.2						
	49292	SAMPLE	1994	1	0.7	0.7	0.7						
			1993	4	0	0	0.7						ĺ
			1993	3	0.2	0.2	0.2						
			1993	2	0.3	0.3	0.3		ĺ				
	50092	SAMPLE	1994	2	0	o	0						İ
		}	1994	1	0.3	0.3	0.3						
			1993	4	0.1	0.1	0.1					٠,	
	50192		1993	3	0.1	0.1	0.1						
	30192	ND	1994	2	0	0	0						
	50292	ND	1993 1994	2 2	0.3	0,3	0.3						
			1993	2	0.3	0	0						
	75092	SAMPLE	1994	2	0.3	0.3	0.3	i					
			1994	1	5	5	5						
			1993	. 4	0.1	0.1	0.1						
			1993	3	0.2	0.2	0.2						
		İ	1993	2	0.2	0.2	0.2	ĺ					İ
	75292	SAMPLE	1994	2	0	o	o	-					
			1994	1	2.5	2.5	2.5	ĺ					
			1993	4	0.4	0.4	0.4	}					
			1993	3	0.2	0.2	0.2						
	75892	NTD	1993	2	0.4	0.4	0.4				•		İ
	75992 75992	ND SAMPLE	1994 1994	2	0	0	0	İ		1			
		SAMI LE	1994	2	0	0	0						
			1993	3	0.2	0.2	0.2						
		į .	1993	2	0.3	0.3	0.3	- [
	76192	ND	1994	2	0	0.2	0.2	ĺ					
	76292	SAMPLE	1994	2	o	0	o	-				,	
			1994	1	4.3	4.3	4.3	- 1					
			1993	4	1	1	1						
			1993	3	0.3	0.3	0.3						1
			1993	2	0.2	0.2	0.2						
	2000		1993	1	0.4	0.4	0.4						
	76792	ND	1994	2	0	0	0						
	76992	ND	1994	2	0	0	0		ĺ		•		
	77192	ND	1994	2	0	0	0						
	77392	ND	1994	2	0	0	o		j			-	

		·	ROCKY FI	ATS GRO	UNDWAT			READING	S		
		1		Survey Results At Opening After Venting						- 	
Well		,	۵.								
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS	{
77492	SAMPLE	1994	2	0	0	0					Ī
		1994		0	0	0					İ
		1993	4	0.5	0.5	0.5					
		1993	3	0.3	0.3	0.3					- 1
İ		1993	2	0.2	0.2	0.2					
00193	,,,,	1993	2	0.2	0.2	0.2			1		
00193	ND SANGUE	1994	2 2	0	0	0					
00293	SAMPLE	1994	- 1	0	0	0			1		1
00393	SAMPLE	1994 1994	2	0	0	0			1		
00393	SAMPLE	1994	1	0	0	0			1		
00493	ND	1994	2	0	o	0		ĺ			
00423	, ND	1994	1	o	o	0			1		
05093	SAMPLE	1994	2	0	0	0					1
05055	JAMI LL	1993	4	0.5	0.5	0.5					
		1993	3	0.3	0.3	0.3			ŀ		Ì
		1993	2	0.1	0.1	0.1					.
	1	1994	ī	0.1	0.1	0.1					l
05193	SAMPLE	1994	2	o	o	0					- 1
	0.2.2.2	1994	1	o	o	o					İ
		1993	4	0.5	0.5	0.5					j
		1993	3	0.3	0.3	0.3					
		1993	2	0.2	0.2	0.2			ł		
05293	SAMPLE	1994	2	0	0	0.2				,	1
		1994	1	o	o	o					
05393	ND	1994	2	0	o	o			Į.		- 4
22093	SAMPLE	1994	2	o	0	0					
		1994	1	o	o	o			İ	_	
		1993	3	0.2	0.2	0.2			l		
22193	SAMPLE	1994	2	0	0	o					
1		1993	3	0.2	0.2	0.2					-
1	1	1993	2	0.4	0.4	0.4			[Ì
		1994	1	1	1	1					
22293	SAMPLE	1994	2	0	o	o					
	!	1994	1	0	0	o			·		
		1993	2	0.2	0.2	0.2	}				
	[1993	3	0.4	0.4	0.4					- 1
22393	SAMPLE	1994	2	0	o	o			!		.
		1994	1	o	o	o					
22593	SAMPLE	1994	2	0	o	o				1	
		1993	3	0.2	0.2	0.2					
		1994	1	1	1	1					
23193	SAMPLE	1994	2	o	o	o	}				
		1994	1	1	1	1					
		1993	0.2	0.2	0.2	ŀ					
23293	ND	1994	2	o	o	0	ŀ				
40193	WLM	1994	2	o	o	1.1	o	0	0		
40293	WLM	1994	2	0	o	o	ļ	ľ			-
1		1994	1	10.8	10.8	10.8					
40393	WLM	1994	2	o	o	o	ļ				
40593	WLM	1994	2	o	0	o					
41193	WLM	1994	2	o	0	0	1				
41693	WLM	1994	2	o	o	0	İ				
41993	WLM	1994	2	o	o	0	Ì				
42393	WLM .	1994	2	o	o	o					
		4277				<u> </u>				<u> </u>	

Well D Salata Vest Opt BG BZ WH BG BZ WH SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID SID S	Г			j	KOCKI FI	AIS GRO		ER SAMPL		READING	<u> </u>	
D		Well								After Vant		4
43993 WLM 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0			Status	Year	Otr							COMMENTS
439293 WLM 1994 2 0 0 0 0 0 43939 WLM 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0				_						BL	Wh	COMMENTS
43933			ľ	1								
43833 VLM 1994 2 0 0 0 0 0 0 0 0 0				1 1								1
44993						1						-
44893			i	1 1						ļ	Į.	
44993				1 1				1				
45093 WLM 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0			1	1 1								
1994 1 11 11 11 11 11 11			1	1 1								
45393 WILM 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0			1			1						Į į
45393 WLM 1994 1 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8		45293	WLM	l i			1					
1994		45393	WLM	1994		o	0				1	
45693 WLM 1594 2 0 0 0 0 0 4 45793 WLM 1594 2 0 0 0 0 0 0 4 45793 WLM 1594 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0				1994		4.8	4.8	4.8				
1994		45593	WLM	1994	2	0	o	o			[
1994		45693	WLM	1994	2	o	o	0				
1994	ĺ	45793	WLM	1994	2	o	o	0				
1994		45893	WLM	1994	2	0	0	o				
1994		45993	WLM	1994	2	0	o	0				
46193 WLM 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0		46093	WLM	1994	2	0	0	0	Ì		Ì	
46293 WLM 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0				1994		0.6	0.6	0.6				
46393 WLM 1994 2 0 0 0 2.1 0 0 0 0 1 1994 1 11 11 11 11 11 11 11 11 11 11 11 11	1		•	1994		0	0	0				
46493 WLM 1994 2 0 0 0 0 1994 1 11 11 11 11 11 1				1994		0	0	0				
SAMPLE 1994			1	1 1			0	2.1	0	0	0	
SAMPLE 1994 2 0 0 0 0 0 0 0 1993 2 0.2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 1994 2 4.2 4.2 4.2 4.2 4.2 4.2 1994 1 2 2 2 2 2 1993 3 0.2 0.2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2		46493	WLM	1 1		1	0	0				
1993 3 0.2 0.2 0.2 0.2 0.2 0.2 1992 1 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4	1.					11	11	11	Į			'
1993 2 0.2 0.2 0.2 0.2 0.2 1992 1 0.4 0.4 0.4 1.4 1.5 1 1994 2 0.0 0 0.0 0.0 1994 1 0.0 0.0 0.0 1994 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		51193	SAMPLE	1 1		İ	ĺ	1				
1992						1						
SAMPLE 1994 2 4.2 4.2 4.2 1994 1 2 2 2 2 1993 3 0.2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 1993 3 0.1 0.1 0.1 1993 3 0.2 0.2 0.2 1993 3 0.1 0.1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			1	1 1	1		4					
SAMPLE			1	j 1º			i i	ľ				·
1994		£0500	G.13	1		1						
1993 3 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2		38/93	SAMPLE	1 1	4	ľ	1		İ			
59093 ND 1994 2 00 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0				1 1		1		1				
Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution Solution		•		1		I						Ì
59393 SAMPLE 1994 2 0 0 0 0 0 5 5 5 6 6 6 7 5 7 9 3 ND 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0		59093	ND									
SAMPLE 1994 2 0 0 0 0 0 0 0 0 0		37073	, ND	l l	,	- 1		4	}			
59493 SAMPLE 1994 1 0 0 0 0 0 1 1 1 1 1 1 1 1 1 1 1 1 1		59393	SAMPLE						ĺ			
SAMPLE 1994 2	1	******	J. L. L.		l	- 1		1				
1994 1 1 1 0.1 0.1 1 1 1 1 1 1 1 1 1 1 1 1 1		59493	SAMPLE		-1	្	9	ď	İ			
1993 3 0.1 0.1 0.1 1.1 1.1 1.1 1.1 1.1 1.1 1.1		·• •	DL	i	1	,	,	,		٠. ا		
59593 SAMPLE 1994 2 0 0 0 0 0 1 1994 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1					-	1	I		[ļ		
59593 SAMPLE 1994 2 0 0 0 0 0 1 1994 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1					1	I .	E .	i i				
1994 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		59593	SAMPLE			,		I	ļ			
1993 3 0.2 0.2 8 0.1 0.1 0.1 Dissipated rapidly Vented before puriging 1993 1 1 1 1 1 1 1993 3 0.1 0.1 0.1 1994 2 0 0 0 0 1993 2 0.2 0.2 0.2 61293 ND 1994 2 0 0 0 0 1993 2 0.2 0.2 0.2 63093 SAMPLE 1994 2 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0 1994 1 0 0 0 0	1					1	- 1	1	1			
1993 2 0.2 0.2 500 1994 1 1 1 1 1993 3 0.1 0.1 0.1 1993 2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 1994 1 0 0 0 1994 1 0 0 0 1994 1 0 0 0 1994 1 0 0 0 1993 2 0.2 0.2 1994 1 0 0 0 0							1		0.1	0.1	0.1	Dissinated rapidly
1994 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1				I .			I .		0.1	J.1	0.1	
1993 3 0.1 0.1 0.1 0.1 0.1 1994 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0				l l		I .	i	1				- chies detera bariguig
59793 ND 1994 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0			İ	1	1	ľ						1
61293 ND 1994 2 0 0 0 0 0 1993 63093 SAMPLE 1994 1 0 0 0 0 1993 2 0.2 0.2 0.2 0.2 0.2 1993 2 0.2 0.2 0.2 0.2 0.2 1994 1 0 0 0 0 0 1999 1999 2 0.2 0.2 0.2 0.2 0.2		59793	ND		I	1					ł	
61293 ND 1994 2 0 0 0 0 0 6 1993 63093 SAMPLE 1994 2 0 0 0 0 0 1994 1 0 0 0 0 1993 2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0.2 0				I		II						ļ
63093 SAMPLE 1994 2 0 0 0 0 1 1994 1 0 0 0 0 1993 2 0.2 0.2 0.2 0.2 0.2		61293	ND			i i			1			
63093 SAMPLE 1994 2 0 0 0 0 0 1994 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0				I .		1		i i	}			
1994 1 0 0 0 1993 2 0.2 0.2 0.2		63093	SAMPLE	1				1	Ī			!
1993 2 0.2 0.2 0.2				I .				1		İ		
					- 1		1	1		l		
	L.	70093	SAMPLE						}	l		j

			1 - 1	ROCKY FL	AIS GRO		ER SAMPI		READING	iS	T		
			1				Survey Res	ults				.	
	Well	i				At Opening			After Vent				4
	ID	Status	Year	Qtr	BG	BZ_	WH	BG	BZ	WH	COMMENTS		
	1		1994	1	5.1	5.1	5.1					. [•
			1993	3	0.1	0.1	0.1					[]	
		İ	1993	2	0.1	0.1	0.1		1				
	70193	SAMPLE	1994	2	0	0	0						
			1994	1	5	5	5					ļ	
			1993	3	0.2	0.2	0.2						
	}	İ	1993	2	0.4	0.4	0.4		}				
	70293	SAMPLE	1994	2	0	0	o		1			-	
		1	1994	1	2.8	2.8	2.8						
		1	1993	4	1.1	1.1	1.1						
			1993	3	0.2	0.2	0.2						
			1993	2	0.4	0.4	0.4						
	70393	SAMPLE	1994	2	0	΄ ο	0					I	
	•		1994	1	2.6	2.6	2.6						
			1993	3	0.2	0.2	0.2						
			1993	2	0.6	0.6	0.6			İ			
			1993	2	0.4	0.4	0.75				•	1	
	70493	SAMPLE	1994	2	o	0	0						
]	1994	1	2.8	2.8	2.8						
			1993	2	0.6	0.6	6]	Ì			
			1993	4	1.1	1.1	3.4		ļ				
			1993	3	0.2	0.2	0.2						
	70593	SAMPLE	1994	2	0	0	0						
		3.2.2.2	1994	2	2.5	2.5	2.5]			
			1993	4	1.1	1.1	1.1						_
			1993	3	0.2	0.2	0.2					14	
			1993	2	0.8	0.8	0.8					1	4
	70693	SAMPLE	1994	2	0	0	0					ŀ	
	1		1994	1	5.1	5.1	5.1					ļ	
			1993	3	0.2	0.2	0.2						٠
	į		1993	2	0.3	0.3	0.3						
	70893	SAMPLE	1994	2	0	0.5	0		!				
	, , , , ,	3.2.2.2	1994	1	1	1	1						
			1993	3	0.2	0.2	0.2						
		-	1993	اء	امیا	اء ۽						Ì	
	71193	SAMPLE	1994	2 2	0.6	0.6	0.6						
	/11/5	JAME CE	1994	1	2.6	2.6	2.4				•		
			1993	4	0.4	0.4	0.4		ļ				
			1993	3	0.4	0.4	0.4						
			1993	2	0.2	0.2	0.2						
	71493	SAMPLE	1994	2		1	l l]	
	/1493	SAMPLE	1994	1	0	0	0						
	i		1993	3	2.2	2.2 0.2	2.2						
			I .	į.	0.2		0.2			i i			
ĺ	71693	CAN (D) C	1993	2	0.2	0.2	0.2						
	/1693	SAMPLE	1994	2	. 0	0	0			ا			
			1994	1	2.4	2.4	2.8	0	0	0			
		j i	1993	3	0.2	0.2	0.2						
	71000	0.43677	1993	2	0.2	0.2	0.2						
Ì	71893	SAMPLE	1994	2	0	0	0						
			1994	1	2.6	2.6	0.26						_
			1993	4	0.4	0.4	0.4	}					J
			1993	3	0.2	0.2	0.2						•
Ì			1993	2	0.2	0.2	0.2						
	72093	SAMPLE	1994	2	0	0	0						
		i i	1994	1	0	0	o	- 1		1			

			OCK I II	AISORO	CINDWAIL	ER SAMPL	INO MING	KEADING.	<u> </u>	
						Survey Resu	lts			
Well				4	At Opening			After Venti	ng]
ID	Status	Year	Qtr	BG	BZ	WH	BG	BZ	WH	COMMENTS
•		1993	3	0.2	0.2	4				No venting data
		1993	2	0.6	0.6	0.8				
72293	SAMPLE	1994	2	o	o	0]
		1994	1	2.4	2.4	6	0	0	c	
1		1993	3	0.2	0.2	1.2				
	1	1993	2	0.2	0.2	1.8				
72393	SAMPLE	1994	2	0	0	o				
		1994	1	1.2	1.2	1.2				
		1993	4	5.8	5.8	5.8				į
		1993	2	0.6	0.6	0.6				,
72493	. ND	1994	2	o	0	o		!		
		1994	1	0.08	0.09	0.08				No venting data
		1993	4	0.3	0.3	0.3				
	· [1993	2	0.2	0.2	0.2	ĺ	,		

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well		, 		T		At Ope	ning		<u> </u>		After Ve	nting		r
	Status	Year	Qtr	BG	BZ	WH	BZ Diff	WH Diff	BG	BZ		BZ Diff	WH Diff	COMMENTS
0586	SAMPLE	1994 1994	2		0 0.6	0 0.6	0					0		
1		1993	4		1.2	3	ŏ		0.2	0.2	0.2	ŏ		
		1993	3		0.3	0.3	0					0		
		1993 1993	1 2		0.6 0.4	0.6 0.4	0					.0 .0		<u> </u>
		1992	3		0.4	0.4	ŏ					ŏ		
- A46Z	841 (D) E	1992	2		0.3	0.3	0					0		
0786	SAMPLE	1994 1994	2 1		10.8	10.8	0					0		ļ
		1993	4		0.2	0.2	ŏ	ŏ				ŏ		
		1993	3		0.2	0.2	0	0				0		
		1993 1992	1		0.8 0.2	0.8 0.2	0					0		
ļ		1992	2	1.4	1.4	3.2	0		0.5	0.5	0.5	0	0	
1386	SAMPLE	1992	1 2		0.2	0.2	-0.1 0	-0.1				0		
1386	SAMPLE	1993	4		0.2	0.2	0	0				0		
		1994	1	6.7	6.7	6.7	0	0				0	0	
		1993	3 2		0.2	0.2	0	0				0		
		1993 1992	3		0.2 0.2	0.2 0.4	0	0 0.2	0.4	0.4	0.4	0		<u> </u>
1		1992	2	0.4	0.4	0.3	G	-0.1	0.8	0.8	0.8	0	0	
1486	SAMPLE	1992 1994	1 2	0.3	0.3	0.3	0	0				0		
1400	DAIVIFLE	1994	1		2.4	2.4	0	0		,		0	_	
1		1993	4	0.2	0.2	0.2	0	0				0	0	
		1993 1993	3 2	0.4 0.4	0.4 0.4	0.4 0.4	0	0				0		
		1993	3	0.4	0.2	0.4	0	0.2	0.1	0.1	0.1	0		
		1992	2		0.4	0.3	0	-0.1				Ō		
1886	WLM	1992 1994	1 2	0.3	0.2	0.2	-0.1 0	0.1				0		
1000	VV LIVE	1994	î	5.8	5.9	5.9	0.1	0.1				0		No Venting data
		1993	2	0.1	0.1	0.1	0	0				0		
1		1992 1992	3 2	0.3 0.4	0.3 0.4	0.4 0.4	0	0.1 0	0.6	0.6	0.4	0		
		1992	ĩ	0.3	0.4	0.4	·· -0.1	-0 .1				. 0		
		1991	4	0.3	0.3	0.3	0	0				0		
1986	SAMPLE	1991 1994	2	0.2	0.2	0.2	0	0				. 0		
	0.01	1994	1	ŏ	0	ŏ	0	ŏ				ŏ		
		1993	4	0.4	0.4	0.4	0	0				0		
		1993 1992	2	0.1 0.4	0.1 0.4	0.1 0.4	0	0				0	0	
		1992	2	0.3	0.3	0.3	0	0				0	0	
		1992 1991	1 4	0.4 0.4	0.4 0.4	0.4 0.9	0	0	0.2		0.2	0		
2486	SAMPLE	1994	2	0.4	0.4	0.9	0	0.5	0.2	0.2	0.2	0		· · · · · · · · · · · · · · · · · · ·
		1994	1	0.5	0.5	0.5	0	0				0		
		1993 1993	3 2	0.3 0.4	0.3 0.4	0.3	0	0				0	0	-
		1992	3	0.4	0.4	0.4 0.3	0	0				0	0	
		1992	2	0.3	0.3	0.3	0	Ö				Ō	0	
		1992 1991	1	0.2 0.4	0.2 0.4	0.2 0.8	0	0 0.4	0	0	0	0		
3686	SAMPLE	1994	2	0.4	0.4	0.8	- 0	0.4				0		
		1994	1	5.5	5.6	5.7	0.1	0.2				0	0	No venting data
		1993 1993	3 2	0.1 0.4	0.1 0.4	0.1 0.4	0	0				0	0	
		1993	1	0.6	0.6	0.6	ŏ	Ö				0	0	
		1992	3	0.2	0.2	0.2	0	0				0	0	
		1992 1992	2 1	0.4 0.2	0.4 0.2	0.4 0.2	0	0				0	0	
3886	SAMPLE	1994	2	0.2	0	0.2	0	0						· · · · · · · · · · · · · · · · · · ·
		1994	1	5.9	6	6.2	0.1	0.3				0	0	No venting data
		1993 1993	4	0.2 0.1	0.2 0.1	0.2 0.1	0	0				0	0	
		1993	2	0.4	0.4	0.1	0	ŏ				Ö	0	
1		1993	1	0.4	0.4	0.4	0	0				0	0	<u> </u>
		1992 1992	3 2	0.2 0.4	0.2 0.4	0.2 0.4	0	0				0	0	
5486	WLM	1994	2	0.4	0	0.4	0					0	0	
		1993	2	0.4	0.4	0.4	0	0				0	0	
		1992 1992	3 2	1.6 0.8	1.6 0.8	1.8 0.8	0	0.2 0	0.4	0.4	0.4	0	0	
1		1992	1	0.2	0.2	0.2	ő	ő				0	ő	
		1991	4	0.2	0.2	0.4	0	0.2	0	0	0	0	o	
		1991 1991	. 2	0.2 0.4	0.2 0.4	0.2 0.4	0	0				0	0	
L		1231	. 4	0.4	0.4	0.4	U					<u>U</u>	- 0	

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well		т	г	 		At Op	ening	 			After Vei	nting		
ID	Status	Year	Qtr		BZ	WH	BZ Diff	WH Diff	BG	BZ	WH	BZ Diff	WH Diff	
B405586 =5586	WLM	1994 1993	2		0.1			,	•				0 0	
2220		. 1993	1	0.4	0.4	0.4	. () ()				o o	
		1992 1992	3		2.8 0.8					0.4	0.4		0 0 0 0	
		1992	ī		0.0								0 0	
		1991 1991	4		0.2			-					0 0 0 0	
5786	SAMPLE	1994	- 2		0.1								0 0	
		1994	1		1								0 0	
		1993 1993	2 1		0.8 0.2								0 0	
		1992	3	0.6	0.6	0.5						(0 0	
		1992 1992	2 1		0.7 0.2								0 0	
		1991	4		0.1		0.1			0.3	0.3		0 0	
5886	WLM	1994	2		0								0 0	
		1993 1992	2		0.4 0.6		0				_		0 0	
		1992	2	0.7	0.7	0.7	C	Ò)			(0	,
		1992 1991	1		0.2 0.2								0 0	
		1991	3	0.3	0.3		Č						ŏ	
1187	SAMPLE	1991 1994	<u>2</u>		0.3		0						0 0	
110/	JAWIFLE	1994	1		0.2		0						0	
		1993	3		0.2								0	
		1993 1993	2 1		0.2 0.2		0						0 0	
		1992	3	0.4	0.4	0.4	0	Ó				(0	
		1992 1992	2 1		4 0.3		0			0.4 0.3	0.4 0.3)	
1287	SAMPLE	1994			<u>0</u>					0.3	0.3) 0	
		1994	1		9		0					9		
		1993 1993	3 2		0.4 0.3	0.8 0.3	0.4 0					(No venting data
		1992	3	0.2	0.2	0.3	0	0.1	0.4	0.4	1.2	C	0.8	Day 2
		1992 1992	2 1		0.4 0.1	1.2 0.4	0			0.3 0.3	0.4 0.3	(Day 2
		1991	4	0.1	0.1	0.2	0	1.0	0.3	0.3	0.3_		0	
1587	SAMPLE	1994 1994	2		0 1.4	3	0	-		2.5	2.5	. 0		
		1993	4	0.2	0.2	0.2	0	0				č		
		1993 1993	3 2	0.2 0.4	0.2 0.4	0.2 0.4	0					0		
		1993	ī	0.4	0.4	0.5	0					0		
		1992	3		0.4	0.4	0					0		
1687BR	SAMPLE	1992 1994	2	0.2	0.4	0.4	0.2			4	4	0		2
		1994	1	1	·1	1	0	0				0	0	
		1993 1993	4	0.3 0.1	0.3 0.1	0.3 0.1	0					0	- 1	
		1993	2	0.2	0.2	0.2	ŏ					ŏ	- 1	
		1993 1992	1	0.3	0.3	0.3	0	_				0	-	
		1992	2	0.4 0.2	0.4 0.4	0.4 0.4	0.2	•	3.8	3.8	3.8	0		
1987	SAMPLE	1994	2	0		0	0	0				0		
		1994 1993	1	8.5 0.2	8.5 0.2	8.5 0.2	0					0		
		1993	2	0.4	0.4	0.4	0	0				0	0	
•		1992 1992	3 2	0.3 0.2	0.3 0.2	0.3 0.4	. 0			0.1	0.2	0		Day 2
		1992	ī	0.4	0.4	1.4	ő		0.1	0.1	0.2	Ö		No venting data
2787	WLM	1991 1994	3	0.2	0.3	0.3	0.1	0.1	0.3	0.3	0.3	0		
2/8/	WLM	1994	2	0.8	0.8	0.8	0	0				0		
		1993	2	0.3	0.3	0.3	0	0				0		
		1992 1992	3 2	0.3 0.6	0.3 0.6	0.2 0.9	0	-0.1 0.3	0.4	0.4	0.4	0		
		1992	1	0.1	0.1	0.2	0	0.1	0.9	0.5	0.5	-0.4	-0.4	
		1991 1991	4	0.2 0.2	0.2 0.2	0.2 0.2	0	0				0		
2987	SAMPLE	1994	2	0.2	0.2	0.2	0	- 0				0		
		1994	l	5	5	6	Ó	1				0	ol	No venting data
		1993 1993	3 2	0.3 0.1	0.3 0.1	0.3 0.1	0	0				0		
		1993	1	0.4	0.4	0.4	0	0				0	o	
		1992	3	0.3	0.3	0.3	0	0				0	ı	
		1992 1992	2 1	0.5 0.1	0.5 0.1	0.5 0.1	0	0				0		
		 -	<u> </u>				-	`						_

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well	Ι	T		Г		At Ope	ning		1		After Venting		1
ID	Status	Year	Qtr	BG	BZ	WH	BZ Diff			BZ	WH BZ Di		
3587	WLM	1994 1994	2 1	_	_	0 11.2	0			_		0 0	
		1992	3	0.2	0.2	0.1	ŏ					ŏ ŏ	
		1992	2		0.2	19.5	0					0 0	
		1992 1991	1 4		0.2 0.3	0.2	0					0 0	
		1991	3		0.3	0.3 0.1	0					0 0	
		1991	2	0.3	0.3	5.3	ŏ						No venting data
3687BR	SAMPLE	1994	2		0	0	0					0 0	
		1994	1 4		2.5 0.2	2.5	0					0 . 0	
		1993 1993	3		0.2	0.2 0.4	0					0 0	
		1993	2		0.1	0.1	Ö	ŏ			•	ŏ ŏ	
		1993	1	0.5	0.5	0.5	0					0 0	
		1992	3 2		0.3 0.2	0.3	0	0				0 0	
4387	WLM	1992 1994	. 2		0.2	2.4	0	2.2				0 0	No venting data
.207	*****	1993	2		0.2	0.2	ŏ	ŏ				o o	
		1992	1		0.1	0.1	0	0				0 0	
		1992	3 2		0.4 0.5	0.4	0	0				0 0	
•		1992 1991	4		0.3	250 0.2	0	249.5 0				0 0	No venting data
		1991	3		0.3	0.2	ŏ	Ŏ				ŏ ŏ	
		1991	2		0.4	0.8	0	0.4		0.2	0.2	0 0	
4487	WLM	1994 1994	2 1	5.5	5.5	5.5	0	0				0 0	
		1994	3	0.2	0.2	3.3 0.2	0	0				0 0	
		1992	2	4	4	17	Ö	13	0.6	0.6	0.6	ŏ ŏ	
		1992	1	0.2	0.2	0.2	0	0				0 0	
		1991	4	0.2	0.2	0.2	0	0				0 0	
		1991 1991	3 2	0.1 0.4	0.1 0.4	0.1 0.4	0	0				0 0	
4587BR	SAMPLE	1994	2	0.4	0.4	0.4	- 6				······································	0 0	<u> </u>
		1994	1	2.8	2.8	2.8	0	0				0 0	
		1993	3	0.3	0.3	0.3	0	0				0 0	
		1993 1993	2 1	0.2	0.2 0.6	0.2 0.6	0	0				0 0	
		1992	3	0.3	0.0	0.0	0	0				0 0	
		1992	2	4	4	4.5	Ō	0.5		0.2	0.2	0 0	
		1992	1	0.2	0.2	0.2	0	0				0 0	
5087	WLM	1994 1994	2	5.2	5.2	0 5.2	0	0				0 0	
		1992	3	0.3	0.3	0.3	0	0				0 0	
		1992	2	4	4	4.5	ŏ	0.5				0 0	No venting data
		1992	1	0.1	0.1	0.1	0	0				0 0	
		1991 1991	4	0.2 0.1	0.2 0.2	0.2 0.2	0	0				0 0	
		1991	2	2.4	2.4	2.4	0.1 0	0.1 0				0 0	No venting data
5187	SAMPLE	1994	- 2	0	0	- 0	0	ŏ				0 0	
		1994	1	3.6	3.6	3.6	. 0	0				0 0	
		1993	1	0.7	0.7	1	0	0.3	. 0	0	0	0 0	
•		1992 1992	3 2	0.4 0.3	0.4 0.3	0.4 0.3	0	0				0 0	
		1992	ī	0.1	0.1	0.3	ŏ	ŏ				0 0	
		1991	4	0.2	0.2	0.2	0	0				0 0	
<u> </u>	647 404 10	1991	3	0.2	0.2	0.2	0	0				0 0	
5487	SAMPLE	1994 1994	2 1	0 1.2	0 1.2	1.2	0	0				0 0	
		1993	3	0.1	1.2	0.1	0	0				0 0	
		1993	2	0.6	0.6	17	0	16.4	0.4	0.4	· 10	0 9.6	2nd day
		1991	2	0.2	0.2	0.2	0	0				0 0	
		1992 1992	3 2	0.3 0.4	0.3 0.4	0.2 0.3	0	-0.1 -0.1				0 - 0	
		1992	1	0.4	0.4	0.3	0	-0.1 0				0 0	
5587	SAMPLE	1994	2	0	0	0	0					0 0	
		1994	1	5.6	5.6	5.6	0	0			_	0 0	
		1993	3 2	0.02	0.02	, 1	0	0.98	0	0	0	0 0	
		1993 1992	3	0.3 0.3	0.3 0.3	0.3 0.2	0	-0.1				0 0	
			2	0.3	0.3	0.2	0	-0.1				0 0	
		1992			0.1	0.1	0	0		1		0 0	
		1992 1992	1	0.1	0.1			0					
	····	1992 1991	1 4	0.1	0.1	0.1	0					0 0	
5887	SAMPLE	1992 1991 1994	1 4 2	0.1	0.1	-0	0	0				0 0	
5887	SAMPLE	1992 1991 1994 1994	1 4 2 1	0.1 0 0.3	0.1 0 0.3	0.3	0	0	0.5	0.5	0.5	0 0	1941 EI
5887	SAMPLE	1992 1991 1994	1 4 2	0.1	0.1	-0	0	0	0.5	0.5	0.5	0 0	1% LEL
5887	SAMPLE	1992 1991 1994 1994 1993 1993 1993	1 4 2 1 4 3 2	0.1 0 0.3 0.3 0.2 0.3	0.1 0 0.3 0.3 0.2 0.3	0 0.3 0.4 0.2 0.3	0 0 0 0	0 0 0.1 0	0.5	0.5	0.5	0 0 0 0 0 0 0 0	1% LEL
5887	SAMPLE .	1992 1991 1994 1994 1993 1993	1 4 2 1 4 3	0.1 0 0.3 0.3 0.2	0.1 0 0.3 0.3 0.2	0 0.3 0.4 0.2	0 0 0	0 0 0.1 0	0.5	0.5	0.5	0 0 0 0 0 0	1% LEL

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well						At Op	ening		т		After Venting		
ID	Status	Year	Qtr	BG	BZ	WH	BZ Diff	WH Diff	BG	BZ	WH BZ Diff		
6087	SAMPLE	1994 1994	1		0		(0 0	
		1993	4		0.5		č					Ó	
		1993	3		0.2		9	-				0	
		1993 1992	1		0.5 0.1		(0 0	
		1992	2		1.4		č			0.2		Ö	
200		1992	1		0.2		-0.1					0 0	
6187	SAMPLE	1994 1994	1	2 0	0		(0 0	
		1993	4	. 0	0.2	0.2	0.2	0.2	:		4	o o	1% EXP
		1993	4		0.2		(0 0	
		1993 1993	3		0.2 0.6		0.4) 0	
		1992	3	0.1	0.1	0.1	() ()			0	
6287	WLM	1992 1994	2		1.2							0 0	
0287	W LAVI	1993	î		0.2		č					ŏ	
		1992	3		0.1		0			0.3		-0.3	
		1992 1992	2		I.2 0.2		0			0.2	0.2		
		1991	4		0.3		Č						
		1991	3		0.4		C						
B400489	WLM	1991 1994	$\frac{2}{2}$	1.5	1.5							0	
		1993	2	. 0	0	0	C) (Ċ	Ö	
		1993 1992	1		0.4 3		0			0.2	0.2		
		1992	2		0.5	-	ď			0.4	0.2		
		1992	1	. 0	0		Q				(
		1991 1991	3		0.2 0.2		0				(
B201189	WLM	1994	2		0.2						- (
		1993	1		0.8		0			0.5	0.5		
		1992 1992	2		2 0.8		0			0.8	0.8		
		1992	1	. 0	0	0	. 0				(0	
		1991	4		0.2 0.2		0	-			(
		1991 1991	3 2		0.2		0				Č		
B201589	WLM	1994	2	0	0	0	0				(
		1993 1992	1		0.2 2.4		0				(
		1992	2	. 2	2	150	0	148		0.2	0.2	0	
		1992 1991	1		0		0				(
		1991	3		0.2		0				ď		
		1991	2		2		0						
B202589	WLM	1994 1993	1		0.3	0 0.5	0			0.4	0,4		
		1992	3		2.4	2.4	ő			0.4	0.4		
		1992	2		1.2	4	0			0.5	0.5		
		1992 1991	1 4	-	0 0.2	0 0.2	0	-			0		
		1991	3	0.2	0.2	0.3	0	0.1			Ċ	0	No venting data
B302789	WLM	1991 1994	<u>2</u>		0.2	0.2	0				0		
B302769	· ·	1993	î		0.2	0.2	0				ŏ		
		1992	3		0.2		0			0.2	0.3		Day 2
		1992 1992	2 1		0.4 0	0.4 0	0				. 0		···
		1991	4		0.15	0.15	ŏ				Ö		
		1991	3		0.2	0.2	0				0		
B302989	WLM	1991 1994	$\frac{2}{2}$		0.2	0	0				0		
	***	1992	3	2.8	2.8	2.8	0	0			0	0	
		1992	2		0.7	0.6	0				0		
		1992 1991	1 4	0 0.2	0 0.2	0 0.2	0				. 0		
		1991	3	0.3	0.3	0.3	0	0			0	0	
		1991 1991	2 1		0.3 0.3	0.3 0.3	0 0.1	0 0.1			0		No venting data
B203189	WLM	1991	2		0.3	0.3	0.1						140 ACUITUR CIVIN
		1993	2	0.4	0.4	0.4	0	0			0	0	
		1993 1992	1	0.3 0.4	0.3 0.4	0.3 0.4	0	0			0		
		1992	. 2		0.4	0.4	0	0			0		
		1992	1	0.6	0.6	0.7	0	0.1	0.2	0.2	0.2 0	0	
		1991 1991	4	0.3 0.2	0.3 0.2	0.3 0.2	0	0			0		
		ואלו		0.2	0.2	0.2							

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

				T		At Dec	ning -				After Venti-			
Well	Status	Year	Qtr	BG	BZ	At Oper WH	BZ Diff	WH Diff	BG	BZ	After Ventin	g Diff WI	H Diff	COMMENTS
B203489	WLM	1994	2	0	0	0	0	0				0	0	
1		1993	2		0.3	0.3	0					0	0	
ļ		1993 1992	1	0.2 2	0.2	0.7 2	0			0.2	0.2	0	0	
		1992	2		0.4	0.4	0					ŏ	ŏ	
		1992	ī	0.4	0.4	0.4	Ō					Ō	0	
		1991	4		0.3	0.3	0					0	0	
B203589	WLM	1991 1994	3 2		0.2	0.2	0					0 –	0	
B203389	ATIVI	1993	2		0.6	0.6	o					Ö	ŏ	
		1993	ī	0.2	0.2	0.2	ŏ					Ö	0	
		1992	3	1.8	1.8	1.8	0					0	0	
ľ		1992	2		1.7	150.2	0			0.2	0.2	0	0	
:		1992 1991	1		0.4 0.3	0.4 0.3	0					0	0	
		1991	3		0.4	0.4	ŏ					ŏ	ŏ	
B203889	WLM	1994	2		0	0	0					0	0	
		1993	2		0.6	0.6	0					0	0	
		1993 1992	i 3		0.2 1.8	0.2 1.8	0					0	0	
		1992	2		1.7	2.1	ŏ			0.3	0.3	ŏ	ŏ	
		1992	ī	0.2	0.2	0.2	ŏ				- · -	0	0	
	•	1991	4		0.3	0.3	0					0	0	
Pacasas	11917	1991	3		0.2	0.2	0					0	- 0	
B203989	WLM	1994 1994	2 1		0	0	0	-				0	0	
		1993	i	0.4	0.4	0.4	ŏ					ŏ	ŏ	
		1992	3	1.9	1.9	1.9	Ó	0	•			0	0	
ı		1992	2		1.5	2	1.35			0.3	0.3	0	0	
İ		1992 1991	1 4	0 0.2	0 0.4	0 0.4	0 0.2					0	0	No venting data
		1991	3		0.4	0.4	0.2					0	0	
B204089	WLM	1994	2		0	0	ō					0	0	
		1994	1		6.8	6.8	0	,				0	0	
1		1993	1		0.3	0.3	0					0	0	
į		1992 1992	3 2		0.5 1	0.5 1.2	. 0			0.4	0.4	0	0	
		1992	1		4	4.8	ŏ			0.3	0.3	ŏ	ő	
		1991	4		0.3	0.3	ŏ					ō	0	
		1991	3		0.2	0.4	0					0	0	
B204189	WLM	1994	2		0	0	0					0	0	
		1994 1993	1		8 0.5	0.5	0			•	•	o	0	
		1992	3		0.5	0.5	Ö					ō	ŏ	
		1992	2	1	1.2	0.8	0.2			0.4		0	0	
		1992	1	4	. 4	5	. 0		0.3	0.3	0.3	0	0	
		1991 1991	4		0.3 0.2	0.3 0.2	0					0	0	
B405289	WLM	1994	$\frac{3}{2}$		0.2	0.2	ŏ					- ŏ	- 0	
		1993	2		0.2	0.2	0	0				0	0	
		1993	1		0.2	0.2	0					0	0	
		1992 1992	3 2		3.4 0.7	3.6 0.6	0		0.2	0.2	0.2	0	0	
		1992	1		0.7	0.4	Ö					Ö	ŏ	
		1991	4		0.1	0.1	ŏ					0	0	
		1991	3	0.2	0.2	0.2	0					0	0	
B405489	WLM	1994	2		0	0	0					0	0	
		1993 1993	2 1		0.3 0.2	0.3 0.2	0					0	0	
		1992	3		3	4.2	0.4			0.2	. 0.2	ŏ	ő	
		1992	2	0.3	0.3	0.3	0	0				0	0	
		1992	1	0	0	0	0					0	0	
		1991	4		0.2	0.2	0					0	0	
B405689	WLM	1991 1994	$\frac{3}{2}$		0.1	0.1	0					0	0	
		1993	2		0.3	0.3	ŏ					Ö	ŏ	
		1993	1	0.8	0.8	0.8	0	0				0	0	
		1992	3		2.2	2.8	0			0.1	0.1	-0.1	-0.1	
		1992	2	1.2	1.2	0.8 0	0					0	0	
		1992 1991	1 4		0.1	0.1	-0.1					0	0	
		1991	3		0.1	0.2	0					ŏ	ő	
B405989	WLM	1994	2	0	0	0	0	0				0	0	
-		1993	1	0.2	0.2	0.2	0					0	0	
		1992	. 3		1.8	1.8	0					0 0	0	
		1992 1992	2		0.7 0.4	0.5 0.4	0					0	0	
		1992	4		0.4	0.1	0.1			0.2	0.2	-0.1	-0.1	
		1991	3		0.2	0.2	0.1					0	0	
		1991	2		0.3	0.3	0	0				0	0	

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well		T				At Op	ening		1		Iter V	enting		T
ID	Status	Year	Qtr	BG	BZ	WH	BZ Diff	TWH Diff	BG	BZ [WH	BZ Diff	TWH Diff	COMMENTS
B106089	SAMPLE	1994 1994	2	2.1	2.1	-		•				() 0	
		1993	4	0.3	0.3	0.3	() ()			Ċ	Ò	
		1993 1993	3 2		0.3)			(-	
		1993	1	0.3	0.3			0 0.						No venting data
		1992	3		0.1) (/ (
B206289	SAMPLE	1992 1994	2		0.4			O -0.						
2200203	07442 20	1994	ĩ	4.5	4.5	5	. (0.:				Č	Ö	no venting data
		1993	4		0.2							(
		1993 1993	3 2		0.3 0.3								-	
		1993	1	0.2	0.4	. 0	0.2	2 -0.3	2			Č		
		1992 1992	3 2		0.1 0.4) ((
B206589	SAMPLE	1994	- 2		0.4)						
		1994	1		5.5							9	-	
		1993 1993	3 2		0 0.2							. (
		1993	1	0.3	0.3	0.4	. (0.1	!			Ċ	-	No venting data
		1992	3		0.1							0		
		1992 1992	2 1	0.4 0.3	0.4 0.2									
B206789	SAMPLE	1994	2	0	0	0	() ()					
		1994 1993	1 4		0.02 0.2							0		<u> </u>
		1993	3	0.1	0.1	0.1	() ()			Č	0	
		1993	2		0.2							0	_	no ventino data
•		1993 1992	1		0.8 0.2							Č	-	no venting data
		1992	2	1.6	1.6	1.6) (1				0	
B206889	SAMPLE	1994 1994	2 1		0 0.2									·
		1993	4		0.2							Ö		
		1993	3		0.2							0	_	
		1993 1992	1 3		0.5 0.2			-				0		, , , , , , , , , , , , , , , , , , , ,
		1992	2	1.6	1.6	100.4	. (0.3	0.3	O	Ŏ	
B207289	WLM	1992 1994	1 2		0.3							0		
B207209	WLIVI .	1994	í		0.09	-						Ö		
		1993	1		0.4							0	-	
		1992 1992	3 2		0.4 1.6			_				0		No venting data
		1992	1	0.2	0.2	0.2	. 0) ()			0		
		1991 1991	4		0.2 0.2							0		
P207389	SAMPLE	1994	- 2		0.2							- 8		
		1994	1		0.3							0		
		1993 1993	4		0.2 0.3			-				0		
		1993	2	0.3	0.3	0.3	0	Ò				Ō	•	
		1992	3 2		0.3	0.3						0	0	
		1992 1991	4		0.3 0.2	0.3 0.3	0			0.2	0.2	0	0	
P209289	SAMPLE	1994	2	0	0	0	C	0				0		
		1994 1993	1 4	0 0.3	0.3	0 0.3						0		
		1993	3	0.1	0.1	0.1	0	Ò)			0	0	
		1993	2		1	200				0.4	0.4	0		
		1993 1992	1 3	0.3 0.3	0.3 0.3							0		
		1992	2	0.3	0.3	0.3	0	0	·			0	0	
P209589	SAMPLE	1994 1994	2	0.2	0.2							0		
		1993	3	0.3	0.3	0.3	0	0				0	0	
		1993	2		0.2	0.2	0					0		
		1992 1992	3 2	0.3 0.3	0.3 0.3	0.3 0.3					,	0		
		1992	ī	0.3	0.3	0.3	0	0				0	0	
7000700	0.000	1991	4	0.4	0.4					0.2	0.2	0		
P209789	SAMPLE	1994 1994	2	0	0							0		
		1993	4	0.6	0.6	0.6	0	. 0				0	0	
		1993	3	0.2	0.2	0.2						0		No ventino data
		1993 1992	2	0.4 0.3	0.4 0.3	2 0.3	0					0		No venting data
			2	0.3	0.3	0.3						Ŏ		
		1992 1992	4	0.1	0.1	0.1						0		

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

_ [Well		T.,				At Op	ening		T		fter Venting		
	ID P210189	Status SAMPLE	Year 1994	Qtr		BZ	WH	BZ Diff 0	WH Diff	BG	BZ	WH BZ Diff		
	F210107	UPLVII LIE	1994	1	0.04	0.04	0.04	0	0			Ċ	0	
			1993 1993	4		0.5 0.3	0.04 0.3	0				(
- 1			1993	2		0.6	4	ŏ			0.5	1 6		
- 1	•		1993 1992	1 3		0.4 0.3	1 0.3	0				(
			1992	2		0.3	0.5	0				(No venting data
ı	B410589	SAMPLE	1994	2		0	0							
- (1992 1992	3		0.4 0.7	0.4 1	0			0.3	0.3		
			1992	1		0.3	0.3	0	_			C		
			1991 1991	4		0.2 0.2	0.2 0.2	0	-			(
			1991	2	0.4	0.4	0.4	0	0			C	0	
-	B410689	SAMPLE	1991 1994	1 2		0.2	0.2	0						
			1992	3	0.4	0.4	0.4	0	0			Q		
			1992 1992	2 1		0.8 0.3	0.7 0.3	0						
- 1			1991	4	0.3	0.3	0.3	Ó	0			C	0	
- 1			1991 1991	3 2		0.2 0.4	0.3 0.4	0 0.1	0.1 0.1	0.2 0.4	0.2 0.4	0.2 0 0.4 0		
			1991	1	_0	0	0	0	0			C	0	
- [B213789	SAMPLE	1994 1994	2		0 5.6	0 5.8	0.1	0.3		,	0		no venting data
			1993	4		0.4	0.4	0.1				O	0	
			1992	3		0	0	0				. 0		
-	B315289	WLM	1992 1994	2		0.4	0.4	0				0		No venting data
ľ	P115589	SAMPLE	1994	2	0	0	2.1	0	2.1	0	0	0 0	0	
			1994 1993	1 4		3 0.8	3 0.8	0				0		
			1992	3	0.3	0.3	0.3	0	0			O	0	
-	P115689	SAMPLE	1992 1994	2		0.4	0.5	0						No venting data
- 1		0.0.0	1994	1	2	2	4.9	0	2.9	0.7	0.7	O	-0.7	
			1993 1992	4		0.6 0.4	0.6 0.4	0				0		
			1992	2	0.5	0.5	0.5	0	. 0		_	0	0	
	P416889	SAMPLE	1994 1994	2		0 22	0	. 0	-		20	2.8		
- [1993	1 4		0.33 0.6	0.35 0.6	0		2.8	2.8	2.8		
			1992	3		0.3	0.3	0				0		
H	B218789	WLM	1992 1994	2		0.4	0.4	0				0		
			1992	3	0.1	0.1	0.1	Ō	0			0	0	
ſ	•		1992 1992	2 1		0.3 0.3	0.3 0.3	0				0		
			1991	4	0.2	0.2	0.2	0	0			0	0	
			1991 1991	3 2		0.1 0.4	0.1 2.2	0	0 1.8	0.4	0.4	0.6		
			1993	2		0.3	0.3	ŏ	0		0.4	. 0		
			1992	3		0.3	0.3	0	0			0		
-	00191	SAMPLE	1992 1994	- 2 2		5.2	<u>5.8</u> 0	0		0.8	0.8	0.8 0	0	
			1994	1	1.2	1.2	1.2	0	0			0	0	
			1993 1993	4		0.2 0.02	0.2 0.02	0 0.02	-			0		No venting data
			1993	2	0.4	0.4	0.4	0	0			0	0	
			1993 1992	1	0.5 0.3	0.5 0.3	1 0.3	0				0		
L			1992	2	0.4	0.4	0.4	0	0			0	0	
ſ	00391	SAMPLE	1994 1994	2		0.2	0.2	0				0		
			1993	3	0.1	0.1	0.1	0	0			0	0	
			1993 1993	2 1		0.2	0.2	0	0			0		No venting data
			1993	4		0.4 0.2	0.2	0	0.6 0			0		THO ACUITUR GRAFT
			1992	3	0.3	0.3	0.3	0	0			0		Y
-	00691	SAMPLE	1992 1994	2		0.2	0.4	0	0.2			0		No venting data
			1994	1	6	6	6	0	0			0	0	
			1993 1992	4	0,2 0,6	0.2 0.6	0.2 0.6	0	0			0		 -
L			1992	2	4.8	4.8	5.4	0	0.6			0	0	No venting data
	00791	WLM	1994 1992	2		0.4	0.4	0	0			0		
			1992	2		5.2	6	0	0.8	0.2	0.2	0.2 0	0	
	00991	WLM	1994	2	0	0	0	0	0			0		
			1992 1992	3 2		0.4 4	0.4	. 0	0 5			0		No venting data
L			1992	1	8	8	20	ŏ	12			0		No venting data
_														

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well	Cana	Ţ,, I					ening				Alter Venting	G 1 100 11 11 11 11 11 11 11 11 11 11 11	COMMENTS
ID 01291	Status SAMPLE	Year 1994	Qtr		BZ 0		BZDiff	TWH Diff		BZ	WH BZ Di	er wh Diff	
01291	SAMPLE	1994	1		5.8			0	-			0 0	
		1993	2		0.2			Ď (0 0	
		1993	4		0.4			0 (0 0	
		1992	3		0.4			0 (0 0	Name in the
		1992 1992	1		0.4 7.2			0 0.3 0 1.4				0 0	No venting data No venting data
01391	SAMPLE	1994			'.2			0				0 0	
		1994	1		2.8	2.8	3 () ()			0 0	
		1993	4		0.2) (0 0	
		1993	3		0.2			0 (0 0	
		1993 1993	2		0.6 0.4) (0 0	
		1992	3		0.4	0.4		Ď				0 0	<u> </u>
į į	_	1992	2		0.2	0.3		0.					No venting data
01991	SAMPLE	1994	2		- 0) (0 0	
-		1994 1993	1		1 0.2	0.2) (0 0	
		1993	3		0.2	0.3						0 0	
		1993	2		0.3	0.3		5				0 0	
		1993	1		0.6	0.6) (0 0	
		1992	2		4.8			0.3				0 0	No venting data
02001	SAL MIE	1992 1994	3		0.1 0	0.1) (0 0	
02091	SAMPLE	1994	1		4.2	8.4		4.3					No venting data
		1993	4		2.6	9.2						o o	No venting data
		1993	3		0.2	25	; (0 0	Rapid dissipation
'		1993	1		0.4	0.4						0 0	
		1992 1992	3		0.2 0.2	0.2 0.2						0 0	
		1992	1		1.6	2.4							No venting data
02191	WLM	1994	<u>-</u> 2		0	- 0					 -	0 0	
		1992	3		0.4	0.4						0 0	
		1992	2		0.2	6.5						0 0	No venting data
		1992 1991	1		1.8 4.1	5 4.1						0 0	No venting data
02291	SAMPLE	1994			7.1	7.1						ŏ ŏ	
		1994	ĩ		0.2	0.4			!			0 0	No venting data
		1993	4		0.2	22				0.2	20	0 19.8	
		1993	3		0.2	0.2				0.5	0.5	0 0	1 Min. venting
		1993 1992	1 3		0.5 0.3	0.3				0.5	0.5	0 0	1 Min. Venting
		1992	2		0.5	0.3				1	1	0 0	
		1992	1	2	2	2) (0 0	
02491	SAMPLE	1994	2		0							0 0	
		1994 1993	1		0.2 2.2	0.2 2.2						0 0	
		1993	3		0.2	0.2						0 0	
		1992	3		0.4	0.4						o o	•
		1992	2		0.5	0.5						0 0	
		1992	1	1.5	1.5	14			8.2	8.2	8.2	0 0	•
02591	SAMPLE	1991 1994	<u>4</u>		4.4	5.2						0 0	
02391	SAMPLE	1994	1	_	3.5	3.5	-					0 0	
		1993	4		2	2						0 0	
		1993	3		0.1	0.1						0 0	
		1993	2		0.4	0.4						0 0	
		1993 1992	1	0.7 0.1	0.7 0.1	0.7 0.1						0 0	
		1992	2		4.8	6.6				0.4	- 0.4	ŏ	
02691	SAMPLE	1994	2	_	0	0						0 0	
		1994	1		0.2	0.2						0 0	
		1993	4		0.9	0.9						0 0	
		1993 1993	3 2		0.3 0.2	0.3 0.2						0 0	
		1993	î	0.8	0.8	0.2						0 0	
		1992	3		0.3	0.3						0 0	
		1992	2		0.5	1.5				0.5	0.5	0 0	
02791	WLM	1994	2		0	. 0						0 0	
		1992 1992	3 2		0.1 0.2	0.1 0.2						0 0	
		1992	1	2.8	2.8	6							No venting data
02891	WLM	1994	- 1		0	0						0 0	
- · · ·		1994	1	11	11	11.5	0	0.5					No venting data
		1993	' 4		0.2	0.2						0 0	
		1993	3		0.3	0.3						0 0	
		1993 1992	2		0.2 0.2	0.2 0.2						0 0	
		1992	2		0.2	0.2						0 0	
		1992	ī	8.8	8.8	11.8							No venting data

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

	WAIT				т		At Ope	ning			 ,	Her Ve-	<u> </u>	T
	Well ID	Status	Year	Qtr	BG	BZ	WH	BZ Diff	WH Diff	BG	BZ T	Itter Ventin	g Diff WH Diff	COMMENTS
	02991	SAMPLE	1994	2	0	0	0	0	0				0 0	
			1994 1993	1		0.2 0.2	0.2 0.2	0	0				0 0	
			1993	3		0.3	0.3	ŏ	ŏ				ŏ ŏ	
			1993	2	0.6	0.6	0.6	0	0				0 0	
			1992 1992	3		0.2 0.2	0.2 0.2	0	0				0 0	
			1992	1		4.8	4.8	1	1	1.6	1.6	1.6	0 0	
1	03091	SAMPLE	1994	2	. 0	0	0	0	0				0 0	
			1994	1		1	1	0	0				0 0	
			1993 1993	4		2.2 0.3	3 0.3	0	0.8 0				0 0	
			1993	2		0.2	0.2	ŏ	ŏ				ŏ ŏ	
			1993	1		0.6	0.6	0	0				0 0	
			1992 1992	3 2		0.3 0.2	0.3 0.2	0	0				0 0	
}	03191	WLM	1994	- 2		0.2	0.2						0 0	
1			1994	1	11.5	11.5	11.5	0	0				0 0	
			1993 1992	4		0.3 1.5	0.3 1.5	0	0				0 0	
			1992	2		0.2	0.2	0	0				0 0	
H			1992	1	8.6	8.6	10.2	0	1.6	0	0	0.2	0 0.2	
L		C-11 (OT N	1991	4		1.2	1.2	0	0				0 0	
	03591	SAMPLE	1994 1994	2		0.2	0.2	0	0				0 0	
			1993	4	0.6	0.6	0.6	0	ŏ				0 0	
			1993	3		0.3	0.3	0	0				0 0	
1			1993 1992	1 3		0.6 0.1	0.6 0.1	0	0				. 0 0	
- }			1992	2		0.1	0.1	0	0				0 0	
L			1992	1	7.2	7.2	8.4	0	1.2	0.2	0.2	0.2	0 0	Day 4
ſ	03691	SAMPLE	1994 1994	2 1		0	3.5	. 0	0 2.7				0 0	
- 1			1993	4		0.8 0.4	3.3 0.4	. 0	2.7				0 0	
			1993	3		0.2	0.2	ŏ	ŏ				o o	
-			1993	2		0.4	0.4	0	0				0 0	
			1993 1992	1		0.7 0.4	6 0.4	0	5.3 0				0 0	
			1992	2		0.4	0.4	0	0				0 0	
	04091	SAMPLE	1994	2	0	0	0	0	0				0 0	
			1994	1		2.8	2.8	0	0				0 0	
			1993 1993	4		0.2 0.2	0.2 0.2	0	0				0 0	
- [1993	2		0.4	0.4	ŏ	ŏ				o o	
			1993	1		0.6	0.6	0	0				0 0	
ľ			1992 1992	3 2		0.6 4	0,6 5	0	0 1	4.8	5	5.4	0 0 0.2 0.6	Day 2
H	04291	SAMPLE	1994	- 2		- 7	- 6	0		7.0		- J 4	0 0	
			1994	1		0.8	0.8	0	0				0 0	
1			1993 1993	4 2		0.3 0.2	0.3 0.2	0	0.				0 0	
			1992	3		0.2	0.2	0	0.1	0.4	0.4	0.4	0 0	
			1992	2		0.4	0.4	Ö	0	•••	•		0 0	
L	04401	61) m/ F	1992	1		4.8	6.2	0	1.4					No venting data
-	04491	SAMPLE	1994 1994	2		0 0.8	0.8	0	0				0 0	
			1993	4		0.8	0.2	ŏ	o				0 0	
		•	1993	2	0.03	0.03	0.03	0	0				0 0	
			1992	3		0.9	0.4	0	-0.5	^-	0.0	0.3	0 0	
-			1992 1992	2 1		0.4 7.8	0.6 8	0	0.2 0.2	0.2	0.2	. 0.2		No venting data
F	04891	WLM	1994			0	- 0	0	0.2				0 0	
			1993	2	0.2	0.2	0.2	0	0				0 0	
			1992 1992	3 2		0.4 0.3	0.4 0.3	0	0				0 0	
			1992	l		2	2.2	0	0.2	1	1	1	0 0	
L			1991	4	0	0	. 0	0	. 0	<u> </u>			0 0	
ſ	04991	SAMPLE	1994	2		0	0	0	0				0 0	
			1994 1993	1		0.1 0.2	0.1 0.2	0	0				0 0	
			1993	3		0.2	0.2	Ö	ő				o o	
			1993	1	0.6	0.6	0.6	0	0				0 0	
			1992	3		0.4	0.4	0	0				0 0	
			1992 1992	2 1		0.4 4.6	0.4 5	0	0 0.4	2	2	2	0 0	
+	05091	SAMPLE	1994			0	- 0	0	0.4	- _			0 0	
			1994	1	0.2	0.2	0.2	0	0				0 0	
		•	1993	4		0.2 0.2	0.2	0	0				0 0	
			1993 1993	3 1		0.2	0.2 0.6	0	0				0 0	
			1992	3		0.4	0.4	ŏ	ŏ				0 0	
			1992 1992	2		0.5 0.9	0.5 0.5	0 0.6	0 0.2	0.5	0.5	0.5	0 0	

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well ID	Status	Year	Otr	BG	BZ	At Ope	ning BZ Diff	WH Diff	BG	BZ	Iter Venting	f wh niff	COMMENTS
05291	ND	1994	2	0	0	0.1	0	0.1	<u> </u>	0	0	0 0	
		1992	3 2	0.3 0.4	0.3	0.3	0	0				0 0	
05391	SAMPLE	1992 1994	- 2	0.4	0.4	2.8	0	2.4				0 0	No venting data
	J. 1.12 22	1994	ĩ	0.8	0.8	0.8	ŏ	ŏ				ŏŏŏ	
		1993	3	0.3	0.3	0.3	0	0				0 0	
		1993 1993	2 1	0.2 0.5	0.2 0.5	0.2 0.5	0	0				0 0	
		1992	3	0.1	0.3	0.3	Ŏ	0				0 0	
		1992	2	0.2	0.2	0.2	ō	ō			•	0 0	
		1992	1	6.4	6.4	6.8	0	0.4	0.4	0.4	0.4		Day 2
05691	SAMPLE	1994 1994	1	0 2.8	2.8	2.8	0	0				0 0	
		1993	4	0.3	2.8 0.3	0.3	0	. 0				0 0	
		1993	3	0.3	0.3	0.4	ō	0.1				0 0	No venting data
		1993	2	0.2	0.2	0.2	0	0				0 0	
		1993 1992	1 3	0.6 0.2	0.6 0.2	0.8 0.2	0	0.2 0	•			0 0	No venting data
		1992	2	0.2	0.2	0.2	ŏ	ŏ				0 0	
06191	SAMPLE	1994	2	0	0	0.6	0	0.6	-	_			No venting data
		1994	1	0.3	0.3	0.3	0	0				0 0	
		1993 1993	4	2 0.1	2 0.1	2 0.1	0	0				0 0	<u></u>
		1993	2	0.8	0.1	0.1	ŏ	Ö				0 0	
		1993	1	0.7	0.7	0.7	0	0				0 0	
		1992	3	0.1	0.1	0.1	0	0				0 0	
06491	SAMPLE	1992 1994	2	0.3	0.3	0.3	. 0	0				0 0	
30-71	UT TANK TE	1994	î	ŏ	ŏ	ŏ	0	Ö				0 0	
		1993	4	0.2	0.2	0.2	0	0				0 0	
		1993	3	0.3	0.3	0.3	0	0				0 0	
		1993 1993	2 1	0.2 0.4	0.2 0.4	0.2 0.6	0	0	0.3	0.3	0.3	0 0	
		1992	3	0.4	0.4	0.6	0	0.2	0.3	0.3	0.3	0 0	
		1992	2	11.4	11.4	17.2	ŏ	5.8	0.4	0.4	0.4	o o	
06591	SAMPLE	1994	2	0	0	0	0	0				0 0	
	•	1994	1	1	1	1	0	0				0 0	· · · · · · · · · · · · · · · · · · ·
		1993 1993	4	0.4 0.4	0.4 0.4	0.4 0.4	0	0			•	0 0	
		1993	2	0.2	0.2	0.2	ŏ	ŏ				o o	
		1993	1	0.3	0.3	0.3	0	0				0 0	
		1992 1992	3 2	0.4 0.2	0.4 0.4	0.3 0.4	0 0.2	-0.1	5	5	5	0 0	
06691	SAMPLE	1994	2	0.2	0.4	0.4	0.2	0.2				0 0	
		1994	ī	1	Ī	Ī	ō	Ö				0 0	
		1993	4	0.2	0.2	0.2	0	0				0 0	
		1993 1993	3 2	0.3 0.1	0.3 0.1	0.3 0.1	0	0				0 0	
		1993	ì	0.1	0.1	0.1	0	Ö				0 0	
		1992	3	0.4	0.4	0.9	Ö	0.5	0.3	0.3	0.3	0 0	
0400)	0.1.001.0	1992	2	4.8	4.8	15	0	10.2	0.6	0.6	0.6	0 0	2 weeks later
06791	SAMPLE	1994 1994	2	0 1.8	0 1.8	0	0	0				0 0	
		1993	4	0.3	0.3	0.3	Ö	Ö				0 0	
		1993	3	0.3	0.3	0.3	ŏ	ŏ				o o	
		1993	2	0.4	0.4	0.4	0	0				0 0	
		1993 1992	1	0.5 0.3	0.5	0.8	0	0.3	0.3	0.3		0 0	
		1992	2	U.3 5	0.3 5	0.5 10	0	0.2 5	0.3 3.6	0.3 3.6		0 0.8	
06991	SAMPLE	1994	2	0	0	0	0	0	3.0			0 0	
		1994	1	4.5	4.5	4.5	0	0				0 0	
		1993 1993	4	0.2 0.2	0.2 0.2	0.2 0.2	0 0	0				0 0	
		1993	2	0.2	0.2	0.2	0	0				0 0	
		1993	ī	0.5	0.5	0.5	0	ŏ				0 0	
		1992	3	0.3	0.3	0.3	0	0	_	_		0 0	
07191	SAMPLE	1992 1994	<u>2</u>	0.2	0.2	1	0	0.8	1	1		0 0	Next month
01121	SAWIFLE	1994	1	1.5	1.5	1.8	0	0.3	2.2	2.2		0 0.6	
		1993	4	0.6	0.6	0.6	0	0				0 0	
		1993	3	0.3	0.3	0.3	0	0				0 0	
		1993	2	0.1	0.1	0.1	0	0				0 0	
		1993 1992	1	0.6 0.4	0.6 0.4	0.6 1.2	0	0 0.8				0 . 0	No venting data
		1992	2	0.8	0.4	1.2	-0.4	0.8					No venting data
07291	SAMPLE	1994	2	1.5	1.5	5.3	0	3.8				0 0	No venting data
		1993	4	0.4	0.4	0.4	0	0	٠.			0 0	
		1993 1993	3 2	0.2 0.1	0.2 0.1	4 0.1,	0	3.8 0	0.1	0.1		0 0	
		1773	4	-			0		,			0 0	
			1	0.5	0.5	U.3	U	0					
		1993 1992	1 3	0.5 0.3	0.5 0.3	0.5 0.4	0	0.1				0 0	

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

_	Well			F			At Ope	ning				After Venti	na		
	ID	Status	Year	Qtr	BG	BZ	WH]	BZ Diff	WH Diff	BG	BZ	WH B	Z Diff	WH Diff	
	07391	SAMPLE	1994 1994	2	2.5	0 2.5	0 11	0	0 8.5	1	1	5	0	0	Day 2
İ			1993	4	0.6	0.6	1.6	ŏ	1	0.4	0.4	Ĭ,	ŏ		Day 2
			1993	3	0.2	0.2	0.9	0	0.7	0.2	0.2	50	0		Day 2
ŀ			1993 1993	2 1	4 0.6	4 0.6	4.9 10	0	0.9 9.4	0.4 0.6	0.4 0.6	3.5 10	0		Day 2 Day 2
			1992	3	0.3	0.3	0.8	ŏ	0.5	0.5	0.5	0.5	ŏ	0	
┖	*****		1992	2		4	35	0	31	0.3	0.3	0.4	0		Next month
1	07891	SAMPLE	1994 1994	2	0.2	0 0.2	0 0.2	0	. 0				0	0	
			1993	4	0.2	0.2	0.2	ŏ	ŏ				ő	ŏ	
			1993	3	0.3	0.3	0.3	0	0				0	0	
			1993 1992	1 3	0.5 0.1	0.5 0.1	0.5 0.1	0	0				0	0	
			1992	2		0.1	1.6	ŏ	1.4	0.5	0.5	0.5	ŏ	ő	
	07991	SAMPLE	1994	2		0	0	0	0				0	0	
			1994 1993	1 4	0.2 0.4	0.2 0.4	0.2 0.4	0	0				0	0	
			1993	3	0.4	0.4	0.4	0	0				ő	0	
			1993	2	0.2	0.2	0.2	0	0				0	0	
			1993 1992	1	0.2 0.4	0.2 0.4	0.2 0.4	0	0				0	0	
1			1992	2	0.4	0.4	1.8	0	0 1.4				0	0	No venting data
Г	08091	SAMPLE	1994	2	0	0	0	0	0				0	0	
			1994	1 4	0.8	0.8	8.0	0	0				0	0	
			1993 1993	3	0.3 1.4	0.3 1.4	0.3 1.4	0	0				0	0	
			1993	1	1.4	1.4	1.4	0	0				0	0	
			1992 1992	3 2	0.3	0.3 0.4	0.3	0	0	0.0	0.0	^	0	0	Nort month
1			1992	1	0.4 5.5	0.4 5.5	0.6 6.4	0	0.2 0.9	0.6	0.6	0.6	0	0	Next month No venting data
Г	08291	WLM	1994	2	0	0	0	0	0				ŏ	Ö	
			1992	3	0.4	0.5	0.4	0.1	0	0.3	0.3	0.3	0	0	
			1992 1992	2	0.4 2.2	0.4 2.2	0.6 2.2	0	0.2 0	0.2	0.2	0.2	0	0	Next month
-	08491	WLM	1994	- 2	0	0	0	- 0	- 6				- ö	- 0	
			1992	3	0.3	0.3	0.3	0	0				0	0	,
			1992 1992	2	0.4 3.8	0.4 4.2	1 5.2	0 0.4	0.6 1.4	0.2	0.2	0.2	. 0	0	Next month
	08591	WLM	1994	2	0	0	0	0.7	0				· 6	0	
			1993	2	0.2	0.2	0.2	0	0				0	0	
			1993 1992	1 3	1.4 0.2	1.4 0.2	1.4 0.2	0	0				0	0	<u>. </u>
			1992	2	0.2	0.4	0.6	0.2	0.4	0.4	0.4	0.4	ŏ	ŏ	
L	00001	0.43.697.5	1992	1	2	2	3	0	1				. 0	0	
	08891	SAMPLE	1994 1994	2	0	0	0	0	0				0	0	Vented Quickly
İ			1993	4	0.4	0.4	30	ō	29.6				ŏ	_	No venting data
i			1993	3	0.3	0.3	50	0	49.7	0.2	0.2	50	0		Day 2
			1993 1993	2 1	0.2 0.5	0.2 0.5	0.2 12	0	0 11.5	0.4	0.4	12	0	0 11 6	Day 2
		•	1992	3	0.4	0.4	43	Ŏ	42.6	•	•		ō		No vetning data
_	09691	SAMPLE	1992 1994	2	0.6	0.6	0.8	0	0.2				0		No venting data
	V3031	SAWIPLE	1994	2	0 1.2	1.2	0 1.2	0	0				0	0	
			1993	4	0.4	0.4	0.4	Ŏ	Ö				ŏ	ŏ	
			1993	3	0.4	0.4	0.4	0	0				0	0	
			1993 1993	2 1	0.3 0.6	0.3 0.6	0.3 1.4	0	0 0.8				0	0	No venting data
			1992	3	0.2	0.2	0.2	0	0.8				ŏ	ŏ	
_	11791	SAMPLE	1992	2	3.8	3.8	5.2	0	1.4	0.7	0.7	0.7	0	0	
	11/71	Jample	1994 1994	2	9	9	9	0	0				0	0	·
			1993	4	0.6	0.6	0.6	0	0				0	ŏ	
			1993	3	0.1	0.1	0.1	0	0				0	0	
			1993 1993	2 1	0.2 0.4	0.2 0.4	0.2 1	0	0 0.6				0	0	No venting data
			1992	3	0.3	0.3	0.3	0	0				ő	ŏ	
	1190	04) 655	1992	2	0.2	0.2	0.4	0	0.2	0.2	0.2	0.2	0		Next month
	11891	SAMPLE	1994 1994	2 1	0 2.8	0 2.8	0.9 2.8	0	0.9				0	0	No venting data
			1993	4	3.2	3.2	3.2	0	0				0	0	· · · · · · · · · · · · · · · · · · ·
			1993	3	0.2	0.2	0.2	0	0				0	0	
			1993 1993	2 1	0.4 0.7	0.4 0.7	0.4 0.7	0	0				0	0	
			1993	3	0.7	0.7	0.7	0	0				0	0	

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well	γ	T				At Ope	ning				Iter Venting		
ID	Status	Year	Qtr	BG	BZ	WH	BZ Diff	WH Diff	BG	BZ Í	WH BZ Dit	T WH Diff	COMMENTS
12091	SAMPLE	1994	2		0	0	0	0				0 0	
		1994 1993	1 4	0.2	0.2	0.2	0	Q				0 0	
		1993	3		0.6 0.2	0.6 0.2	ő	0				0 0	
		1993	ĩ		0.6	0.6	ŏ	ď				ŏ	
		1992	3		0.4	0.4	ō	ō				0 0	L
		1992	2		0.5	1.5	0	1	0.3	0.3	0.3	0 0	
12191	SAMPLE	1994	2		0	0	0	0				0 0	
		1994 1993	14		1.2 5.2	1.2 2.1	0 3.1	0				0 0	L
		1993	3		0.2	0.2	3.1	ă				0 0	No venting data
		1993	2		7	0.3	6.7	Ŏ		0.8	2	0 1.2	
		1993	1	0.2	0.2	0.2	0	0			_	0 0	
		1992	3		0.1	0.1	0	0				0 0	
10001	*****	1992	2		0.2	0.2	- 0	0				0 0	
12891	WLM	1994 1992	3	0.3	0.3	0	0	0.1		0.2	0.3	0 0	
		1992	2		0.3	0.4 1	0	0.1		0.2 0.4	0.2 0.4	0 0	
12991	SAMPLE	1994	- 2		0.7	- i		0.0		V. 7		0 0	
		1994	1	0.2	0.2	0.2	Ō	Ō				o o	
		1993	4		0.2	0.2	0	0				0 0	
		1993	3	0.3	0.3	0.3	0	0				0 0	
		1993	2		0.3	0.3	0	0				0 0	
		1993 1992	1	0.6 0.3	0.6 0.3	0.6 0.3	0	0				0 0	
		1992	2		0.3	1.2	Ö	0.8	0.3	0.3			Next month
13091	SAMPLE	1994	$\frac{\overline{2}}{2}$	0.4	0.4	0	 	0.0				ŏ ö	
		1994	1	1.4	1.4	1.4	0	0				0 0	
		1993	4	0.2	0.2	0.2	0	0				0 0	
		1993 1993	3 2	0.3 0.3	0.3 0.3	0.3 0.3	0	0				0 0	
		1993	1	0.3	0.3	0.3	0	0				0 0	
		1992	3	0.5	0.4	0.3	-0.1	-0.2				0 0	
		1992	2	4.2	4.2	9	0	4.8	4.2	4.2		0 0.8	
13191	SAMPLE	1994	2	0	0	0	0	0				0 0	
		1994	1	2.5	2.5	3	0	0.5		1.2		0 0.8	
		1993 1993	4	0.4 0.3	0.4 0.3	0.4 0.3	0	0				0 0	<u> </u>
		1993	2	0.3	0.3	0.3	0	0				0 0	
		1994	4	0.3	0.3	0.3	ŏ	. 0				o o	
		1992	3	0.3	0.3	0.7	Ö	0.4	0.6	0.6		0 0	
		1992	2	0.2	0.4	0.4	0.2	0.2	0.4	0.4			Next month
13291	SAMPLE	1994	2	0	0	0	0	0				0 0	····
		1994 1993	1	0.8 0.4	0.8 0.4	0.8 0.4	0	0				0 0	<u></u>
		1993	3	0.4	0.4	0.4	ŏ	ŏ				0 0	
		1992	3	0.3	0.3	1	ŏ	0.7	0.4	0.4		o o	
		1992	2	0.4	0.6	2	0.2	1.6				0 0	No venting data
13491	SAMPLE	1994	2	0	0	0	0	0				0 0	
`		1994	1	0.2	0.2	0.2	0	0				0 0	
		1993 1993	4	3.1 0.3	3.1 0.3	3.1 0.3	0	0				0 0	
		1993	2	0.3	0.3	0.3	0	0				0 0	
		1993	ī	0.4	0.4	0.4	ŏ	ŏ				ŏ	
		1992	3	0.1	0.1	0.1	Ŏ	ŏ				o o	
1060		1992	2	0.6	0.6	1.2	0	0.6	4.4	4.4			Next month
13591	WLM	1994	2	0	0	0	0	0	- -	·		0 0	N
		1992 1992	3 2	0.2 3.4	0.2 2.4	0.5 3.8	0 -1	0.3 0.4	0.4	0.4			No venting data Next month
30991	SAMPLE	1994	2	- 3.4	- 2.4	3.8	1	0.4	U.4	0.4		0 0	Meyr Mount
•		1994	ī	ì	ì	ĩ	ŏ	ŏ				ŏ	
				0.3	0.3	0.3	ō	ō				o o	
		1993	4			0.2	0	0			1	o of	
		1993	3	0.2	0.2								
		1993 1993	3 2	0.3	0.3	0.3	0	0			(0 0	
		1993 1993 1993	3 2 1	0.3 0.8	0.3 0.8	0.3 0.8	0 0	0			(0 0	
		1993 1993 1993 1992	3 2 1 3	0.3 0.8 0.4	0.3 0.8 0.4	0.3 0.8 0.4	0 0 0	0	0.4	0.4	(0 0 0 0 0 0	Next month
33491	SAMPLE	1993 1993 1993 1992 1992	3 2 1 3 2	0.3 0.8 0.4 4.5	0.3 0.8 0.4 4.5	0.3 0.8 0.4 5	0 0 0	0 0 0.5	0.4	0.4	0.4	0 0 0 0 0 0	Next month
33491	SAMPLE	1993 1993 1993 1992	3 2 1 3	0.3 0.8 0.4	0.3 0.8 0.4	0.3 0.8 0.4	0 0 0	0	0.4	0.4	0.4	0 0 0 0 0 0	Next month
33491	SAMPLE	1993 1993 1993 1992 1992	3 2 1 3 2	0.3 0.8 0.4 4.5	0.3 0.8 0.4 4.5	0.3 0.8 0.4 5	0 0 0 0	0 0 0.5	0.4	0.4	0.4	0 0 0 0 0 0 0 0	Next month
33491	SAMPLE	1993 1993 1993 1992 1992 1994 1994 1993 1993	3 2 1 3 2 2	0.3 0.8 0.4 4.5 0 1 0 0.3	0.3 0.8 0.4 4.5 0 1 0	0.3 0.8 0.4 5 0 1 0	0 0 0 0 0 0	0 0 0.5 0	0.4	0.4	0.4	0 0 0 0 0 0 0 0 0 0	Next month
33491	SAMPLE	1993 1993 1993 1992 1992 1994 1994 1993 1993	3 2 1 3 2 2 1 4 3 1	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6	0.3 0.8 0.4 5 0 1 0 0.3 0.6	0 0 0 0 0 0 0	0.5 0.5 0 0	0.4	0.4	0.4	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	Next month
33491	SAMPLE	1993 1993 1993 1992 1992 1994 1994 1993 1993 1993	3 2 1 3 2 2 1 4 3 1 3	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4	0.3 0.8 0.4 5 0 1 0 0.3 0.6 0.4	0 0 0 0 0 0 0	0 0 0.5 0 0 0	-		0.4		Next month
		1993 1993 1993 1992 1992 1994 1994 1993 1993 1993 1993 1992	3 2 1 3 2 2 1 4 3 1 3 2	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5	0.3 0.8 0.4 5 0 1 0 0.3 0.6 0.4 6	0 0 0 0 0 0 0	0 0.5 0 0 0 0 0	0.4	0.4	0.4		Next month
33491 36191	SAMPLE	1993 1993 1993 1992 1992 1994 1994 1993 1993 1993 1992 1992	3 2 1 3 2 2 1 4 3 1 3 2 2 2 2 1 4 3 3 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5	0.3 0.8 0.4 5 0 1 0 0.3 0.6 0.4 6	0 0 0 0 0 0 0 0	0 0.5 0 0 0 0 0 0 0	0.4	0.4	0.4		Next month
		1993 1993 1993 1993 1992 1994 1994 1993 1993 1993 1993 1992 1994	3 2 1 3 2 2 1 4 3 1 3 2	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5	0.3 0.8 0.4 5 0 1 0 0.3 0.6 0.4 6	0 0 0 0 0 0 0	0 0 0.5 0 0 0 0 0 0 1.5	-		0.4 (0.4 (1.2 (Next month
		1993 1993 1993 1992 1992 1994 1994 1993 1993 1993 1992 1992	3 2 1 3 2 2 1 4 3 1 3 2 2 1 4 3 2 1	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5 0 4.6	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5	0.3 0.8 0.4 5 0 1 0 0.3 0.6 0.4 6	0 0 0 0 0 0 0 0 0	0 0.5 0 0 0 0 0 0 0	0.4	0.4	0.4		Next month
		1993 1993 1993 1992 1992 1994 1994 1993 1993 1992 1994 1994 1993 1993	3 2 1 3 2 2 1 4 3 1 3 2 2 1 4 3 1 4 3 1 1 4 3 1 1 1 1 1 1 1 1 1 1	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5 0 4.6 0.1 0.3 0.4	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5 0 4.6 0.1 0.3 0.4	0.3 0.8 0.4 5 0 1 0 0.3 0.6 0.4 6 0 0 0.3 0.4	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	0 0.5 0 0 0 0 0 0 0 1.5	0.4	0.4	0.4		Next month
		1993 1993 1993 1992 1992 1994 1994 1993 1993 1992 1992 1994 1994 1993 1993	3 2 1 3 2 2 1 4 3 1 3 2 2 1 4 3 2 1 4 3 2 1	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5 0 4.6 0.1 0.3	0.3 0.8 0.4 4.5 0 1 0 0.3 0.6 0.4 4.5 0 4.6 0.1 0.3	0.3 0.8 0.4 5 0 0.3 0.6 0.4 6 0.1 0.3	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	0 0.5 0 0 0 0 0 0 1.5 0	0.4	0.4	0.4		Next month

TABLE E-3
ROCKY FLATS GROUNDWATER WELLS WITH POSITIVE PID READINGS

Well	T			т		At Ope	ning			A	ter Venting		1
ID	Status '	Year	Qtr		BZ	WH	BZ DIII WH D	II BC	j E	3Z	WH BZ	Diff WH Diff	COMMENTS
36391	SAMPLE	1994 1994	2	0 4	0	4	0	0				0 0	'L
~		1993		• 0	ō	ō	ŏ	ŏ				ŏ ŏ	
		1993	3		0.1	0.1	0	0				0 0	
		1993 1992	1		0.8	0.8 0.3	0 0	0				0 0	
		1992		3 0.3 2 5.5	0.3 5.5	6		0.5	1	1	1	0 0	
37191	SAMPLE	1994	2	2 0	0	0	0	0				0 0	
		1994	1		2.6	2.6	0	0				0 0	
		1993 1993	3	0 3 0.3	0 0.3	.0.3	0 0	0				0 0	
		1993	2		0.4	0.4	Ŏ	ŏ				ŏ ŏ	
1		1992	3	0.4	0.4	0.4	0	0				0 0	
20001	0.45 005 5	1992	2		4.5	7.5	00		0.4	0.4	0.4	0 0	
38291	SAMPLE	1994	2		0 0.4	0.9	0	0.5	0.3	0.3	0.3	0 0	
1		1992	2		4.5	9			0.4	0.4	3	0 2.6	
38991	SAMPLE	1994	- 2		0	0	0	0				0 0	
		1994. 1993	1		2.8	2.8 0.1	0 0	0				0 0	
		1992	3		0.1 0.6	0.1	Ö	ŏ				0 0	
		1992	2		4.5	5.5	o	-	0.2	0.2	0.2	0 0	
40491	WLM	1994		2 0	0	0	0	0		<u> </u>		0 0	
		1992 1992	3		0.4 0.2	0.6 0.4			0.4 7.9	0.4 7.9	0.4 7.9	0 0	
41091	SAMPLE	1994		2 0	0.2	0.4	0	0		1.3	1.5	0 0	
1		1994	1	1 2	2	2	0	0				0 0	
		1993		4 0.3	0.3	0.3	0 0	0				0 0	
		1993 1993	3	3 0.2 2 0.2	0.2 0.2	0.2 0.2	0	0				0 0	
1		1993	ī		0	0	Ŏ	Ö				0 0	
		1992	,3		0.4	0.4	0	0				0 0	
10392	SAMPLE	1992 1994		2 0.4	0.4	1 0	0	0.6	0.5	0.5	0.5	0 0	
10392	SAMPLE	1994	1		0.2	0.2	ŏ	0				0 0	
Ì		1993	4		0.2	0.2	Ö	ō				0 0	
10/00		1992	3		0.6	0.8			0.4	0.4	0.4	0 0	
10592	SAMPLE	1994 1994	1	2 0	0	0	0	0				0 0	
		1993		4 0.6	0.6	0.6	Ö	ŏ				ŏ ŏ	
7 1		1993	3	0.2	0.2	0.2	0	0 -				0 0	
1.681000		1993		0.2	0.2	0.2	0	0				0 0	
A6.S1020		1993 1992	1		0.3 0.6	0.3 0.8	0 0	0 0.2	0.4	0.4	0.4	0 0	
10692	SAMPLE	1994			0.0	0	0	0	• • •			0 0	
		1994	1		0	0	0	0				0 0	
		1993 1993	3		0.6	0.6 0.2	0 0	0				0 0	
		1993	2		0.1	0.2	ŏ	Ö				0 0	
1		1993	1	0.3	0.3	0.3	0	0				0 0	
10000		1992	3		0.6	0.6			0.4	0.4	0.4	0 0	
10792	SAMPLE	1994 1994	1		0	0	0 0	0				0 0	
1		1993	4		0.2	0.2	Ö	ŏ				0 0	
		1993	3	0.3	0.3	0.3	0	0				0 0	
		1993	2		0.1	0.1	0	0				.0 0	
		1993 1992	1		0.3 0.2	0.3 0.4	0 0	0 0.2	0.4	0.4	0.4	0 0	
10892	SAMPLE	1994			0.2	0.4	- 0	0		7.7		0 0	
		1994	ļ	0.2	0.2	0.2	0	0				0 0	
		1993	4		0.2	0.2	0	0	0.4	0.4	0.4	0 0	
46192	SAMPLE	1992 1994	3		0.6	0.8	0	0.2	∪. ∓	U.4	0.4	0 0	
		1994	1		0.1	0.1	ŏ	ŏ				0 0	
		1993	3		0.2	0.2	0	0				0 0	
		1993 1992	2		0.2 0.2	0.2 0.3	0 0	0 0.1				0 0	No venting data
		1992	3		2.9	2.9	0	0				0 0	
40193	WLM	1994	2	2 0	0	1.1	0	E.1	0	0	0	0 0	
46393	WLM	1994	2		0	2.1		2.1	0	0	0	0 0	
59593	SAMPLE	1994 1994	2 1		0	0	0	0				0 0	
		1993	3		0.2	8			1.0	1.0	1.0	o o	Dissipated rapidly
		1993	2	0.2	0.2	500	0 49	9.8				0 0	Vented before puriging
		1994	ı		1	1	0	0				0 0	
70393	SAMPLE	1993 1994	3		0.1	0.1	0	0				0 0	
	- 111 LL	1994	1		2.6	2.6	ő	ŏ				o o	
N		1993	3	0.2	0.2	0.2	0	0				0 0	
'		1993	2		0.6	0.6	0	0				0 0	
		1993	2	2 0.4	0.4	0.75	00	35				<u> </u>	'L

APPENDIX F SPECIAL TASK HEALTH AND SAFETY PLAN

GROUNDWATER MONITORING PROGRAM SUBCONTRACTOR SPECIAL TASK

HEALTH AND SAFETY PLAN Revision Level___

Job No.

Page 1	of	14
--------	----	----

	G&G Special Task Project Manag	
Task		
Requested by		
Proposed Start-Up Date	19 Project/Task No.	
Prepared by/Reviewed	Rev. Levelby Groundwater Monitoring Progra	am Subcontractor
Tiopaida by/iteviewea	Health and Safety Officer	
Printed Name		
Signature	Date	19
Reviewed by Ground	water Monitoring Subcontractor Site	e Safety Officer
Printed Name		
Signature	Date	19
Approved	by EG&G Special Task Project Mar	nager
Printed Name		
Signature	Date	19
Title		

Note to Project Managers:

A signed and completed copy of the Health and Safety Plan and a signed and completed copy of the safety briefing (p. 14) <u>must</u> be included in the project file.

Groundwater Monitoring Program Subcontractor	SPECIAL TASK HEALTH AND SAFETY PLAN	Page <u>2</u> of <u>14</u> Job No.
2. Project Description:	^	
	·	
3. Location:		
4. Facility/Work Site Description:	i.	
5. Proposed Personnel and Tasks:		,
Project Manager		
Field Team Leader		
Proposed Field Team	Job Function	/Tasks

♥ : =♥	TAL TASK D SAFETY PLAN Page 3 of 14 Job No.
6. Confined Space Entry	
limited means of egress, which is subject to the deficient atmosphere, or other hazards, such as equipment be inadvertently activated while an emplimited to storage tanks, process vessels, bins,	rently used or intended for human occupancy, having a accumulation of toxic contaminants, a flammable or oxygen engulfment, or electrical or mechanical hazards should bloyee is in the space. Confined spaces include but are not boilers, ventilation or exhaust ducts, air pollution by vaults, sewers, septic tanks, and open top spaces more disposal trenches, sumps and vats.
Will this task require entry into any confined	YES - Describe below
or partially confined space?	No
7. Cutting and Welding	
Will this task involve use of a cutting torch or welding?	YES - Describe below
8. Other Potential Hazards	
Chemical	Trips, Slips, Falls
Radiological	Trenching/Shoring
Fire/Explosion	Heavy Equipment/Vehicular Traffic
Heat Stress	Overhead Hazards
Electrical	Unstable/Uneven Terrain

9. I, ________, attest that this information is accurate to the best of my knowledge and hereby request a Health and Safety Plan for the task(s) designated above.

___ Machinery/Mechanical Equipment

Signature Date
Title

_Other - Describe below

	r Monitoring Progra	m Subcontracto	or HEALTH AI	CIAL TASK ND SAFETY PLAN	l		Pa Job N	age <u>4</u> of <u>14</u> lo.
10. Chemic	al/Radiological Haz	ard Evaluation	•					
Was	te Media			Hazaro	dous Character	istics		
	Airborne Contamin	ation		Igr	nitible			
	Surface Contamina	tion		Cor				
	Contaminated Soil			Rea				
	Contaminated Grou	ndwater		Ext				
	Contaminated Surf	ace Water		Tox	cic (non-radio	logical)		
	Solid Waste			Rac	lioactive			
_	Liquid Waste							
	Sludge							
	k will involve the i	•		-		listed below a	at concenti	rations or
		hazardous to t	he health of	-	onnel.	listed below a	at concent	rations or
in quant	ities which may be I Inhalation of Gases/	Primar Inhalation of Dusts/	he health of y Hazard (Rat	e: low, med, Dermal Absorption of Solids/ Liquids and/or Skin	Dermal Absorption of Gases/	Corrosive/	lgnit-	Reactivit
	ities which may be I	hazardous to t Primar Inhalation	he health of	e: low, med, Dermal Absorption of Solids/ Liquids and/or	high, ext) Dermal Absorption			Reactivit

				SF	ECI	AL TASK	
Groundwater	Monitoring	Program	Subcontractor	HEALTH	AND	SAFETY	PLAN

Instrument

Page <u>5</u> of <u>14</u> Job No.

Specific Action

nstrument	Monitor	ing Freque	ency		
PID (HNU, OVM) w/eV lamp	Cont.	15min.	30min.	hourly	other
DVA	Cont.	15min.	30min.	hourly	other
Combustible Gas Indicator	Cont.	15min.	30min.	hourly	other
H2S Detector	Cont.	15min.	30min.	hourly	other
Colorimetric Detector Tubes	Cont.	15min.	30min.	hourly	other
Other (describe below)	Cont.	15min.	30min.	hourly	other
otion/Other:					

Action Level

Groundwater Monitoring Program Subcontractor	SPECIAL TASK HEALTH AND SAFETY PLAN		Page <u>6</u> of <u>14</u> Job No.
13. Personal Monitoring			
Passive Dosimeter	Personal Air Sampling	Other	
Description/Other:			
14. Biological Monitoring/Medical Surveill This project requires medical sur the routine medical surveillance	veillance or biological mor		eyond the provisions of
Description:			
			,
15. Onsite Control			
Control boundaries have been established, and Decontamination Line, Contamination Control identified as follows:			
(Name) has lithis task. No unauthorized person shall be	been designated to coordina		the work site during

	SP	ECI	\L	TASK		
Δı	TH	AND	C	EETV	DI	ΔW

Groundwater Monitoring Program Subcontractor HEALTH AND SAFETY PLAN

Page $\underline{7}$ of $\underline{14}$ Job No.

Location	Job Function/Task		. In	itia	l Le	vel	of P	rote	ction
Controlled Zone			8	С	D	1	2	3	othe
			В	С	D	1	2	3	othe
			В	С	D	1	2	3	othe
<u></u>	· · · · · · · · · · · · · · · · · · ·		8	С	D	1	2	3	othe
		<u></u>	8	C	D	1	2	3	othe
econtamination Zone			В	C	D	1	2	3	othe
			В			1			othe
			8	С	D	1	2	3	othe
	irline	Half face	Air Puri	fyin	g Re	spir	ator		
Pressure demand a Pressure demand S	irline with escape provisions	Full faceFull faceStandardHard hat,Ear prote	Air Puri canister work clot steel to	Air hes ed b	Pur oots	ifyi , sa	ng R fety	espi gla	sses
	· ·	Full face Full face Standard Hard hat,	Air Puri canister work clot steel to ction dur	Air hes ed b	Pur oots dril	ifyi , sa l ri	ng R fety g op	espi gla erat	sses ion
	CBA	Full face Full face Standard Hard hat, Ear prote	Air Puri canister work clot steel to ction dur	Air hes ed b	Pur oots dril	ifyi , sa l ri	ng R fety g op	espi gla erat	sses ion
Pressure demand S Level Standard works cl Hard hat, steel t	CBA Level othes oed boots, safety glasses ring drill rig operation	Full face Full face Standard Hard hat, Ear prote Inner lat Outer NBR	Air Puri canister work clot steel to ction dur	Air hes ed b	Pur oots dril	ifyi , sa l ri	ng R fety g op	espi gla erat	sses ion

NO CHANGES TO THE SPECIFIED LEVELS OF PROTECTION SHALL BE MADE WITHOUT THE KNOWLEDGE AND APPROVAL OF THE HEALTH AND SAFETY OFFICER AND THE PROJECT MANAGER

				SPECIAL TASK						
Groundwater	Monitoring	Program	Subcontractor	HEALTH AND	SAFETY	PLA				

Page <u>8</u> of <u>14</u> Job No.

17.	n.	_	_	٠	2	:		٠	ŧ.	~~
1/_	120	~	•	ĸ.	82	1	nа	T I	21	

Personnel and equipment leaving the Controlled Zone shall proceed through the following decontamination stations and procedures from the decontamination zone:

Personnel Decontamination

Station

Procedure

Equipment Decontamination

<u>Station</u>

<u>Procedure</u>

The following decontamination equipment is required:

Emergency decontamination procedures:

Groundwater Monitoring Program Subcontractor	SPECIAL TASK HEALTH AND SAFETY	PLAN Page 9 of 14
18. Confined Entry Procedures	Not Applicable	
Yes N/A	Yes N/A	
Provide Forced Ventilation		tefer to Personal Protective Equip. (#16)
Test Atmosphere For:	R	tefer to Emergency Procedures (#29)
(a) %0 ₂	0	other Special Procedures
(b) %LEL		
(c) Other		·
Descriptions/Other:		

	Cutting	Justicing Procedure Not Applicable
Yes	N/A	
_		Relocate or Protect Combustibles
		Wet Down or Cover Combustible Floor
		Check Flammable Gas Concentrations (%LEL) in air
_		Cover Wall, Floor, Duct and Tank Openings
_		Provide Fire Extinguisher

Other Special Instructions:

Groundwater Monitoring Program Subcont	SPECIAL TASK TRACTOR HEALTH AND SAFETY PLAN	Page <u>10</u> of <u>14</u> Job No.
20. Onsite Organization and Coordinat		
Project Manager:		
Field Team Leader: Site Safety Officer:		
Field Team Mamme	Job Function	
·		
		· · · · · · · · · · · · · · · · · · ·

21. Special Instructions

Groundwater Monitoring Program Subcon	SPECIAL TASK tractor HEALTH AND SAFETY		Page <u>11</u> of <u>14</u> Job No.
22. Sanitation Requirements			
Potable water supply available	on work site?	Yes	
Portable toilets required on w	ork site?	Yes If Yes, No	how many?
Temporary washing/shower facil	ities required at work site	No If no,	
Description:			
23. Field Procedures Change Authoriz	ation		
Instruction Number	Duration of Authoriz	ation Requested	Date:
to be changed	Today only Duration of Task		
Description of Procedures Modificati	on:		
Justification:	<u> </u>		
·		·	
Person Requesting Change:	Verbal Authorization Re	eceived From:	
Name ,	Name		Time
Title		Title	
Signature		Approved By	

(Signature of person named above to be obtained within 48 hours of verbal authorization)

SPECIAL TASK Groundwater Monitoring Program Subcontractor HEALTH AND SAFETY PLAN	Page <u>12</u> of <u>14</u> Job No.
24. Emergency Procedures This page is to be posted at prominent location on site.	
Yes No On-site Communications Required? Emergency Channel	
Nearest Telephone	
Fire and Explosion In the event of a fire or explosion, if the situation can be readily controlled with available jeopardizing the health and safety of yourself, the public, or other site personnel, take impose, otherwise:	
 Notify emergency personnel by calling If possible, isolate the fire to prevent spreading. Evacuate the area 	
Chemical Exposure Site workers must notify the site health and safety officer immediately in the event of any is signs or symptoms of overexposure to hazardous substances identified below:	injury or any of the

Symptoms of Acute Exposure

<u>Substances Present</u>

First Aid

SPECIAL TASK
Groundwater Monitoring Program Subcontractor HEALTH AND SAFETY PLAN

Page $\underline{13}$ of $\underline{14}$ Job No.

24. Eme	rgency	Procedures	-	Cont'd
---------	--------	-------------------	---	--------

On Site Injury Or Illness

exposure to hazardous substances, immediately t	take the victim to	located at
, phone In the	e event of life-threater	ning or traumatic injury, implement
appropriate first-aid and immediately call for		
designated trauma center is	located at	, phone
		·
Designated Persor	nnel Current in First Ai	d/CPR (Names)
	<u> </u>	
	•	
Designated Back-Up Personnel (Names)		Function
	•	
•		•
Required	Emergency Back-Up Equi	pment
Emergency Response Authority		
		d site emergency coordinator and has final
authority for first response to on-site e	mergency situations.	
Upon purityal of the appropriate amongones	recognic personnel th	e site emergency coordinator shall defer all
authority but shall remain on the scene i	•	•
earliest opportunity, the site safety off	•	•
coordinator or health and safety officer.		ncy coordinator shall contact the project
coolumnator or health and safety officer.		
Project Coordinator	Phone (u)	(h)
		(11)
Health and Safety	Phone (w)	(h)
		\''/

Groundwater Monitoring Program Subcontractor	SPECIAL TASK HEALTH AND SAFETY PLAN	Page <u>14</u> of <u>14</u> Job No.
25. Safety Briefing		•
The following personnel were present a(date) at with its provisions:	pre-job safety briefing conducted a conducted (location), and have read	
Name	Signatu	re
		:
Fully charged ABC Class fire extinguisher averaged Fully stocked First Aid Kit available on site All project personnel advised of location of All project personnel advised of location of	? nearest phone?	YES YES YES Lities? YES
	Printed Name of Field Team Leade	r or Site Safety Officer
	Signature	Date

.

TABLE C-1

ANALYTE CONCENTRATIONS FOR COMBINED OPERABLE UNITS 1-16 AND UPPER AND LOWER SOUTH INTERCEPTOR DITCHES (Concluded)

	Groundwater			Surface	: Water			Soils ,		Sediments		
Parameter	Maximum+	Minimum++	Potential ARAR	Maximum ⁺	Minimum++	Potential ARAR	Maximum *	Minimum ⁺⁺	Potential** ARAR	Maximum*	Minimum++	Potential** ARAR
POLYCHLORINATED BIPHENY	LS (PCBs) (µg/L)		·									
Aroclor-1254				12 1.0 1.0		1.0	440000		0.09	1600000	160	

NOTE: Analytical data received prior to October 1988 not subjected to validation procedure. Some of the chemical values reported in this table have not yet been validated, and the analyte list may be changed after the data are validated.

Present in laboratory blank
These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.
Analyzed below detection limit
Bedrock (including some weathered bedrock)
Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.
Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program.
Plutonium 238+239+240
Radium 226+228
Ammonia as N
Sum of polychlorinated biphenyls (PCBs) in water

TABLE C-1

		Gr	oundwater			Surfac	e Water				Soils			Sediments		
Parameter	Maxim	um+	Minimum**	Potential ARAR	Maxim	um+	Minimum++	Potential ARAR	Maxim	um +	Minimum++	Potential** ARAR	Maxir	num*	Minimum++	Potential** ARAR
N-Nitroso-di-n-Propylamine					5	J	10	10								
N-Nitrosodiphenylamine	162	•	10	10	300		10	10	880	J	330	•	2000	•	330	
Pentachlorophenol	4.0	J	50	50	20	J ·	50	50	110	J	1600	200000	350	J	1600	
Phenanthrene	1				6.0	J	10	10	500	J	330		16000		330	
Phenol	1.0	J	10	10	39		10	10	320	J	330	3000000	660	j	330	
Prometon	İ				0.09		0.03				•					
Prometryn	}				0.18		0.06									
Propazine				•	2.4		0.03									
Pyrene	I		•		4	j	10	10	880	J	330		19000		330	
Simazine					330		0.06	4.0								
Simetryn	1			j	0.64		0.07									
Terbuthylazine	}			i	1.4							.,				•
1,2,4-Trichlorobenzene	l			ı	4		10	700	l			i	4.0	J	330	

Present in laboratory blank
These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.

Analyzed below detection limit

Bedrock (including some weathered bedrock)

Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.

Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program. Plutonium 238 + 239 + 240

Radium 226 + 228

Ammonia as N

Ammonia as N
Sum of polychlorinated biphenyls (PCBs) in water

TABLE C-1

		Gro	undwater			Surface Water					Soils			Sedimen	ıts	
Parameter	Maximo	ım+	Minimum++	Potential ARAR	Maxim	um*	Minimum+•	Potential ARAR	Maxim	um+	Minimum**	Potential** ARAR	Maxir	num+	Minimom++	Potential** ARAR
Dichloroprop					1.8		0.65									 -
Diethyl Phthalate	ļ				6.0	3	10	23000	31		330	60000000	1200		330	
Di-n-Butyl Phthalate	170	J BR	10	10	20	•	10	10	3643	j	330	8000000	3100		330	
Di-n-Octyl Phthalate	56	J BR	10		24	•	10		370	J	330		2000		330	
2,4-Dimethylphenol	ł				6.0	J	10	2120			•					
2,4-Dinitrotoluene	1				4.0	J	10	10			•					
Endosulfan	ľ												1600	J	· 8.0	
Ethyl Parathion	0.04				270			0.13								•
Fluoranthene	10		10		2.0	J	10	42	1900		330		16000		330	
Fluorene				i	3.0	J	10	10	350		330		2000	J	330	
Gamma-BHC (Lindane)	ļ								i				50		8.0	
Hexachlorobenzene					:								440	3	330	
Indeno (1,2,3-cd) Pyrene									80	J	330		5000	J	330	
Isophorone					1.0	J	10	10				i				
2-Methylnaphthalene	1				21	J	10						350	J	330	
2-Methylphenol					43 .		10						2300		330	
4-Methylphenol					160		10						2300		330	
Naphthalene					25		10	10					1100	J	330	
2-Nitrophenol	3.0	J	10													
4-Nitrophenol	2.0	J	50						160	J	1600				•	
4-Nitroaniline	1			1				ŀ					5300	1	1600	

- Present in laboratory blank
 These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.

 Analyzed below detection limit

 Bedrock (including some weathered bedrock)

 Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.

 Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program.

 Plutonium 238+239+240

 Radium 226+228

 A meronic as N.

- Ammonia as N
 Sum of polychlorinated biphenyls (PCBs) in water
- Source: U.S. Department of Energy. March 1992. Annual Report for Treatability Studies at Rocky Flats Plant Fiscal Year 1991. This table was reproduced precisely from a previous report.

TABLE C-1

		Gro	undwater			Surfa	ce Water				Soils			Sediments	_	
Parameter	Maxim	ium+	Minimum++	Potential ARAR	Maxim	um+	Minimum**	Potential ARAR	Maxim	num *	Minimum**	Potential** ARAR	Maxin	num ⁺	Minimum++	Potential** ARAR
Benzo (a) Anthracene					2.0	J	10	10	120]	330	224	7100		330	
Benzo (b) Fluoranthene	i				3.0	J	10	10	350	J	330		7100		330	
Benzo (k) Fluoranthene				ļ	4.0	j	10	10	320	J	330		6300		330	
Benzo (g,h,i) Perylene	ļ						•		50	J	330	-	5700		330	
Benzo (a) Pyrene	1				3.0	J	10.0	10	230	3		60.9	6300		330	
Benzo (k) Pyrene	1								130	J	330					
Benzoic Acid	1			1	8.0	J	50		400	J	1600		3300	J	1600	
Benzyl Alcohol	ĺ				43		10		1							
Beta-BHC					0.1		0.05	0.05					13000		8.0	
Bis (2-ethylhexyl) Phthalate	100	J BR	10	10	220		10	10	18000	•	330	83000	41		330	
Butyl Benzyl Phthalate	2.0	J	10		3.0	J	10	3000	510	J	330		540	J	330	
4-Chioro-3-methylphenol				Į	1.0	J	10	30	740		330					•
4-Chlorophenyl Phenyl Ether				İ					40	J	330					
Chrysene	420		10	}	2.0	J	10	10	550	J	330		8200		330	
Cyanazine					0.3		0.1									
4,4-DDT				- 1	0.06	J	0.1	0.1					95		16	
Delta-BHC				ì	0.02		0.05						3.2	J	8.0	
Dibenzo (a,h) Anthracene]				-					1200	-	330	
Dibenzofuran				İ	1.0	J							1000	1		
Dicamba				1	2.1		0.27							•		
1,4-Dichlorobenzene				Į.	4.0	1	10	75					1	, ,		

- Present in laboratory blank
 These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.
 Analyzed below detection limit
 Bedrock (including some weathered bedrock)
 Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.
 Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program.
 Plutonium 238+239+240
 Radium 226+228
 Ammonia as N
 Sum of polychlorinated biphenyls (PCBs) in water

- Source: U.S. Department of Energy. March 1992. Annual Report for Treatability Studies at Rocky Flats Plant Fiscal Year 1991. This table was reproduced precisely from a previous report.

TABLE C-1 ANALYTE CONCENTRATIONS FOR COMBINED OPERABLE UNITS 1-16 AND UPPER AND LOWER SOUTH INTERCEPTOR DITCHES

		Groundwater				Surface	Water		Soils					Sediments		
Parameter	Maxin	num ⁺	Minimum++	Potential ARAR	Maxim	ım+	Minimum++	Potential ARAR	Maxim	um +	Minimum**	Potential** ARAR	Maxim	ium+	Minimum++	Potential** ARAR
Dibromochloromethane				-	5.0		5.0	6.0			. ,				-	
Ethylbenzene	16		5.0	680	18		5.0	680	780		5.0	8000000	4.0		5.0	•
Methylene Chloride	4100		5.0	5.0	340		5.0	5.0	590	BR	5.0	93000	16000		5.0	
Styrene	9		5.0	100	6.0		5.0	100	17	J	5.0	23000	2.0	J	5.0	
Tetrachloroethene	528000		5.0	5.0	280		5.0	5.0	10000		5.0	140000	8.0		5.0	
Toluene	270	J	5.0	1000	94		5.0	1000	860		5.0	20000000	120		5.0	
Trichloroethene	221860		5.0	5.0	2500		5.0	5.0	17000		5.0	64000	39		5.0	
Vinyl Acetate	39	J	10		3.0	J	10									
Vinyl Chloride	930		10	10	25		10	10					57	J	10	
Xylenes (Total)	50	J	5.0	10000	40		5.0	10000	3300		5.0	200000000	7.0	J	5.0	
SEMIVOLATILES (TOTAL) (1	ug/L)				(ug/L)				(ug/kg)	_			(pg/kg)			<u> </u>
Acenaphthene					5.0	J	10	520	57	J	330		2400	J	330	
Acenaphthylene													450	J	330	
Aldrin					0.06		0.05	0.05			•					
Alpha-BHC	ľ				0.01	j	0.05	0.05					4.7	J	8.0	
Alpha-chlordane					2.6		0.5	0.5								
Ametryn					0.18		0.06									
Anthracene	1				2.0	J	10	10	180	J	330		2900	J	330	
Atrazine	1				2720.0	-	0.05	3.0	l				Į.			

- Present in laboratory blank
 These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.
 Analyzed below detection limit
 Bedrock (including some weathered bedrock)
 Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.
 Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program.
 Plutonium 238+239+240
 Radium 226+228
 Ammerica 48

- Ammonia as N
- Sum of polychlorinated biphenyls (PCBs) in water
- Source: U.S. Department of Energy. March 1992. Annual Report for Treatability Studies at Rocky Flats Plant Fiscal Year 1991. This table was reproduced precisely from a previous report.

TABLE C-1 ANALYTE CONCENTRATIONS FOR COMBINED OPERABLE UNITS 1-16 AND UPPER AND LOWER SOUTH INTERCEPTOR DITCHES

(Continued)

Parameter	Groundwater			Surface Water				Soils				``	Sediments			
	Maxim	um ⁺	Minimum++	Potential ARAR	Maxim	um+	Minimum++	Potential ARAR	Maximu	ım+	Minimum**	Potential** ARAR	Maxin	ıum+	Minimum+•	Potential®
1,1,2-Trichloroethane	14740		5.0	5.0	6.0		5.0	5.0	62		5.0	120000				
1,1,2,2-Tetrachloroethane	15		5.0	5	440		5.0	5.0								
1,2-Dichloroethane	16000		5.0	5	23				120		5.0	7700				
1,2-Dichloroethene (Total)	14000		5.0	100	460		5.0	100	140		5.0					
1,2-Dichlorópropane	6		5.0	5	7.0		5.0	5.0	3.0		5.0					
1,3-Dichloropropene	3	J	5.0		7.0		5.0	10	6.0	J	5.0	3900				
2-Butanone	580		10	1	7 6		10		530		10.0		12000		10	
2-Chloroethylvinylether					5.0	J			31	J	10.0					
2-Hexanone	975		10		87				41							
4-Methyl-2-Pentanone	35		10.0		32	•	10		120	j	10		220	•	10	
Acetone	4100	J•	10.0	4000	970	•	10	4000	2400	•	10	8000000	7300		10	
Benzene	83	J	5.0	5.0	. 83		5	5	12	J	10	24000	3.0	J	10	
Bromodichloromethane	1.0	J	5.0	5.0	.6.0		5	700			•					
Bromoform	1.0	J	5.0	5.0	3.0	J	5	700								
Bromomethane	7.0	J	10.0	10	8.0	J	10	48	6.0	J	10 -	30000				
Carbon Disulfide	28		5.0	4000	29		5.0	4000	150			8000000	13	J	5.0	
Carbon Tetrachloride	28000		5.0	5.0	1005		5.0	5.0	180	•	5.0	5400				
Chlorobenzene	73		5.0	Ĺ	94		5.0	100	150		55	2000000	4.0	J	5.0	
Chloroethane	17		10.0	f	34		10		50	J	10					
Chloroform	5427		5.0	5.0	84		5.0	5.0	130	J	5.0	110000	18		5.0	
Chloromethane	l 17		10.0	ļ	38		10				•		l 60		10	

Present in laboratory blank
These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.
Analyzed below detection limit
Bedrock (including some weathered bedrock)
Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.
Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program.
Plutonium 238 + 239 + 240
Radium 226 + 228
Ammonia as N
Sum of polychlorinated biphenyls (PCBs) in water

C-4

TABLE C-1

	Gr	oundwater		Surfac	e Water			Soils		Sedimen	ts	
Parameter	Maximum+	Minimum++	Potential ARAR	Maximum ⁺	Minimum + +	Potential ARAR	Maximum	* Minimum**	Potential** ARAR	Maximum [†]	Minimum++	Potential** ARAR
Gross Alpha	2000	2.0	7.0	2107	2.0	7.0	480	4.0	5.0	77	4.0	5.0
Gross Beta	1200	4.0	5.0	3800	4.0	5.0	49.9	10	50.0	53	10	50
Plutonium 238	0.040	0.01	0.05	0.031	0.01				·	0.016	0.03	•
Plutonium 239 + 240	8.13	0.01	15(a)	120	0.01	15(a)	180	0.03	0.9	3.3	0.03	0.9
Radium 226	3.54	0.5	5(b)	30	0.5	5(b)	1.9	0.5	!	1.96	0.5	
Radium 228	13.95	1.0	5(b)	52	0.5	5(b)	2.8	2.0		4.41	0.5	
Strontium 89 + 90	7.52	1.0	1	4.27	1.0		1.9	1	,	2.53	1	
Strontium 90	.12.4	1.0	8.0	33.34	1.0	8.0	4.57	1 '		0.99	. 1	
Tritium	12000	400	500	13000	400	500	3.9	400		580	400	
Uranium 233 + 234	1000	0.6		1050	0.6		3.7	0.3		4.11	0.3	
Uranium 233 + 238 + 239	16.9	0.6	i	14.31	0.6					3.32	0.3	
Uranium 235	47	0.6		65.5	0.6		1.01	0.3		1.34	. 0.3	
Uranium 235 + 236	6.90	.0.6]	47.5	0.6		•		•	0.15		
Uranium 238	750	0.6	1	1211	0.6		3.9	0.3	•	3.82	0.3	
Uranium (Total)	63.7	0.6	5	1023	0.6	5.0	4.0	BR 0.3		4.8	0.3	
VOLATILES (mg/L)		_		(ug/L)			(ug/kg)	. •		(æg/kg)		
1,1-Dichloroethane	344	5.0		50	5.0		49	5	-			
1,1-Dichloroethene	48000	5.0	7	143	5.0	7.0	110	• 5	12000	5.0 J	5.0	
1,1,1-Trichloroethane	l ₃₀₂₅₀	5.0	200 l	42	5.0	200	l ₂₉₀	5.0	7000000	l 3.0 ј	5.0	

Present in laboratory blank
These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.
Analyzed below detection limit
Bedrock (including some weathered bedrock)
Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.
Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program.
Plutonium 238+239+240
Radium 226+228
Ammonia as N

Ammonia as N Sum of polychlorinated biphenyls (PCBs) in water

Source: U.S. Department of Energy. March 1992. Annual Report for Treatability Studies at Rocky Flats Plant - Fiscal Year 1991. This table was reproduced precisely from a previous report.

TABLE C-1

	Groundwater			Surf	ace Water	•		Soils		Sediments		
Parameter	Maximum *	Minimum++	Potential ARAR	Maximum *	Minimum+•	Potential ARAR	Maximum*	Minimum**	Potential** ARAR	Maximum ⁺	Minimum + •	Potential* ARAR
Selenium	100.3	0.005	0.010	0.55	0.005	0.005	6.5	1.0		21.3	1.0	
Silicon	56.4	0.010		44	0.010		İ			2470	4.6	
Silver	0.217	0.010	0.050	0.148	0.010	0.010	40.9	2.0	200	411	2.0	
Sodium	4447	5.000	ļ	9030	5.000		44000	2000		1480 •	2000	
Strontium	82.4	0.200		11.9	0.200		1030	40		1230	40	
Thallium	0.544	0.050		0.029	0.050	0.050	5.74	2.0		90	2.0	
Tin	1.121	0.200	1	1.53	0.200		382	40		1080	40	
Vanadium	0.85	0.050	0.1	1.65	0.050		2590	10		90.4	10	
Zinc	5.0	0.020	2.0	28.7	0.020	0.110	487	4.0		735	4.0	
ANIONS (mg/L)				(mg/L)			(mg/kg)	,		(mg/kg)	•	
Ammonia				ట	0.5	0.5						
Chloride	1100	5.0	250	1200	5.0	230	20			210	•	
Cyanide	3.8	0.01	0.2	0.6	0.01	0.01	19.8			1.0		
Fluoride	8.2	5.0	5.0	7.7	5.0	5.0	1					
Nitrate as N	1450	5.0	10.0	1186	5.0	10.0	4.3			35.86		_
RADIONUCLIDES (TOTAL A	AND DISSOLVED) (pCi/L)		(pCi/L)			(pCi/g)			(pCi/g)		
Americium 241	9.68	0.01		90	0.01	30	22	0.02		1.467	0.02	<u> </u>
Cesium 137	7.72	1.0	1	12	1.0		4.7	0.1		3.2	0.1	

Present in laboratory blank
These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.
Analyzed below detection limit
Bedrock (including some weathered bedrock)
Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.
Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program.
Plutonium 228+239+240
Radium 226+228
Ammonia as N
Sum of polychlorinated biphenyls (PCBs) in water

Source: U.S. Department of Energy. March 1992. Annual Report for Treatability Studies at Rocky Flats Plant - Fiscal Year 1991. This table was reproduced precisely from a previous report.

TABLE C-1 ANALYTE CONCENTRATIONS FOR COMBINED OPERABLE UNITS 1-16 AND UPPER AND LOWER SOUTH INTERCEPTOR DITCHES!

	Gre	oundwater		Surface	Water	-1		Soils		Sedime	nts	
Parameter	Maximum+	Minimum**	Potential ARAR	Maximum +	Minimum**	Potential ARAR	Maximum+	Minimum**	Potential** ARAR	Maximum*	Minimum++	Potential** ARAR
METALS (TOTAL AND DISSO	OLVED) (mg/L)			(mg/L)	•		(mg/kg)			(mg/kg)		<u> </u>
Aluminum	37.7	0.200	0.2	293	0.200	0.200	70600	40		33900	40	
Antimony	0.628	0.060		0.643	0.060	0.060	57	12	30	69.7	12	
Arsenic	3.0	0.010	0.05	1.03	0.010	0.05	64	2.0		49.2	2	
Barium	0.943	0.200	1.0	11600	0.200	1.0	1899	40	4000	706	40	
Beryllium	0.04	0.005	0.1	0.170	0.005	0.005	18.3	1.0	0.143	15.5	1.0	
Boron	0.218	5.0	5.0								•	
Cadmium	0.0352 BR	0.005	0.005	.25	0.005	0.005	119	1.0]	19.5	1.0	
Calcium	99.9 BR	5.000	Í	1590	5.000		254000	2000		132000	2000	
Cesium	0.4	1.000		12	1.000		2410	200		700 *		
Chromium	0.172 BR	0.010	0.05	0.298	0.010	0.05	781	2.0	8000(111)	64 -	2.0	
Cobalt	0.22	0.050	0.05	0.489	0.050		88.9	10		43.3	10	
Copper	3.13	0.025	0.2	0.908	0.025	0.025	<i>7</i> 3.6	5.0		275	5.0	
iron	76.6	0.100	0.3	3220	0.100	0.30	75900	20		33300	20	-
Lead	2.8	0.005	0.05	0.950	0.005	0.005	86.9	1.0		255	1.0	
Lithium	1.79	0.100	2.5	85.2	0.100		100	20		958	20	
Magnesium	788	5.000	1	391	5.000		23300	2000		103000	2000	
Manganese	11.34	0.015	0.05	27.7	0.015	0.050	3540	3.0		1950	3.0	
Mercury	0.013	0.0002	0.002	3.97	0.0002	0.0002	. 114	0.2		٠ کـ1	0.2	
Molybdenum	1.92 BR	0.200	. [0.680	0.200]	38.65	40		177	40	
Vickel	11.7	0.040	0.2	0.82	0.040	0.4	543	8.0	2000	89.2	8.0	
Phosphorus	1.210	0.040	!	12	0.040	· ·				655	200	
Potassium	l 7050	5.000	- 1	4260	5.000	l	8020	2000	Į	67000	2000	

Present in laboratory blank
These are based on human health and environmental risk assessment criteria developed for screening purposes, or applicable state or federal requirements.
Analyzed below detection limit
Bedrock (including some weathered bedrock)
Maximum concentration may be a one-time measurement. Values compiled from both recent and historic data, checked against Rocky Flats Environmental Data System.
Value given is detection or quantitation limit for analysis, in accordance with Statement of Work for General Radiochemistry and Routine Analytical Services Protocol (G.R.R.A.S.P.), v.1.1, 1990, EG&G Rocky Flats Environmental Restoration Program.
Plutonium 238+239+240
Radium 226+228
Ammonia as N
Sum of polychlorinated biphenyls (PCBs) in water

